

**MUDDY RUN II STREAM AND WETLAND RESTORATION
PROJECT
MONITORING REPORT
MONITORING YEAR 7
FINAL**

DUPLIN COUNTY, NORTH CAROLINA
DMS CONTRACT No. 004631 – DMS PROJECT No. 95354
SAW-2011-02191
DWR 2013-0653



Prepared for:

Division of Mitigation Services

North Carolina Department of Environment and Natural Resources
1652 Mail Service Center
Raleigh, NC 27699-1652

March 2021

Mitigation Project Name **Muddy Run II Site**
 DMS ID **95354**
 River Basin **Cape Fear**
 Cataloging Unit **03030007**
 County **Duplin**

USACE Action ID **2012-01387**
 DWR Permit **2013-0653**
 Date Project Instituted **8/1/2012**
 Date Prepared **4/21/2020**
 Stream/Wet. Service Area **Cape Fear 03030007**



Signature & Date of Official Approving Credit Release

- 1 - For NCDMS, no credits are released during the first milestone
- 2 - For NCDMS projects, the initial credit release milestone occurs automatically when the as-built report (baseline monitoring report) has been made available to the IRT by posting it to the DMS portal, provided the following have been met:
 - 1) Approved of Final Mitigation Plan
 - 2) Recordation of the preservation mechanism, as well as a title opinion acceptable to the USACE covering the property.
 - 3) Completion of all physical and biological improvements to the mitigation site pursuant to the mitigation plan.
 - 4) Receipt of necessary DA permit authorization or written DA approval for projects where DA permit issuance is not required.
- 3 - A 10% reserve of credits is to be held back until the bankfull event performance standard has been met.

Credit Release Milestone	Warm Stream Credits						
	Scheduled Releases %	Proposed Releases %	Proposed Released #	Not Approved # Releases	Approved Credits	Anticipated Release	Actual Release
1 - Site Establishment	N/A	N/A	N/A	N/A	N/A	N/A	N/A
2 - Year 0 / As-Built	30.00%	30.00%	3,221.640	0.000	3,221.640	2014	10/3/2014
3 - Year 1 Monitoring	10.00%	10.00%	1,073.880	0.000	1,073.880	2015	4/23/2015
4 - Year 2 Monitoring	10.00%	10.00%	1,073.880	0.000	1,073.880	2016	4/26/2016
5 - Year 3 Monitoring	10.00%	10.00%	1,073.880	0.000	1,073.880	2017	10/20/2017
6 - Year 4 Monitoring	5.00%	5.00%	536.940	0.000	536.940	2018	4/25/2018
7 - Year 5 Monitoring	10.00%	10.00%	1,073.880	0.000	1,073.880	2019	4/26/2019
8 - Year 6 Monitoring	5.00%	5.00%	536.940	0.000	536.940	2020	4/21/2020
9 - Year 7 Monitoring	10.00%					2021	
Stream Bankfull Standard	10.00%	10.00%	1,073.880	0.000	1,073.880	2016	4/26/2016
			Totals	0.000	9,127.980		

Total Gross Credits	10,738.800
Total Unrealized Credits to Date	0.000
Total Released Credits to Date	9,127.980
Total Percentage Released	90.00%
Remaining Unreleased Credits	1,610.820

Credit Release Milestone	Riparian Credits						
	Scheduled Releases %	Proposed Releases %	Proposed Released #	Not Approved # Releases	Approved Credits	Anticipated Release	Actual Release
1 - Site Establishment	N/A	N/A	N/A	N/A	N/A	N/A	N/A
2 - Year 0 / As-Built	30.00%	30.00%	1.476	0.000	1.476	2014	10/3/2014
3 - Year 1 Monitoring	10.00%	10.00%	0.492	0.000	0.492	2015	4/23/2015
4 - Year 2 Monitoring	10.00%	10.00%	0.492	0.000	0.492	2016	4/26/2016
5 - Year 3 Monitoring	15.00%	15.00%	0.738	0.000	0.738	2017	10/20/2017
6 - Year 4 Monitoring	5.00%	5.00%	0.246	0.000	0.246	2018	4/25/2018
7 - Year 5 Monitoring	15.00%	15.00%	0.738	0.000	0.738	2019	4/26/2019
8 - Year 6 Monitoring	5.00%	5.00%	0.246	0.000	0.246	2020	4/21/2020
9 - Year 7 Monitoring	10.00%					2021	
Stream Bankfull Standard	N/A	N/A	N/A	N/A	N/A	N/A	N/A
			Totals	0.000	4.428		

Total Gross Credits	4.920
Total Unrealized Credits to Date	0.000
Total Released Credits to Date	4.428
Total Percentage Released	90.00%
Remaining Unreleased Credits	0.738

Mitigation Project Name Muddy Run II Site
 DMS ID 95354
 River Basin Cape Fear
 Cataloging Unit 03030007
 County Duplin

USACE Action ID 2012-01387
 DWR Permit 2013-0653
 Date Project Instituted 8/1/2012
 Date Prepared 4/21/2020
 Stream/Wet. Service Area Cape Fear 03030007

Notes

Contingencies (if any)

Project Quantities

Mitigation Type	Restoration Type	Physical Quantity
Warm Stream	Restoration	9,976.000
Warm Stream	Enhancement I	708.000
Warm Stream	Enhancement II	727.000
Riparian	Restoration	4.920

Debits

Stream Restoration Credits	Riparian Restoration
----------------------------	----------------------

Beginning Balance (mitigation credits)							10,738.800	4.920
Released Credits							9,127.980	4.428
Unrealized Credits							0.000	0.000
Owning Program	Req. Id	TIP #	Project Name	USACE Permit #	DWR Permit #	DCM Permit #		
Statewide Stream & Wetland ILF Program	REQ-003339		Parson's Mill	2004-01067	2007-1158		297.000	
Statewide Stream & Wetland ILF Program	REQ-003541		North New Hanover 10-inch Pipeline	2007--2785			12.000	
Statewide Stream & Wetland ILF Program	REQ-004453	R-2405A	DOT - I-40 Connector Porters Neck	1994-03620	2000-1426		71.000	
Statewide Stream & Wetland ILF Program	REQ-004878		Olsen Farm Project Park	2008-1284	2008-0815		149.000	
Statewide Stream & Wetland ILF Program	REQ-005549		GE-Hitachi Global Laser Enrichment Facility	2008-00188	2012-0478		158.000	
Statewide Stream & Wetland ILF Program	REQ-005600		ILM Security Fence Wilmington Airport	2010-00280	2008-1167		214.000	
Statewide Stream & Wetland ILF Program	REQ-006101		ILM Runway 24 Critical Area	2011-00455	2013-1263		1,069.000	
Statewide Stream & Wetland ILF Program	REQ-006300		The Reserve on Island Creek	2014-01310	2015-0072		24.000	
Total Credits Debited							1,994.000	0.000
Remaining Available balance (Released credits)							7,133.980	4.428
Remaining balance (Unreleased credits)							1,610.820	0.492

**Muddy Run II
Duplin County, North Carolina
DMS Project ID 95354**

**Cape Fear River Basin
HUC 0030007060010**

Prepared by:



**Resource Environmental Solutions, LLC
3600 Glenwood Ave, Suite 100
Raleigh, NC 27612
919-209-1061**



3600 Glenwood Avenue, Suite 100
Raleigh, NC 27612

Corporate Headquarters
6575 West Loop South, Suite 300
Bellaire, TX 77401
Main: 713.520.5400

March 24, 2021

Lindsay Crocker
NC DEQ Division of Mitigation Services
217 West Jones Street
Raleigh, NC 27604

RE: Muddy Run II Stream and Wetland Restoration Site: MY7 Monitoring Report
(NCDMS ID 95354)

Listed below are comments provided by DMS on December 17, 2020 regarding the Muddy Run II Stream and Wetland Restoration Site: Year 7 Monitoring Report and RES' responses.

1. Page 11, Vegetation. Please describe pine thinning that occurred in MY7 along 3b (how large was the thinning, approx.). Also describe the replanted encroachment areas (extent of replanted area, how many trees, species). These two should be separated.

There were three methods of pine thinning performed in three separate areas on site. Along Reach 1 stump cut was used to cut pine trees down (0.28 acres), along Reach 3b the area was mulched with a skid-steerer (0.23 acres), and along Reach 5a the pine trees were girdled (0.25 acres). The areas along Reach 1 and Reach 3b required supplemental plantings which were performed in January 2021 and consisted of 160 3-gallon trees (sycamore, river birch, willow oak, and overcup oak). The two encroachment areas on Reach 3a were caused by missing easement poles and mowing which were repaired in January 2021. These areas total about 0.13 acres and were planted with 60 3-gallon trees (sycamore, river birch, willow oak, and overcup oak). The other encroachment area, Reach 5a, was an area where ATVs were cutting across the easement. This area (0.03 acres) was repaired and replanted in January 2021 (15 3-gallon sycamore, river birch, willow oak, and overcup oak). As of March 2021, no further encroachment has occurred.

2. Page 11, vegetation. It is shown on timeline table 2 and was discussed in the field that RES has conducted ongoing privet treatment throughout project. Please describe this in the narrative (target species, targeted areas).

Invasive species and pines were treated in October 2020 and will be treated again prior to close-out. Invasive species treatment including cutting and stump spraying large Chinese privet stems and foliar spraying smaller/re-sprouted Chinese privet plants. The majority of the invasive species treatment took place along Reach 2 and Reach 3.

3. CCPV: Please separate the pine thinning shapefile from the encroachment shapefile with different colors and show the extent of both areas (in acres). Confirm if / when both were planted.
Done.



4. Add the overhead ROW on reach 3b near the turkey houses to the CCPV and check that this ROW was removed from credit on the as-built stationing for credit. If it was not considered, determine width of ROW and impact on credit and separate on asset table for removal.

The powerline ROW has been added to the map. The powerline was installed directly along the outside easement edge but due to its 30-foot easement, 13 linear feet of Reach 3b are not creditable. Information about this has been added to Section 1.3.

5. Coordinate with stewardship to ensure all marking is upright and clear, ensure a long-term solution to the crossing encroachment on 5b. Revise report to reflect this.

RES has replaced all damaged/missing easement signs. There has been no further encroachment since the addition of the t-posts/signs on Reach 5b and there is evidence of ATV traffic across the crossing/easement break upstream on Reach 5a.

TABLE OF CONTENTS

1 PROJECT GOALS, BACKGROUND AND ATTRIBUTES..... 1
 1.1 Location and Setting.....1
 1.2 Project Goals and Objectives.....1
 1.3 Project Structure3
 1.3.1 Restoration Type and Approach.....3
 1.4 Project History, Contacts and Attribute Data6
 1.4.1 Project History.....6
 1.4.2 Project Watersheds6
2 SUCCESS CRITERIA 7
 2.1 Stream Restoration7
 2.1.1 Bankfull Events7
 2.1.2 Cross Sections7
 2.1.3 Digital Image Stations7
 2.2 Vegetation8
 2.3 Scheduling/Reporting.....8
3 MONITORING PLAN..... 8
 3.1 Stream Restoration8
 3.1.1 As-Built Survey.....8
 3.1.2 Bankfull Events8
 3.1.3 Cross Sections9
 3.1.4 Digital Image Stations9
 3.1.5 Bank Pin Arrays9
 3.1.6 Visual Assessment Monitoring.....9
 3.1.7 Surface Flow.....9
 3.2 Vegetation10
4 Maintenance and Contingency plan 10
 4.1 Stream.....10
 4.2 Vegetation10
5 YEAR 7 MONITORING CONDITIONS (MY7) 12
 5.1 Year 7 Monitoring Data Collection.....12
 5.1.1 Vegetation.....12
 5.1.2 Photo Documentation12
 5.1.3 Hydrology.....13
6 REFERENCES..... 14

Appendix A. Project Background Data and Maps

Table 1. Project Components and Mitigation Credits
Table 2. Project Activity and reporting History
Table 3. Project Contacts
Table 4. Project Information and Attributes
Figure 1. Project Vicinity Map
Figure 2. Project USGS Map

Appendix B. Visual Assessment Data

Figure 3a-b. Current Conditions Plan View Map (CCPV)
Table 5. Visual Stream Morphology Stability Assessment
Table 6. Vegetation Condition Assessment
Table 7. Stream Problem Areas
Table 8. Vegetation Problem Areas
Figure 4. Vegetation Photos
Figure 5. Stream and Vegetation Problem Photos

Appendix C. Vegetation Plot Data

Table 9a. Planted Stem Count Summary
Table 9b. Planted Species Totals
Table 9c. Planted Stem Counts (Species by Plot)

Appendix D. Stream Geomorphology Data

Table 10. Morphological Parameters Summary Data
Table 11. Dimensional Morphology Summary – Cross Sections Data
Table 12. Bank Pin Array Summary Data
Cross Section Plots

Appendix E. Hydrology Data

Table 13. Documentation of Geomorphologically Significant Flow Events
Table 14. Rainfall Summary
Table 15a. Wetland Hydrology Criteria Attainment
Table 15b. MY1-MY7 Wetland Hydrology Gauges Summary
2020 Groundwater Monitoring Gauge Hydrographs

1 PROJECT GOALS, BACKGROUND AND ATTRIBUTES

1.1 Location and Setting

The Muddy Run Stream Site (“Site”) is located in Duplin County approximately 1.4 miles east of Chinquapin, NC (Figure 1). The project is in the Cape Fear River Basin (8-digit USGS HUC 03030007, 14-digit USGS HUC 03030007060010) (USGS, 1998) and the NCDWQ Cape Fear 03-06-22 sub-basin (NCDWQ, 2002). To access the Site from the town of Chinquapin, travel east on Highway 50, take the first left onto Pickett Bay Road (SR 1819), go 1.1 miles, then turn left onto Kenney Crawley Road. This private road is gravel and will split just past the residential house on the right. Keeping to the left will take you to the Reaches 3b, 3c, 5b, and 6. Going to the right at the split will take you to Reaches 1, 2, 3a, and 4.

1.2 Project Goals and Objectives

The Muddy Run II stream and wetland mitigation project provides numerous ecological and water quality benefits within the Cape Fear River Basin. While many of these benefits are limited to the project area, others, such as pollutant removal and improved aquatic and terrestrial habitat, have more far-reaching effects. Expected improvements to water quality, hydrology, and habitat are outlined below.

Design Goals and Objectives

Benefits Related to Water Quality	
Nutrient removal	Benefit will be achieved through filtering of runoff from adjacent CAFOs through buffer areas, the conversion of active farm fields to forested buffers, improved denitrification and nutrient uptake through buffer zones, and installation of BMPs at the headwaters of selected reaches and ditch outlets.
Sediment removal	Benefit will be achieved through the stabilization of eroding stream banks and reduction of sediment loss from field areas due to lack of vegetative cover. Channel velocities will also be decreased through a reduction in slope, therefore decreasing erosive forces.
Increase dissolved oxygen concentration	Benefit will be achieved through the construction of instream structures to increase turbulence and dissolved oxygen concentrations and riparian canopy restoration to lower water temperature to increase dissolved oxygen capacity.
Runoff filtration	Benefit will be achieved through the restoration of buffer areas that will receive and filter runoff, thereby reducing nutrients and sediment concentrations reaching water bodies downstream.
Benefits to Flood Attenuation	
Water storage	Benefit will be achieved through the restoration of buffer areas which will infiltrate more water during precipitation events than under current site conditions.
Improved groundwater recharge	Benefit will be achieved through the increased storage of precipitation in buffer areas, ephemeral depressions, and reconnection of existing floodplain. Greater storage of water will lead to improved infiltration and groundwater recharge.
Improved/restored hydrologic connections	Benefit will be achieved by restoring the stream to a natural meandering pattern with an appropriately sized channel, such that the channel’s floodplain will be flooded more frequently at flows greater than the bankfull stage.
Benefits Related to Ecological Processes	
Restoration of habitats	Benefit will be achieved by restoring riparian buffer habitat to appropriate bottomland hardwood ecosystem.
Improved substrate and instream cover	Benefit will be achieved through the construction of instream structures designed to improve bedform diversity and to trap detritus. Stream will be designed with the appropriate channel dimension and will prevent aggradation and sedimentation within the channel. Substrate will become coarser as a result of the stabilization of stream banks and an overall decrease in the amount fine materials deposited in the stream.

Addition of large woody debris	Benefit will be achieved through the addition of wood structures as part of the restoration design. Such structures may include log vanes, root wads, and log weirs.
Reduced temperature of water due to shading	Benefit will be achieved through the restoration of canopy tree species to the stream buffer areas.
Restoration of terrestrial habitat	Benefit will be achieved through the restoration of riparian buffer bottomland hardwood habitats.

1.3 Project Structure

Following 2016 monitoring the NCIRT requested a review of the differential between the Approved Mitigation Plan and Baseline Monitoring Report. The table below details the discrepancies by reach. The primary cause of the 5% increase in baseline SMUs is survey methodology (thalweg vs. centerline). The Mitigation Plan lengths were based on centerline. Wetland credits are unchanged from Mitigation Plan to Baseline Monitoring Report. Additionally, 13 SMUs have been removed from Reach 3b due to a powerline that was built along the easement edge (**Figure 3a**). The powerline has a 30-foot easement on it half of which overlaps the conservation easement.

Table 1. Muddy Run II Project Components – Stream Mitigation

Reach	Mitigation Type	Proposed Length (LF)*	Mitigation Ratio	Proposed SMUs	Baseline SMUs
Reach 1	Headwater Valley	401	1:1	401	398
Reach 2	Headwater Valley	504	1:1	504	504
Reach 2	P1 Restoration	1,369	1:1	1,369	1,410
Reach 3a	P1 Restoration	3,440	1:1	3,440	3,586
Reach 3b	P1 Restoration	1,852	1:1	1,852	1,966
Reach 3c	Enhancement I	707	1:1.5	471	472
Reach 4	P1 Restoration	172	1:1	172	173
Reach 5a	P1 Restoration	1,774	1:1	1,774	1,926
Reach 5b	Enhancement II	401	1:2.5	160	164
Reach 6	Enhancement II	317	1:2.5	127	127
Total		11,411		10,270	10,726

*The proposed lengths represent the total proposed channel length minus the length of the proposed channel associated with crossings (easement breaks).

Table 2. Muddy Run II Project Components – Wetland Mitigation

Wetland	Mitigation Type	Mitigation Area (ac)	Mitigation Ratio	WMUs
WA	Restoration	3.60	1:1	3.60
WB	Restoration	1.32	1:1	1.32
Total		4.92		4.92

1.3.1 Restoration Type and Approach

Reach 1

Headwater valley restoration approach was performed along Reach 1. The existing channel/ditch was backfilled, and flow has been directed from its current position along the tree line back to within the historic valley location down to the confluence with Reaches 2 and 3a. A 100-foot-wide forested buffer

has been planted throughout the reach. The upstream limit of Reach 1 ties into an existing headwater valley system comprised of intermittent sections of single and multiple channels. This system will be used as a reference site for incorporating a small baseflow channel into the headwater valley restoration design.

Reach 2

Similar to Reach 1, headwater valley restoration was performed along the upper section of Reach 2. The existing channel was backfilled with existing spoil material located along the channel, a result of previous dredging activities. Areas within the 100-foot buffer that were disturbed or lack riparian vegetation were planted. Grade control structures were installed along three ditches that enter Reach 2 at the upstream end of the project. These structures raised the upstream channel bed elevations slightly to tie into existing ditches to the project reach. An existing CMP culvert located along the upstream section was removed and replaced outside the easement (upstream) to continue to allow the landowner access to all areas of his property. Priority 1 restoration was performed for the majority of Reach 2. Restoration activities involved relocating the channel to the north through an existing wooded area consisting primarily of pines and a few hardwoods. Existing spoil piles located along the channel banks were removed and used to fill the existing ditch. Diffuse flow structures have been installed along several ditches that outlet to the reach from both the north and south. The structures will attenuate and disperse flows as the existing ditches enter the proposed easement.

Reach 3a

Priority Level I restoration was performed on Reach 3a. The restoration approach on this reach included relocating the channel on either side of its current location to follow the natural valley and removing the adjacent roadbed to allow continuous access to the floodplain. Two existing 36" CMP culvert crossings were located along this reach. Each culvert was removed and replaced in-line with the proposed stream to allow the landowners to access portions of their respective properties to the west of the project site. Reach 3a now flows in a northwesterly direction until it reaches a property line. At this point, the existing ditch that continued to flow in a northerly direction was plugged and a diversion structure was installed. The structure is designed to pass 100 percent of baseflow and small storms through the project, and divert up to 70 percent of storms larger than the 25-yr storm to the existing ditch and offsite. See Section 7.3.1.1 (Stream Hydrologic Analysis) for hydraulic analysis details.

Just downstream of the diversion structure, the channel was relocated south of several turkey houses, and now flows in a westerly direction as Reach 3b. The network of ditches surrounding the turkey houses appear to cross a small ridge, directing flow away from the project area. An additional culvert crossing was constructed where flow will be diverted to the west at the turkey houses. Priority I restoration is appropriate for this channel because it is the only mitigation approach that addresses bed and bank instability, establishes a forested riparian buffer, and significantly enhances aquatic habitat. Diffuse flow structures were constructed where existing agricultural ditches enter the easement area.

The diversion structure was constructed at the downstream end of Reach 3a to alleviate and prevent flooding caused by rerouting flow and increased drainage areas, to provide continued flow through the existing ditch for storms larger than bankfull (design) events, and to reduce impacts from proposed grading activities. Per discussions with Mr. Lanier (owner of parcel northwest of proposed structure), larger storm events overtop the existing ditch flowing to the north. This flooding may be attributed to inefficiencies with existing structures and ditch alignments in conjunction with low gradients. The culvert associated with the gravel access road that leads from Ludie Brown Road to the turkey houses outlets perpendicular to the receiving ditch that flows to the northeast and under Ludie Brown Road. This ditch continues to the northeast and crosses Route 111, where it flows to the north into Muddy Creek. By diverting up to 70 percent of higher flows through the existing ditch and offsite, existing flooding issues will be reduced adjacent to the turkey houses. This diversion also decreases potential

flooding impacts that would occur if 100 percent of storm events were passed through the proposed channel, Reach 3b. There are several residential parcels within zero to 200 feet of the proposed easement along Reach 3b. Because the topography is very flat through this area, the flooding associated with the majority of storm events greater than bankfull would negatively impact these parcels.

Finally, by diverting a percentage of the proposed higher flows, flooding impacts will also be reduced along Reaches 5a and 5b and at the existing HWY 41 culvert at the downstream end of the project. Currently, agricultural fields are present along the north side of Reach 5a. By reducing high flows, the flooding extent and duration will be reduced; thus, preventing adverse impacts to crops. If 100 percent of higher storm events were allowed to pass through the project, significant grading would be required to cut floodplain terraces/benches to relieve flooding of the adjacent agricultural fields.

Approximately 1,611 LF of the existing ditch that flows to the north from the Reach 3a/3b diversion structure will be impacted (dewatered). This length includes the segment of the ditch from the diversion structure downstream to the Muddy Creek floodplain. The channel impacts resulting from the proposed channel relocation will be addressed in the ensuing NWP application.

Reach 3b

Priority Level I restoration was performed on Reach 3b. The restoration approach on this reach included relocating the channel in a westerly direction through an open pasture. The pasture area has been extensively modified and substantial grading was required. The design then moves the channel to a historic drainage way as observed on LiDAR and historical aerial photographs. The flow path is now connected to a small relic channel identified in the forested area west of the pasture. Subsequent topographic survey confirmed positive drainage along the relic channel which follows a low-lying feature observed on LiDAR. The restoration approach included some minor grading to enlarge the existing channel and to create a diverse bed habitat by constructing pools. Log grade control structures were installed at the confluence with Reach 3c and at the connection to the relic channel. Small, mechanical equipment and hand tools were used to minimize damage to the existing forested buffer. A livestock protected culvert crossing was constructed near the existing pasture along an existing farm path to allow the landowner uninterrupted access to his property.

Reach 3c

Enhancement I was performed on Reach 3c as it flows through a forested area downstream from Reach 3b to Reach 3 of the Muddy Run Stream Mitigation Project. A grade control structure was installed at the upstream end to stabilize the transition from an existing agricultural ditch to the stable channel. A crossing was constructed along the upper section to allow the landowner access to both sides of his property. Enhancement activities included removing portions of existing spoil piles located along top of banks, cutting floodplain benches and laying back banks, and installing woody debris habitat structures. Diffuse flow structures were also constructed at the downstream limit where existing agricultural ditches enter the easement area. Invasive species management was performed throughout the buffer, and any bare or disturbed areas were planted with native riparian vegetation.

Reach 4

Priority 1 restoration was performed on the downstream end of Reach 4 as it flows through a forested area below a ditch draining an agricultural field. A grade control structure was installed at the upstream end to transition from the existing ditch to a stable channel. The lower section of the reach was constructed into an E-type channel before its confluence with Reach 3a. Invasive species management

was performed throughout the buffer, and any bare or disturbed areas were planted with native riparian vegetation.

Reach 5a

Priority Level I restoration was performed on Reach 5a. The channel was relocated north of its current location into the adjacent agricultural field. The existing ditch was backfilled and plugged at any locations that may cross the proposed channel. The upstream end of the reach ties into Reach 1C of the Muddy Run Stream Mitigation Project. The single-thread channel flows through proposed wetland WB beginning approximately 300 feet downstream of the Muddy Run project. A CMP culvert crossing was installed in-line with the proposed design near the middle of the reach to allow the landowners access to the adjacent parcels. Priority I restoration is appropriate for this channel because it is the only mitigation approach that addresses bed and bank instability, establishes a forested riparian buffer, and significantly enhances aquatic habitat.

Reach 5b

Enhancement Level II was performed on Reach 5b. Several log grade controls and woody debris structures were installed along the bed to increase aquatic habitat and bed diversity. The right bank along the reach was laid back and spoil piles along the tops of banks were removed using small equipment to minimize impacts to the existing buffer. Additionally, invasive species management was performed throughout the buffer, and any bare or disturbed areas were planted with native riparian vegetation.

Reach 6

Enhancement Level II was performed on the downstream section of Reach 6 (STA 9+02 to STA 12+19). The right and left banks were laid back, and the channel was backfilled using spoil located adjacent to the channel such that positive drainage is maintained throughout the reach down to the confluence with Reach 5a. Invasive species management was performed throughout the buffer where enhancement took place, and any bare or disturbed areas were planted with native riparian vegetation. A 50-foot-wide buffer was provided along the upper section of Reach 6 (STA 0+00 to STA 9+02); however, no enhancement activities were performed through this section other than filling portions of the channel. This additional easement was provided to account for any hydrologic impacts that may occur as a result of the proposed enhancement activities.

1.4 Project History, Contacts and Attribute Data

1.4.1 Project History

The Site was restored by Environmental Banc & Exchange, LLC (EBX) through a full-delivery contract awarded by NCDMS in 2011. EBX was acquired by Resource Environmental Solutions, LLC (RES) in 2014 and now oversees the project tasks. Tables 2, 3, and 4 in **Appendix A** provide a time sequence and information pertaining to the project activities, history, contacts, and baseline information.

1.4.2 Project Watersheds

The easement totals 37.6 acres and is broken into nine reaches. Reach 1 has a drainage area of 68 acres; it begins at the start of the restoration project (STA 0+00) and extends west to STA 4+48. Reach 2 has a drainage area of 114 acres; it begins at STA 0+00 and extends to STA 19+14. Reach 3a (Sta. 0+00 to 37+23) begins at the confluence of Reaches 1 and 2 and has a drainage area of 227 acres. Reach 3b has a drainage area of 333 acres and flows west into Reach 3c; it begins at STA 37+23 and extends to STA 57+92. Reach 3c has a drainage area of 370 acres extending north to south and flows into Reach 3 of the Muddy Run project; it begins at STA 57+92 and extends to STA 65+30. Reach 4 has a drainage area of 46 acres and flows from the east into Reach 3a; it begins at STA 0+44 and extends to STA STA

2+17. Reach 5a begins at the downstream limit of the Muddy Run project, flows into Reach 5b, and has a drainage area of 774 acres; it begins at STA 0+00 and extends to STA 19+59. Reach 5b has a drainage area of 908 acres; it starts at STA 19+59 and extends to STA 23+68. Reach 6 has a drainage area of 318 acres and flows from the south into Reach 5a; it starts at STA 9+02 and extends to STA 12+19 (**Figure 2**). The land use in the project watershed is approximately 38 percent cultivated, 32 percent evergreen forest, 15 percent shrub/scrub, 6 percent bottomland forest/hardwood swamp, 5 percent mixed forest, 2 percent developed, and 2 percent managed herbaceous cover.

2 Success Criteria

The success criteria for the Site stream restoration was assembled from the NCDMS Monitoring Requirements and Performance Standards Guidance for Stream and-or Wetland Mitigation (11/07/2011). Specific success criteria components are presented below.

2.1 Stream Restoration

2.1.1 Bankfull Events

Two bankfull flow events must be documented within the seven-year monitoring period. The two bankfull events must occur in separate years. Otherwise, the stream monitoring will continue until two bankfull events have been documented in separate years. Bankfull events will be documented using stage recorders, photographs, and visual assessments for evidence of debris rack lines.

2.1.2 Cross Sections

There should be little change in as-built cross-sections. If changes do take place, they should be evaluated to determine if they represent a movement toward a less stable condition (for example down-cutting or erosion), or are minor changes that represent an increase in stability (for example settling, vegetative changes, deposition along the banks, or decrease in width/depth ratio). Cross-sections are classified using the Rosgen stream classification method, and all monitored cross-sections should fall within the quantitative parameters defined for channels of the design stream type.

2.1.3 Digital Image Stations

Digital images are used to subjectively evaluate channel aggradation or degradation, bank erosion, success of riparian vegetation, and effectiveness of erosion control measures. Longitudinal images should not indicate the absence of developing bars within the channel or an excessive increase in channel depth. Lateral images should not indicate excessive erosion or continuing degradation of the banks over time. A series of images over time should indicate successional maturation of riparian vegetation.

2.2 Wetland Restoration

At the time of the development of mitigation plan, the NRCS did not have a current WETs table for Duplin County upon which to base a normal rainfall amount and average growing season. The closest comparable data was determined to be from Sampson County. The growing season for Sampson County is 242 days long, extending from March 17 to November 14, and is based on a daily minimum temperature greater than 28 degrees Fahrenheit occurring in five of ten years.

Because of the surface roughing and shallow depressions, a range of hydroperiods are expected. The water balance indicates that the site will have a positive water balance in the early part of the growing season for four to five weeks, on average. The hydrology success criterion for the site is to restore the water table at the Site so that it will remain continuously within 12 inches of the soil surface for at least

nine percent of the growing season (approximately 22 days) at each groundwater gauge location during normal rainfall years. Overbank flooding events will provide additional inputs that may extend the hydroperiod in some years.

Gauge data will be compared to reference wetland well data in growing seasons with less than normal rainfall. In periods of low rainfall, if a restoration gauge hydroperiod exceeds the reference gauge hydroperiod, and both exceed five percent of the growing season, then the gauge will be deemed successful. If a gauge location fails to meet these success criteria in the seven-year monitoring period, then monitoring may be extended, remedial actions may be undertaken, or the limits of wetland restoration will be determined.

2.3 Vegetation

Specific and measurable success criteria for plant density within the riparian buffers on the site will follow NCDMS Guidance. Vegetation monitoring plots are 0.02 acres in size, and cover greater than two percent of the planted area. Vegetation monitoring will occur annually in the fall of each year. The interim measures of vegetative success for the site will be the survival of at least 320 three-year-old trees per acre at the end of Year 3, 260 trees per acre at the end of Year 5, and the final vegetative success criteria will be 210 trees per acre at the end of Year 7. Invasive species on the site will be monitored and treated if necessary throughout the required vegetation monitoring period.

2.4 Scheduling/Reporting

The monitoring program will be implemented to document system development and progress toward achieving the success criteria. The restored stream morphology will be assessed to determine the success of the mitigation. The monitoring program will be undertaken for seven years or until the final success criteria are achieved, whichever is longer.

Monitoring reports will be prepared in the fall of each year of monitoring and submitted to NCDMS. The monitoring reports will include all information, and will be in the format required by NCDMS in Version 2.0 of the NCDMS Monitoring Report Template.

3 MONITORING PLAN

Annual monitoring data will be reported using the NCDMS monitoring template. Annual monitoring shall be conducted for stream, wetland, and vegetation monitoring parameters as noted below.

3.1 Stream Restoration

3.1.1 As-Built Survey

An as-built survey was conducted following construction to document channel size, condition, and location. The survey included a complete profile of thalweg, water surface, bankfull, and top of bank to compare with future geomorphic data. Longitudinal profiles will not be required in annual monitoring reports unless requested by NCDMS or USACE.

3.1.2 Bankfull Events

Four sets of continuous stage recorders were installed on the site, one along Reach 2, one along Reach 3a, one along Reach 3b, and one along Reach 5a. The stage recorders are made up of an auto logging flow gauge and a manual crest gauge. Auto logging flow gauges were installed within the channel and continuously record water level conditions at an hourly interval. Manual crest gauges were installed on the bank at bankfull elevation and record bankfull height using ground cork. Crest gauges are checked

during each site visit to determine if a bankfull event has occurred since the last site visit. The auto logging flow gauges are used to record the bankfull readings that the manual crest gauges miss. Crest gauge readings and debris rack lines are photographed to document evidence of bankfull events.

3.1.3 Cross Sections

A total of 59 permanent cross sections were installed to monitor channel dimensions and stability. Four cross sections were installed along Reach 1 and ten cross sections were installed along Reach 2. There were 21 cross sections (nine runs, nine pools, and three riffles) installed along Reach 3A and six cross sections installed along Reach 3B. Four cross sections were installed along Reach 3C and two cross sections were installed along Reach 4. Reach 5A had eight cross sections installed, while Reach 5B and 6 each had two cross sections installed. Cross sections were typically located at representative shallow and pool sections along each stream reach. Each cross section was permanently marked with 3/8 rebar pin to establish a monument location at each end. A marker pole was also installed at both ends of each cross section to allow ease locating during monitoring activities. Cross section surveys will be performed in monitoring years 1, 2, 3, 5, and 7 and will include all breaks in slope including top of bank, bottom of bank, streambed, edge of water, and thalweg. Cross sections 52-55 were monitored in Year 6 to provide additional data after the repair of this reach in Year 3.

3.1.4 Digital Image Stations

Digital photographs will be taken at least once a year to visually document stream and vegetation conditions. This monitoring practice will continue for seven years following construction and planting. Permanent photo point locations at cross sections and vegetation plots have been established so that the same directional view and location may be repeated each monitoring year. Monitoring photographs will also be used to document any stream and vegetation problematic areas such as erosion, stream and bank instability, easement encroachment and vegetation damage.

3.1.5 Bank Pin Arrays

Twenty bank pin arrays have been installed at cross sections located on meander pools. These bank pin arrays were installed along the upstream and downstream third of the meander. Bank pins are a minimum of three feet long, and have been installed just above the water surface and every two feet above the lowest pin. Bank pin exposure will be recorded at each monitoring event, and the exposed pin will be driven flush with the bank.

3.1.6 Visual Assessment Monitoring

Visual monitoring of all mitigation areas will be conducted a minimum of twice per monitoring year by qualified individuals. The visual assessments will include vegetation density, vigor, invasive species, and easement encroachments. Visual assessments of stream stability will include a complete stream walk and structure inspection. Digital images will be taken at fixed representative locations to record each monitoring event as well as any noted problem areas or areas of concern. Results of visual monitoring will be presented in a plan view exhibit with a brief description of problem areas and digital images. Photographs will be used to subjectively evaluate channel aggradation or degradation, bank erosion, success of riparian vegetation, and effectiveness of erosion control measures. Longitudinal photos should indicate the absence of developing bars within the channel or an excessive increase in channel depth. Lateral photos should not indicate excessive erosion or continuing degradation of the banks over time. A series of photos over time should indicate successional maturation of riparian vegetation.

3.1.7 Surface Flow

Headwater valley restoration areas will be monitored to document intermittent or seasonal surface flow. This will be accomplished through direct observation, photo documentation of hydrology conditions, and dye tests if necessary.

3.2 Vegetation

A total of 28 vegetation plots were randomly established within the planted stream riparian buffer easement. Each vegetation plot measures 22 feet by 40 feet (0.02 acres) and has all four corners marked with PVC posts. Planted woody vegetation was assessed within each plot to establish a baseline dataset. Within each vegetation plot, each planted stem was identified for species, “X” and “Y” origin located, and measured for height. Reference digital photographs were also captured to document baseline conditions. Species composition, density, growth patterns, damaged stems, and survival ratios will be measured and reported on an annual basis. Vegetation plot data will be reported for each plot as well as an overall site average.

3.3 Wetland Hydrology

Wetland hydrology will be monitored to document hydric conditions in the wetland restoration areas. Seven automatic recording pressure transducer gauges were installed in representative locations across the restoration areas and an additional three gauges were installed in reference wetlands. The gauges will be downloaded quarterly and wetland hydroperiods will be calculated during the growing season. Gauge installation followed current regulatory and NCDMS guidance. Visual observations of primary and secondary wetland hydrology indicators will also be recorded during quarterly site visits.

4 MAINTENANCE AND CONTINGENCY PLAN

All identified problematic areas or areas of concern such as stream bank erosion/instability, aggradation/degradation, lack of targeted vegetation, and invasive/exotic species which prevent the site from meeting performance success criteria will be evaluated on a case by case basis. These areas will be documented and remedial actions will be discussed amongst NCDMS staff to determine a plan of action. If it is determined remedial action is required, a plan will be provided.

4.1 Stream

During the Year 7 monitoring activities, no stream problem areas were documented. The series of beaver dams on Reach 5A, that were reported in previous years, were removed in 2019. No signs of beavers were observed during the November 2020 monitoring event. Additionally, the MY3 repair reach, Reach 5a, has remained stable throughout the remainder of the monitoring period.

4.2 Vegetation

Vegetation problem areas in MY7 included invasive species, overgrown pines, encroachment, and low stem density areas. Invasive species were treated in October 2020 and will be treated again prior to close-out. Invasive species treatment includes cutting and stump spraying large Chinese privet stems and foliar spraying smaller/re-sprouted Chinese privet plants. The majority of the invasive species treatment took place along Reach 2 and Reach 3a. There were three methods of pine thinning performed in three separate areas on site. Along Reach 1 stump cut was used to cut pine trees down (Photo 6 - 0.28 acres), along Reach 3b the area was mulched with a skid-steerer (Photo 2 - 0.23 acres), and along Reach 5a the pine trees were girdled (0.25 acres). The areas along Reach 1 and Reach 3b required supplemental plantings which were performed in January 2021 and consisted of 160 3-gallon trees (sycamore, river birch, willow oak, and overcup oak). The two encroachment areas on Reach 3 were caused by missing easement poles and mowing which were repaired in January 2021 (Photos 3 and 4).

These areas total about 0.13 acres and were planted with 60 3-gallon trees (sycamore, river birch, willow oak, and overcup oak). The other encroachment area, Reach 5a, was an area where ATVs were cutting across the easement (Photo 3). This area (0.03 acres) was repaired and replanted in January 2021 (15 3-gallon sycamore, river birch, willow oak, and overcup oak). As of March 2021, no further encroachment has occurred. Additionally, there was a low stem density area where the fire plow went through the easement in 2019 along Reach 5b (Photo 1). This area totaled 0.06 acres and was planted with container trees in January 2021 (30 3-gallon sycamore, river birch, willow oak, and overcup oak).

4.3 Wetlands

No wetland problem areas were noted during the Year 7 monitoring period. All pressure transducers were replaced prior to the 2019 growing season.

5 YEAR 7 MONITORING CONDITIONS (MY7)

The Muddy Run II Year 7 Monitoring activities were completed in May, June, and November 2020. All Year 7 monitoring data is presented below and in the appendices. The Site met all stream, vegetation, and wetland interim success criteria and is recommended for close-out.

5.1 Year 7 Monitoring Data Collection

5.1.1 Morphological State of the Channel

Morphological stream data was only collected at all cross sections in MY7 **Appendix D** includes the cross-section plots and morphological parameters for this year.

Profile

The baseline (MY-0) profiles closely matched the proposed design profiles. The plotted longitudinal profiles can be found on the As-Built Drawings. Longitudinal profiles will not be performed in annual monitoring reports unless requested by NCDMS or USACE. Morphological summary data tables can be found in **Appendix D**.

Dimension

The Year 7 cross sectional dimensions closely match the Year 5 cross section parameters. Starting in Year 6, Bank Height Ratio (BHR) was calculated on riffles using the baseline bankfull cross sectional area. With a fixed cross-sectional area (based on the baseline data), minor changes in channel dimension corresponds with slight changes in bankfull stage. Therefore, the new bankfull stage is used to more accurately calculate current BHRs and entrenchment ratios (ER). None of the restoration cross sections exceeded a 1.2 BHR. All cross-section plots and data tables can be found in **Appendix D**.

Sediment Transport

The Year 7 conditions show that shear stress and velocities have been reduced for all six restoration reaches. Pre-construction conditions documented all six reaches as sand bed channels and remain classified as sand bed channels post-construction. Visual assessments (**Appendix B**) show the channels are transporting sediment as designed and will continue to be monitored for aggradation and degradation.

Bank Pin Arrays

Ten pool cross section locations with bank pin arrays were observed and measured for bank erosion located on the outside meander bends. If bank pin exposure was noticeable, it was measured, recorded, photographed, and then driven flush with the bank at each monitoring location. No bank pin array

locations had measurable readings during annual Year 7 monitoring activities. Bank pin array data tables can be found in **Appendix D**.

5.1.2 Vegetation

The Year 7 monitoring vegetation survey was completed in November 2020 and resulted in an average of 596 planted stems per acre, well above the interim survival density of 210 stems per acre at the end of Year 7 monitoring. The average stems per vegetation plot was 12 planted stems. The minimum planted stems per plot was 6 stems and the maximum was 20 stems per plot. The average planted stem height was 13 feet. Volunteer tree species were noted throughout the site during MY7 activities. Vegetation summary data tables and plot photos can be found in **Appendix C**.

5.1.3 Photo Documentation

Permanent photo point locations have been established at cross sections, vegetation plots, stream crossings, and stream structures by RES staff. Any additional problem areas or areas of concern will also be documented with a digital photograph during monitoring activities. Stream digital photographs can be found in **Appendix B** and **Appendix C** for vegetation photos.

5.1.4 Stream Hydrology

Four sets of continuous stage recorders were installed on the site, one along Reach 2, one along Reach 3a, one along Reach 3b, and one along Reach 5b. Two of the four stage recorders documented bankfull events during the Year 7 monitoring period. Stage Recorder 1, which is located on Reach 2, documented 6 bankfull events during MY7 with a highest reading of 0.94 feet. Stage Recorder 4 (Reach 5b) logged 16 bankfull events during MY7 with a reading of 3.20 feet above bankfull elevation. Stage Recorders 2 and 3 did not detect bankfull events in MY7 due to failed HOBOS. Stage recorder summary data and photo documentation of the bankfull events can be found in **Appendix D**.

5.1.5 Wetland Hydrology

Seven of the seven wetland restoration gauges achieved the success criteria by remaining continuously within 12 inches of the soil surface for at least nine percent of the growing season. Groundwater gauge data indicates the hydroperiods being very responsive to rainfall events. Of the three reference wetlands gauges, only one (RAW2) did not meet success criteria in MY7. All pressure transducers were replaced prior to the 2019 growing season. Wetland gauge and rainfall data is presented in **Appendix D**.

6 REFERENCES

- Chow, Ven Te. 1959. Open-Channel Hydraulics, McGraw-Hill, New York.
- Cowardin, L.M., V. Carter, F.C. Golet and E.T. LaRoe. 1979. Classification of Wetlands and Deepwater Habitats of the United States. U.S. Fish and Wildlife Service, Office of Biological Services, FWS/OBS-79/31. U.S. Department of the Interior, Washington, DC.
- Environmental Banc & Exchange (2012). Muddy Run Stream Restoration Project Final Mitigation Plan. North Carolina Ecosystems Enhancement Program, Raleigh, NC.
- Horton, J. Wright Jr. and Victor A. Zullo. 1991. The Geology of the Carolinas, Carolina Geological Society Fiftieth Anniversary Volume. The University of Tennessee Press. Knoxville, TN.
- Johnson PA. 2006. Assessing stream channel stability at bridges in physiographic regions. U.S. Department of Transportation. Federal Highway Administration. Report Number FHWA-HRT-05-072.
- Krstolic, J.L., and Chaplin, J.J. 2007. Bankfull regional curves for streams in the non-urban, non-tidal Coastal Plain Physiographic Province, Virginia and Maryland: U.S. Geological Survey Scientific Investigations Report 2007-5162, 48 p.
- LeGrand, H.E., Jr. and S.P. Hall, eds. 1999. Natural Heritage Program List of the Rare Animal Species of North Carolina. North Carolina Natural Heritage Program, Division of Parks and Recreation, North Carolina Department of Environment and Natural Resources. Raleigh, North Carolina.
- Natural Resources Conservation Service (NRCS). 2007. Stream Restoration Design Handbook (NEH 654), USDA
- NCDENR. "Water Quality Stream Classifications for Streams in North Carolina." Water Quality Section. <http://h2o.enr.state.nc.us/wqhome/html> (June 2005).
- Radford, A.E., H.E. Ahles and F.R. Bell. 1968. Manual of the Vascular Flora of the Carolinas. The University of North Carolina Press, Chapel Hill, North Carolina.
- Schafale, M.P. and A.S. Weakley. 1990. Classification of the Natural Communities of North Carolina, Third Approximation. North Carolina Natural Heritage Program, Division of Parks and Recreation, NCDENR, Raleigh, NC.
- Sweet, William V. and Jens W. Geratz. 2003. Bankfull Hydraulic Geometry Relationships and Recurrence Intervals for North Carolina's Coastal Plain. J. of the American Water Resources Association (JAWRA) 39(4):861-871.
- Tweedy, K. A Methodology for Predicting Channel Form in Coastal Plain Headwater Systems. Stream Restoration in the Southeast: Advancing the Science and Practice, November 2008, Asheville, NC. Unpublished Conference Paper, 2008.
http://www.bae.ncsu.edu/programs/extension/wqg/srp/2008conference/tweedy_paper.pdf

Appendix A

Project Background Data and Maps

Table 1. Project Components and Mitigation Credits

Table 2. Project Activity and reporting History

Table 3. Project Contacts

Table 4. Project Information and Attributes

Figure 1. Project Vicinity Map

Figure 2. Project USGS Map

Appendix A. General Tables and Figures
Table 1 Project Components and Mitigation Credits
Monitoring Report Year 7

Table 1. Project Components and Mitigation Credits

Mitigation Credits									
Stream		Riparian Wetland		Non-riparian Wetland		Buffer	Nitrogen Nutrient Offset	Phosphorous Nutrient Offset	
Type	R	RE	R	RE	R	RE			
Totals	10,726		4.92	N/A	N/A	N/A	N/A	N/A	N/A
Project Components									
Project Component -or- Reach ID	As-Built Stationing/Location (LF)		Existing Footage/Acreage		Approach (PI, PII etc.)	Restoration -or- Restoration Equivalent	Restoration Footage or Acreage	Mitigation Ratio	
Reach 1	0+00 – 4+48		438		HWV	Restoration	398	1 : 1	
Reach 2	0+00 – 5+04		504		HWV	Restoration	504	1 : 1	
Reach 2	5+04 – 19+14		1,223		P1	Restoration	1,410	1 : 1	
Reach 3A	0+00 – 37+23		3,301		P1	Restoration	3,586	1 : 1	
Reach 3B**	37+23 – 57+92		NA		P1	Restoration	1,966	1 : 1	
Reach 3C	57+92 – 65+30		737		Enh. I	Rest. Equivalent	708	1 : 1.5	
Reach 4	0+44 – 2+17		120		P1	Restoration	173	1 : 1	
Reach 5A	0+00 – 19+59		1,602		P1	Restoration	1,926	1 : 1	
Reach 5B	19+59 – 23+68		401		Enh. II	Rest. Equivalent	409	1 : 2.5	
Reach 6*	9+02 – 12+19		317		Enh. II	Rest. Equivalent	318	1 : 2.5	
Component Summation									
Restoration Level	Stream (linear feet)	Riparian Wetland (acres)		Non-riparian Wetland (acres)	Buffer (square feet)	Upland (acres)			
		Riverine	Non-Riverine						
Restoration	9,061	4.92							
Headwater Valley	902								
Enhancement									
Enhancement I	708								
Enhancement II	727								
Creation									
Preservation									
High Quality Preservation									
BMP									
Element	Location	Purpose/Function			Notes				
---	---	---			---				
---	---	---			---				
---	---	---			---				
BMP Elements									
BR = Bioretention Cell; SF = Sand Filter; SW = Stormwater Wetland; WDP = Wet Detention Pond; DDP = Dry Detention Pond; FS = Filter Strip; S = Grassed Swale; LS = Level Spreader; NI = Natural Infiltration Area; FB = Forested Buffer									

*The upper portion of Reach 6 (893 ft) and the side channel (307 ft) that confluences with it were given a 50 ft buffer and are included in the easement to account for hydrologic impacts. No credit was generated from these channels.

**13 linear feet lost due to powerline ROW

Table 2. Project Activity and Reporting History

Project Activity and Reporting History Muddy Run II Stream and Wetland Restoration / NCDMS Project #95354		
Activity or Report	Data Collection Complete	Completion or Delivery
Mitigation Plan	NA	January 2014
Final Design – Construction Plans	NA	March 2014
Construction Completed	NA	May 2014
Site Planting Completed	NA	May 2014
Baseline Monitoring Document (Year 0 Monitoring – baseline)	June 2014	August 2014
Year 1 Monitoring	December 2014	December 2014
Year 2 Monitoring	December 2015	February 2016
Adaptive Management Repair and Supplemental Replanting*	---	April 2016
Invasive Species Control	---	October 2016
Year 3 Monitoring	November 2016	February 2017
Year 4 Monitoring	November 2017	February 2018
Structure Repair and Addressing Bare Area/Encroachment	---	June 2018
Year 5 Monitoring	XS: June 2018 VP: October 2018	November 2018
Beaver Management	---	February 2019
Year 6 Monitoring	XS 52-55: July 2019 VP: October 2019	January 2020
Encroachment Repair	---	August 2020
Pine and Invasive Species Treatment		October 2020
Year 7 Monitoring	XS: June 2020 VP: November 2020	November 2020
Encroachment Repair and Supplemental Planting*	---	January 2021


*4,400 trees


*265 trees

Table 3. Project Contacts

Project Contacts Table Muddy Run II Stream and Wetland Restoration / NCDMS Project # 95354	
Designer	WK Dickson and Co., Inc. 720 Corporate Center Drive Raleigh, NC 27607 (919) 782-0495 Frasier Mullen, PE
Construction Contractor	GP Jenkins 6566 HWY 55 W Kinston, NC 28504 (252) 569-1222 Gary Jenkins
Planting Contractor	H&J Forestry Matt Hitch
Seeding Contractor	Rain Services, Inc. Lupe Cruz

Native Vegetation Community	Coastal Plain Small Stream Swamp								
Percent Composition of Exotic	0%	0%	0%	0%	0%	0%	0%	0%	0%
Wetland Summary Information									
Parameters	Wetland A			Wetland B					
Size of Wetland (acres)	3.60			1.32					
Wetland Type (non-riparian, riparian riverine or riparian)	Riparian			Riparian					
Mapped Soil Series	Goldsboro			Rains					
Drainage class	Moderately Well			Poorly					
Soil Hydric Status	Yes			Yes					
Source of Hydrology	Runoff/Overbank Flows			Runoff/Overbank Flows					
Hydrologic Impairment	Ditched/Incised Channel			Ditched/Incised Channel					
Native vegetation community	Cultivated			Cultivated					
Percent composition of exotic invasive vegetation	NA			NA					
Regulatory Considerations									
Regulation				Applicable?	Resolved?	Supporting Documentation			
Waters of the United States – Section 404				X	X	USACE NWP 27			
Waters of the United States – Section 401				X	X	401 Water Quality Cert.			
Endangered Species Act				X	X	USFWS (Corr. Letter)			
Historic Preservation Act				X	X	SHPO (Corr. Letter)			
Coastal Zone Management Act (CZMA)/ Coastal Area Management Act (CAMA)				N/A	N/A	N/A			
FEMA Floodplain Compliance									
Essential Fisheries Habitat				N/A	N/A	N/A			

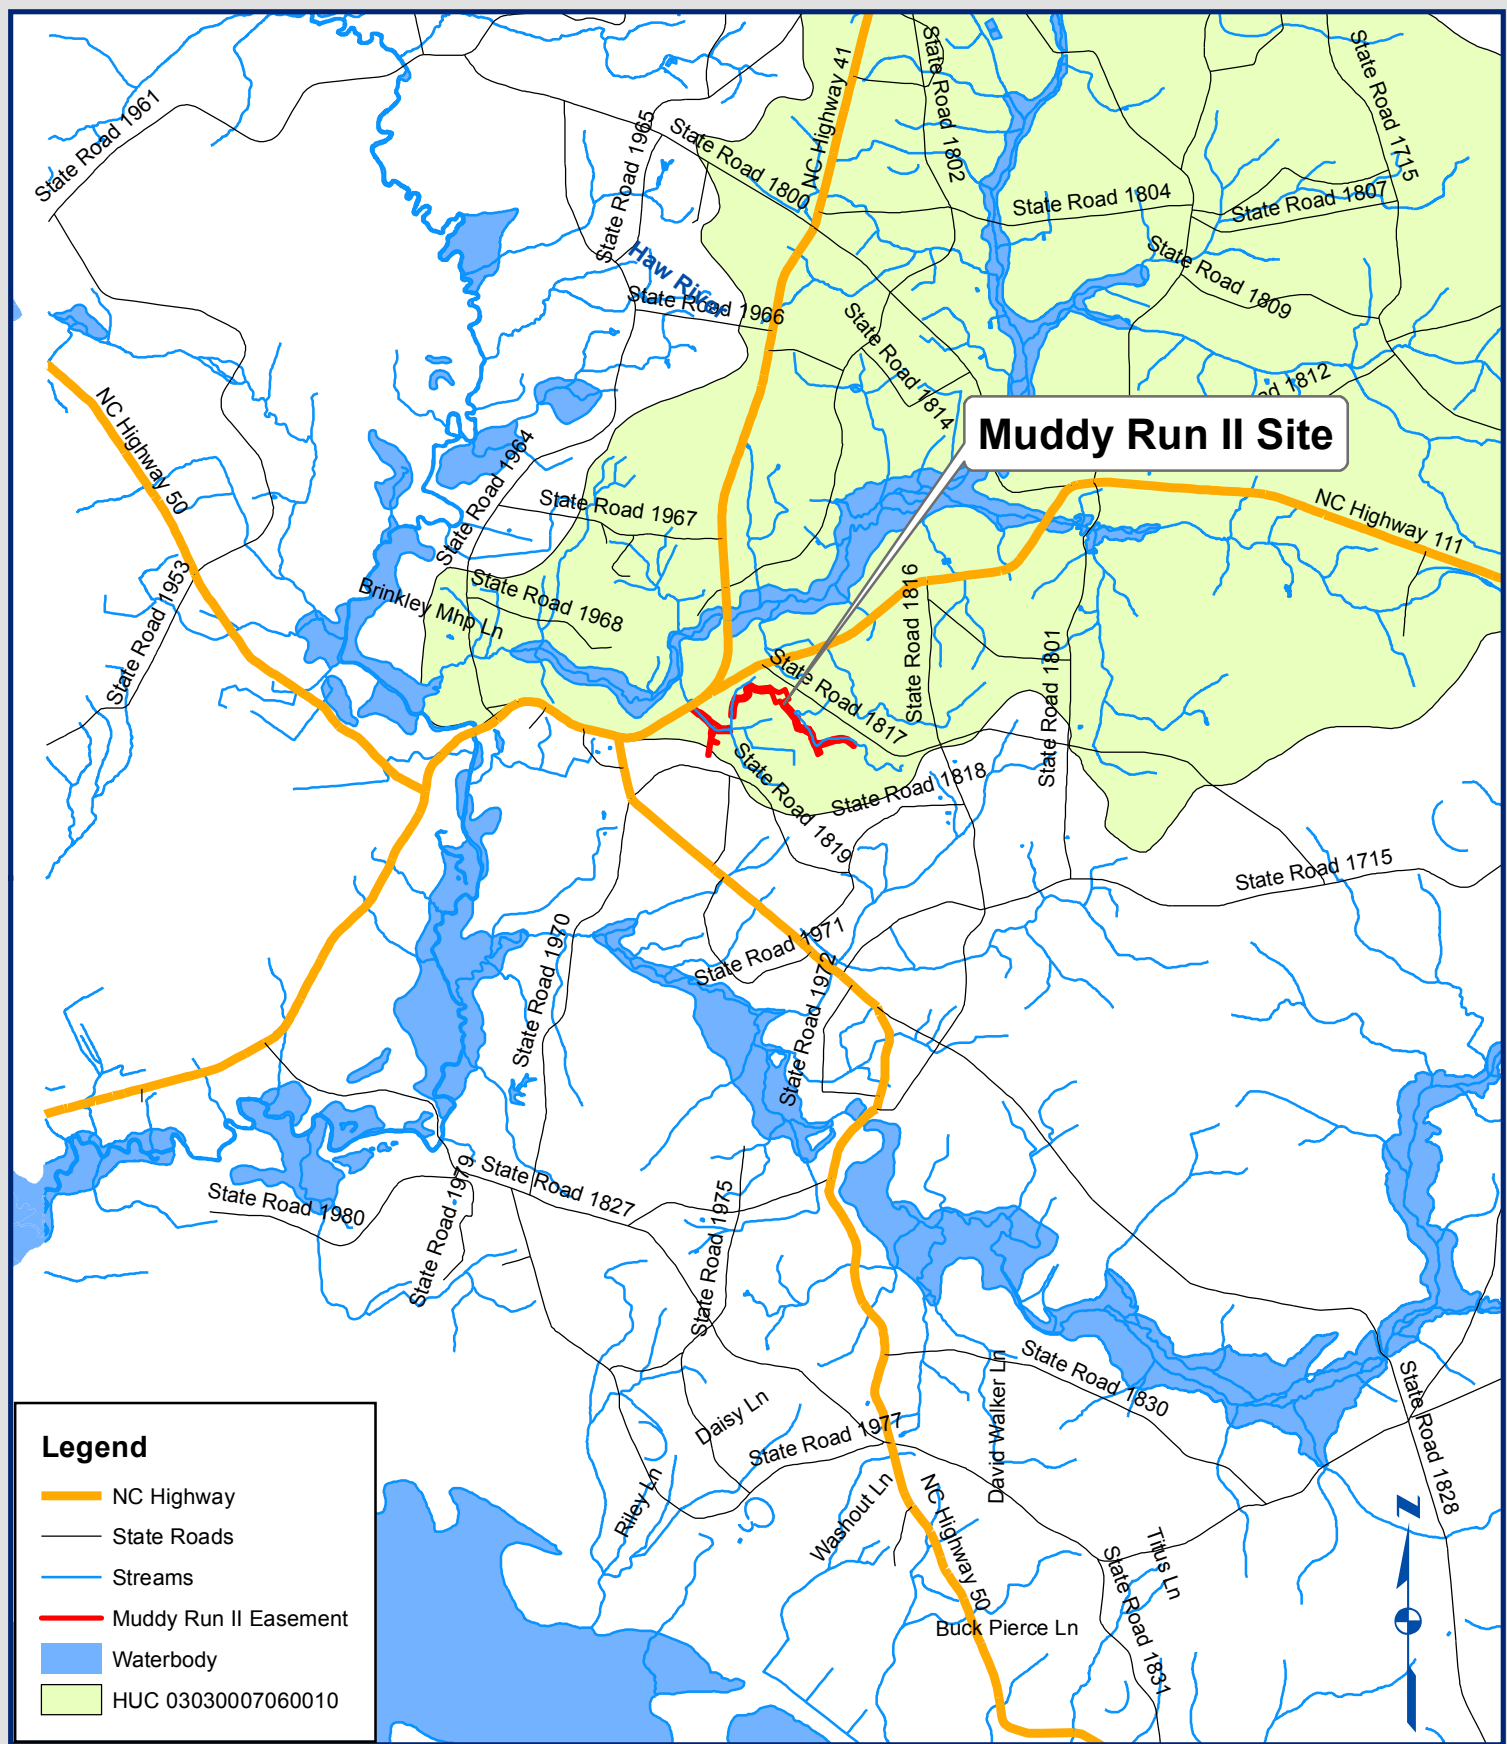

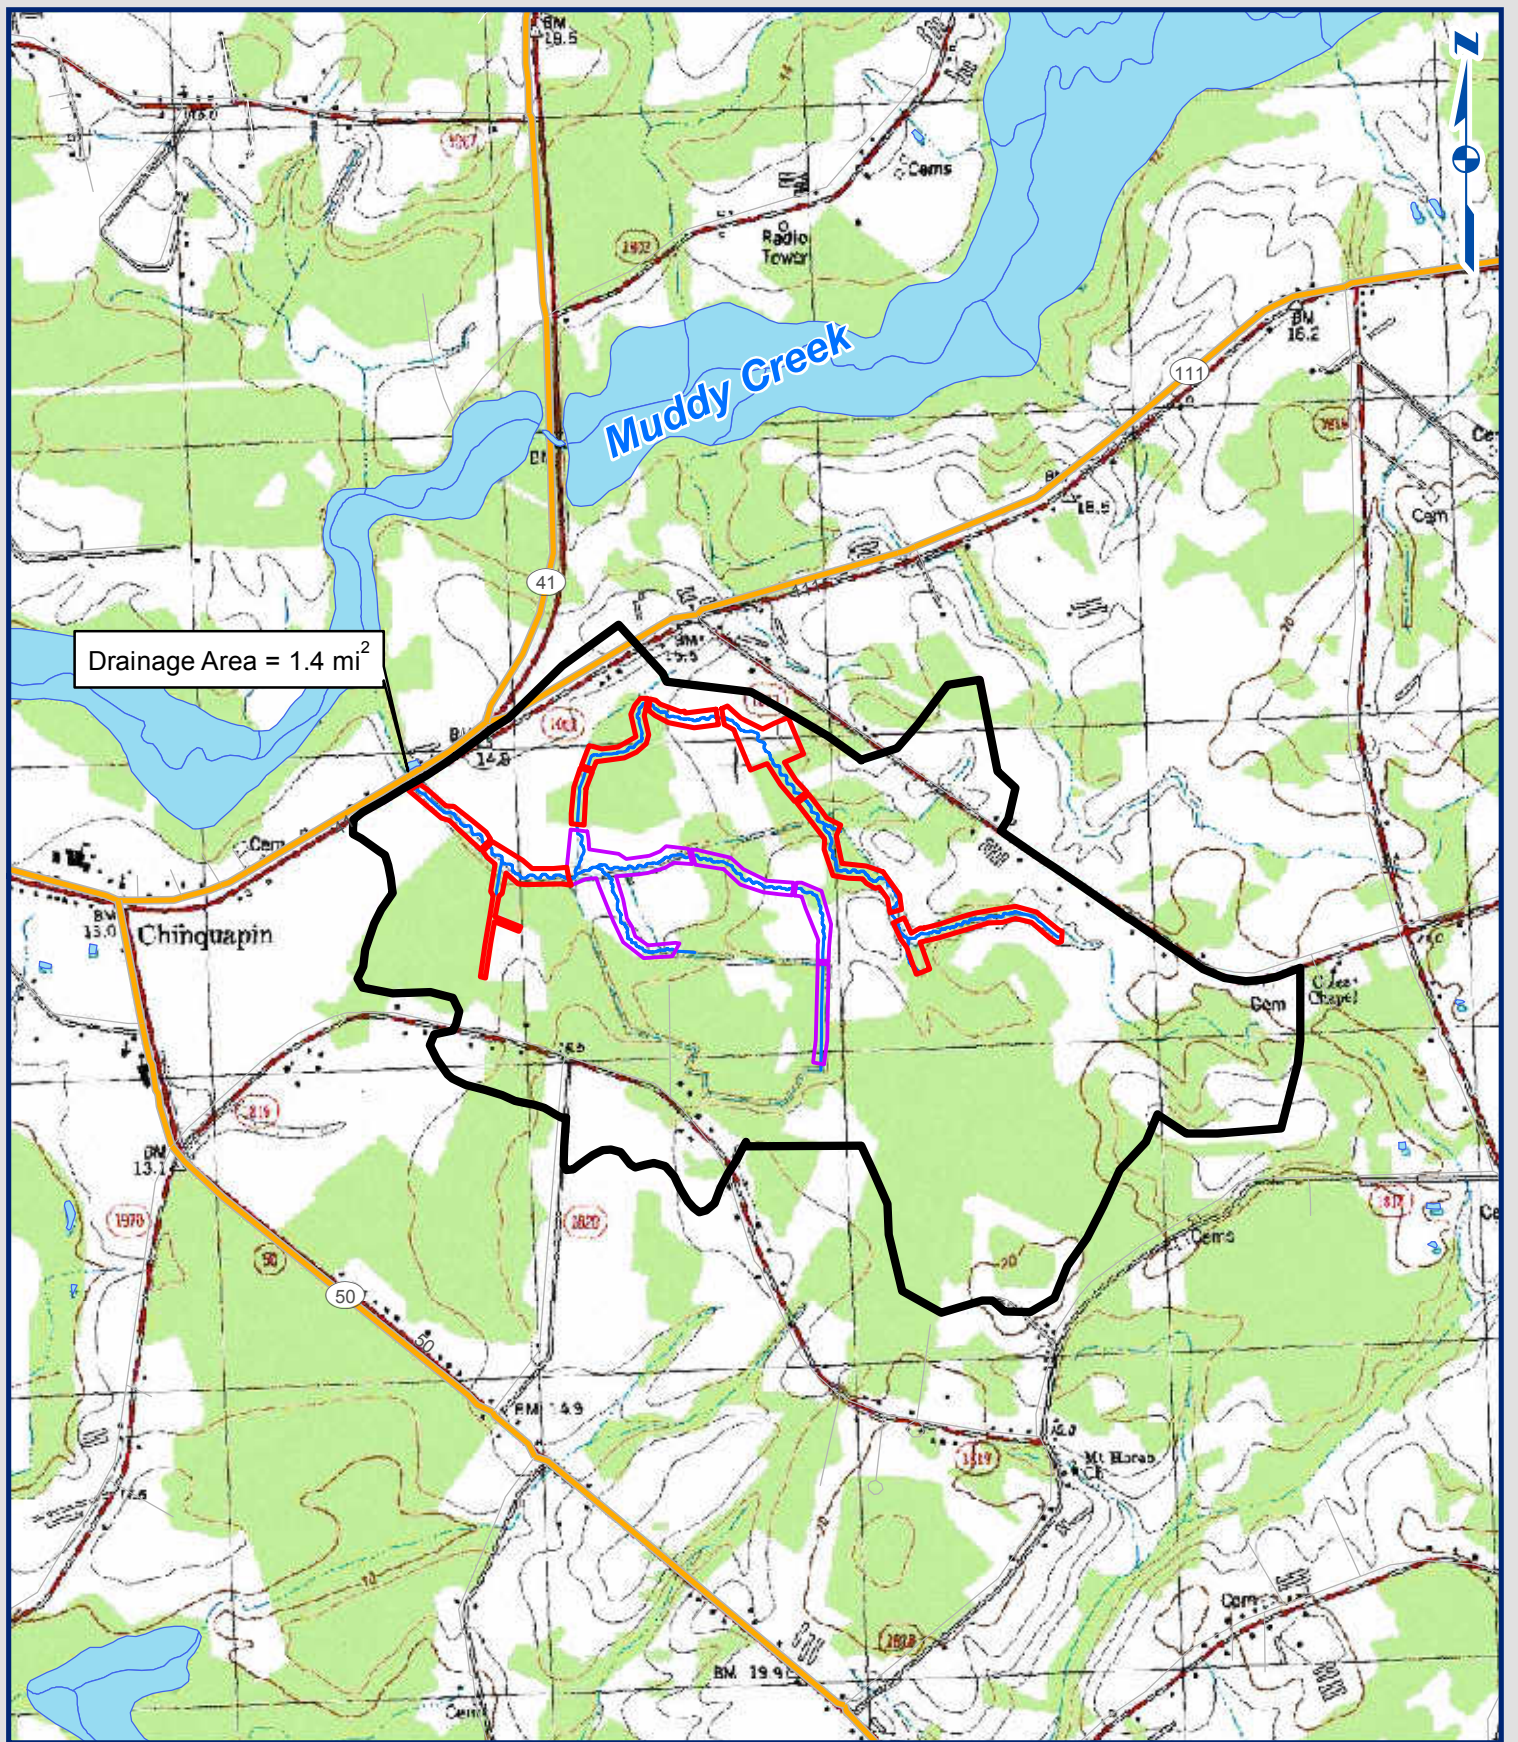

Drainage Area = 1.4 mi²



Figure 2.
USGS/Watershed Map
Muddy Run II Mitigation Site

0 1,000 2,000 4,000 Feet
1 inch = 2,000 feet


- Proposed Streams
- Waterbodies
- Muddy Run II Easement
- Muddy Run Easement
- Drainage Area

Appendix B

Visual Assessment Data

Figure 3a-b. Current Conditions Plan View Map (CCPV)
Table 5. Visual Stream Morphology Stability Assessment
Table 6 Vegetation Condition Assessment
Table 7. Stream Problem Areas
Table 8. Vegetation Problem Areas
Figure 4. Vegetation Photos
Figure 5. Stream and Vegetation Problem Photos

Figure 3a.
Muddy Run II
Mitigation Site
Current Conditions Map
Duplin County, NC
MY7 2020

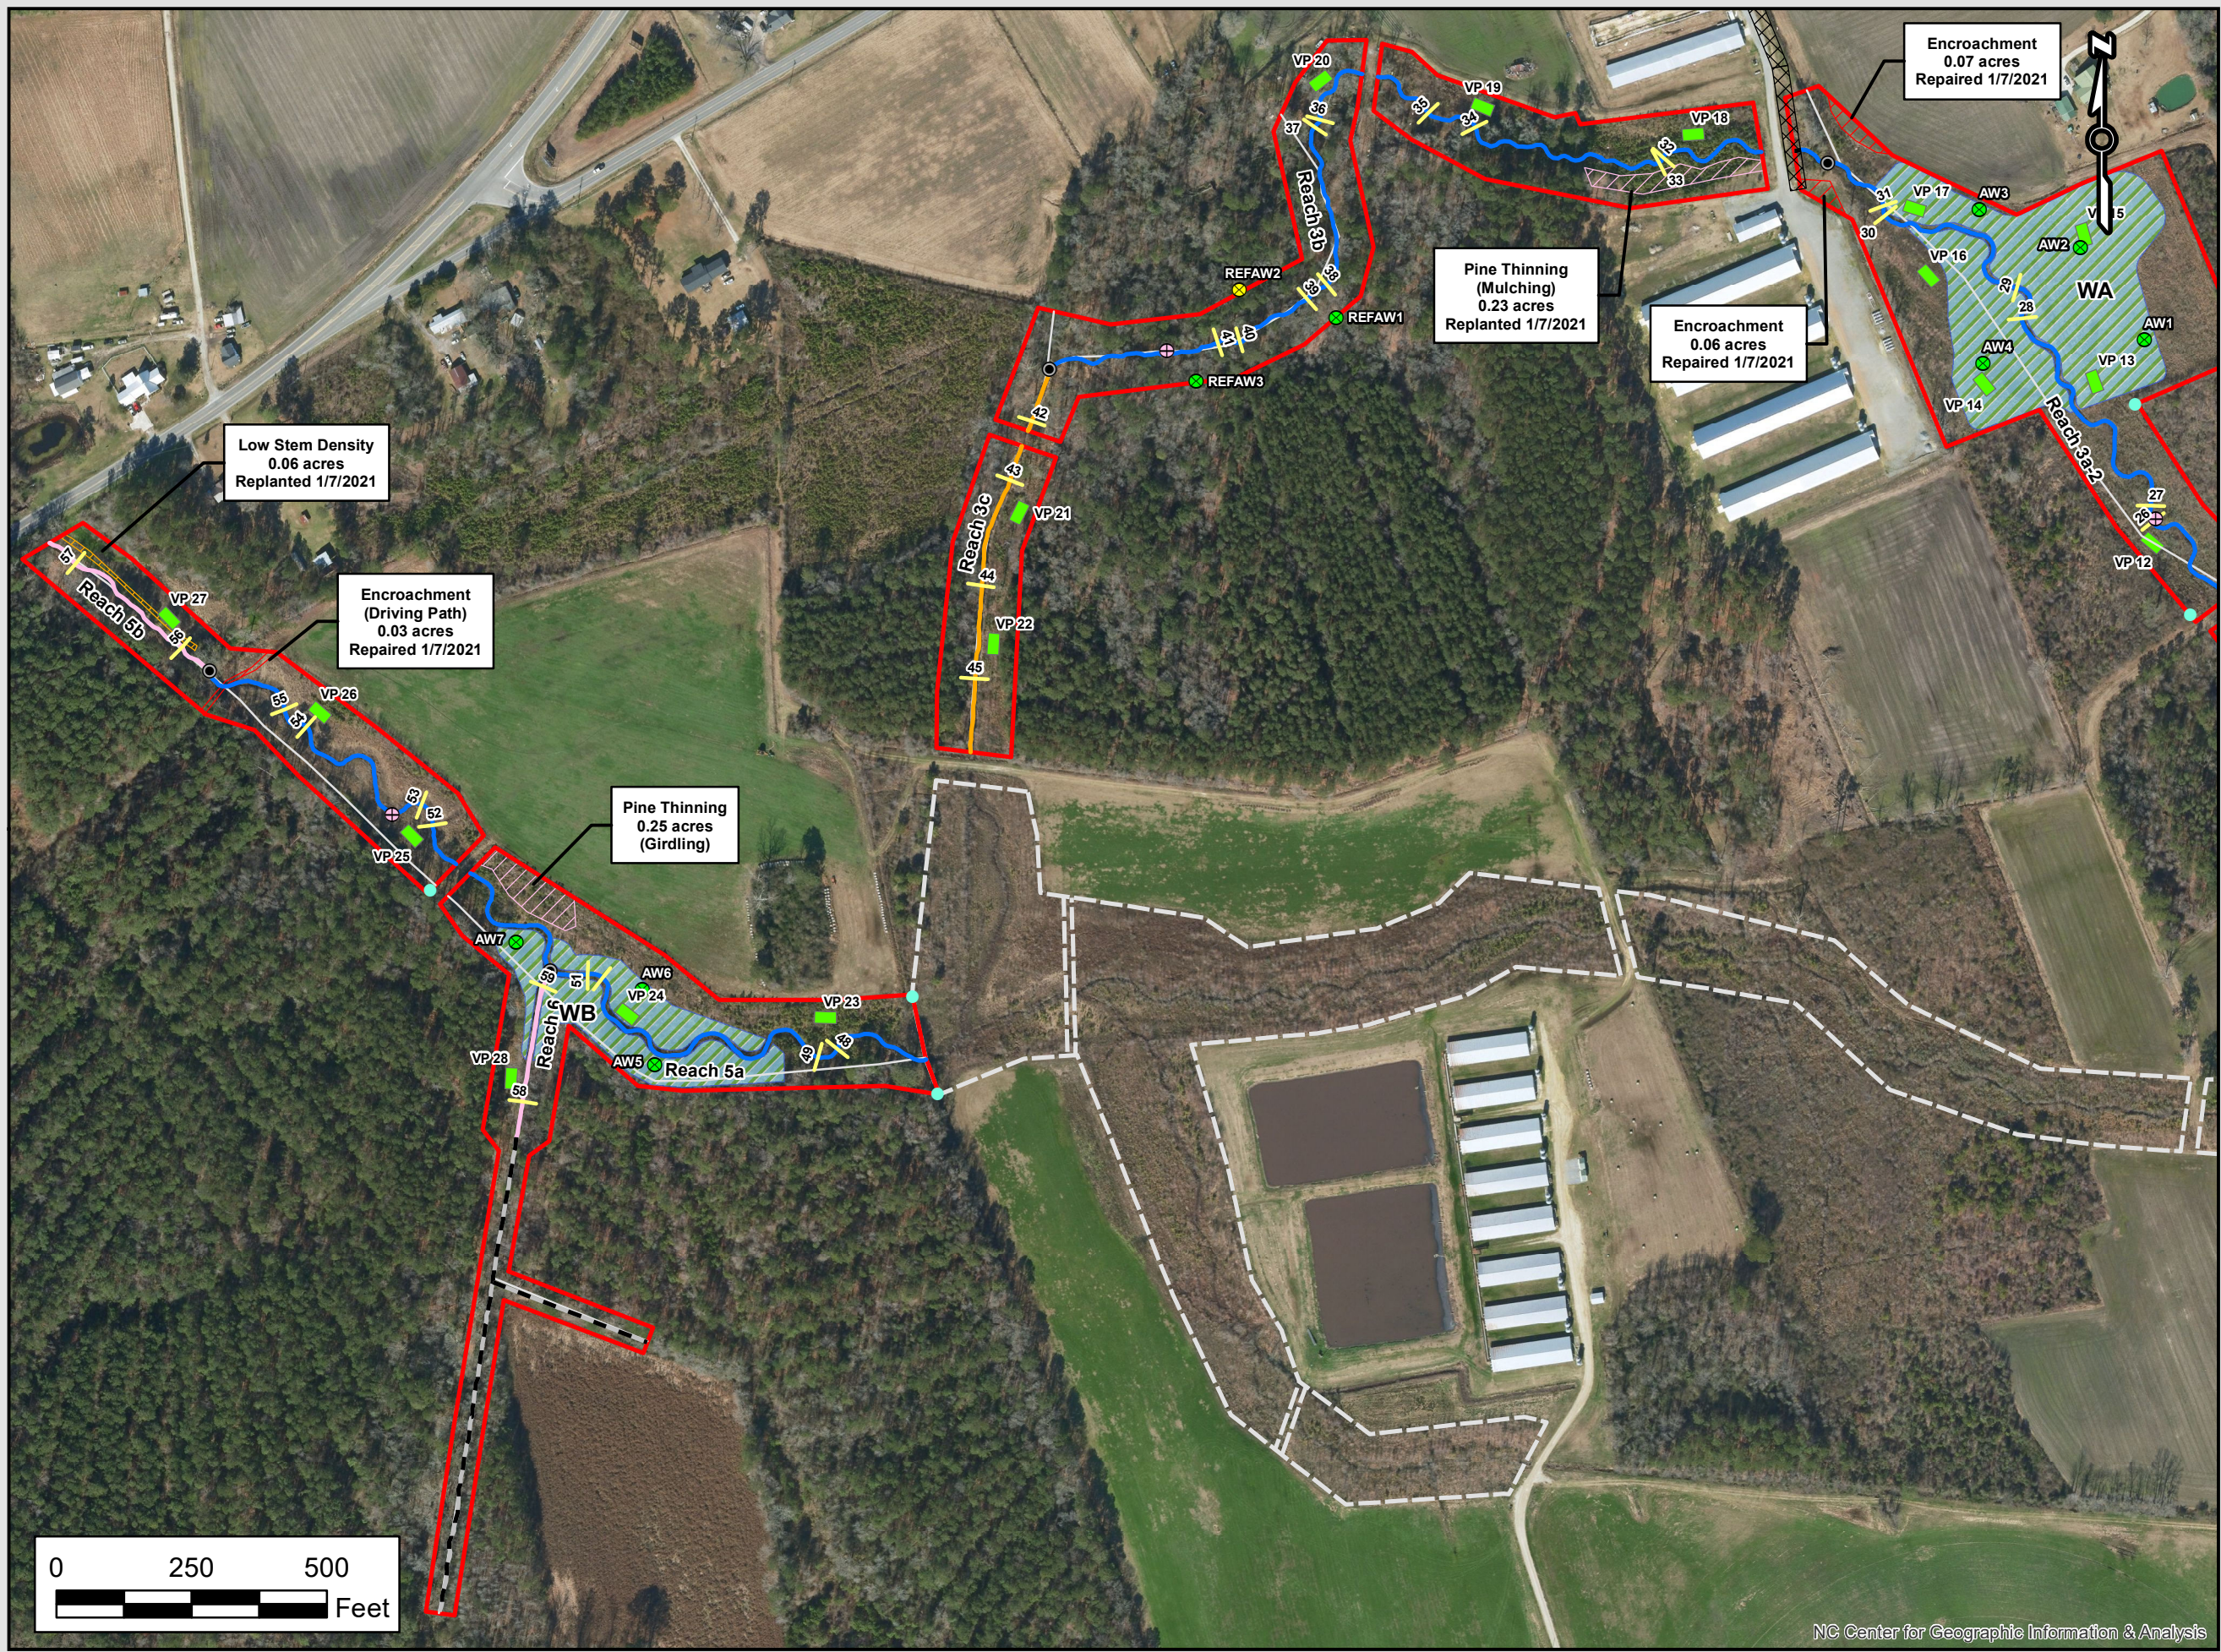

Legend

- Muddy Run II Easement
- Wetland Restoration Area
- Powerline ROW
- Vegetation Plot**
- >210 stems/acre
- Cross Sections
- P1 Restoration
- HWV Restoration
- Enhancement I
- Enhancement II
- Channel - No Credit
- Muddy Run Easement
- Pine Thinning
- Low Stem Density
- Encroachment
- Pre-Construction Channel
- Agricultural BMP
- ⊕ Stage Recorder
- Reach Breaks
- Well Hydroperiod**
- >9%
- ⊗ 5-8%





Figure 3b.
Muddy Run II
Mitigation Site
Current Conditions Map
Duplin County, NC
MY7 2020



Legend

- Muddy Run II Easement
- Wetland Restoration Area
- Vegetation Plot**
- >210 stems/acre
- Low Stem Density
- Encroachment
- Pine Thinning
- P1 Restoration
- HWV Restoration
- Enhancement I
- Enhancement II
- Channel - No Credit
- Muddy Run Easement
- Cross Sections
- Pre-Construction Channel
- Agricultural BMP
- ⊕ Stage Recorder
- ⊙ Reach Breaks
- Rain Gauge
- Well Hydroperiod**
- >9%
- 5-8%

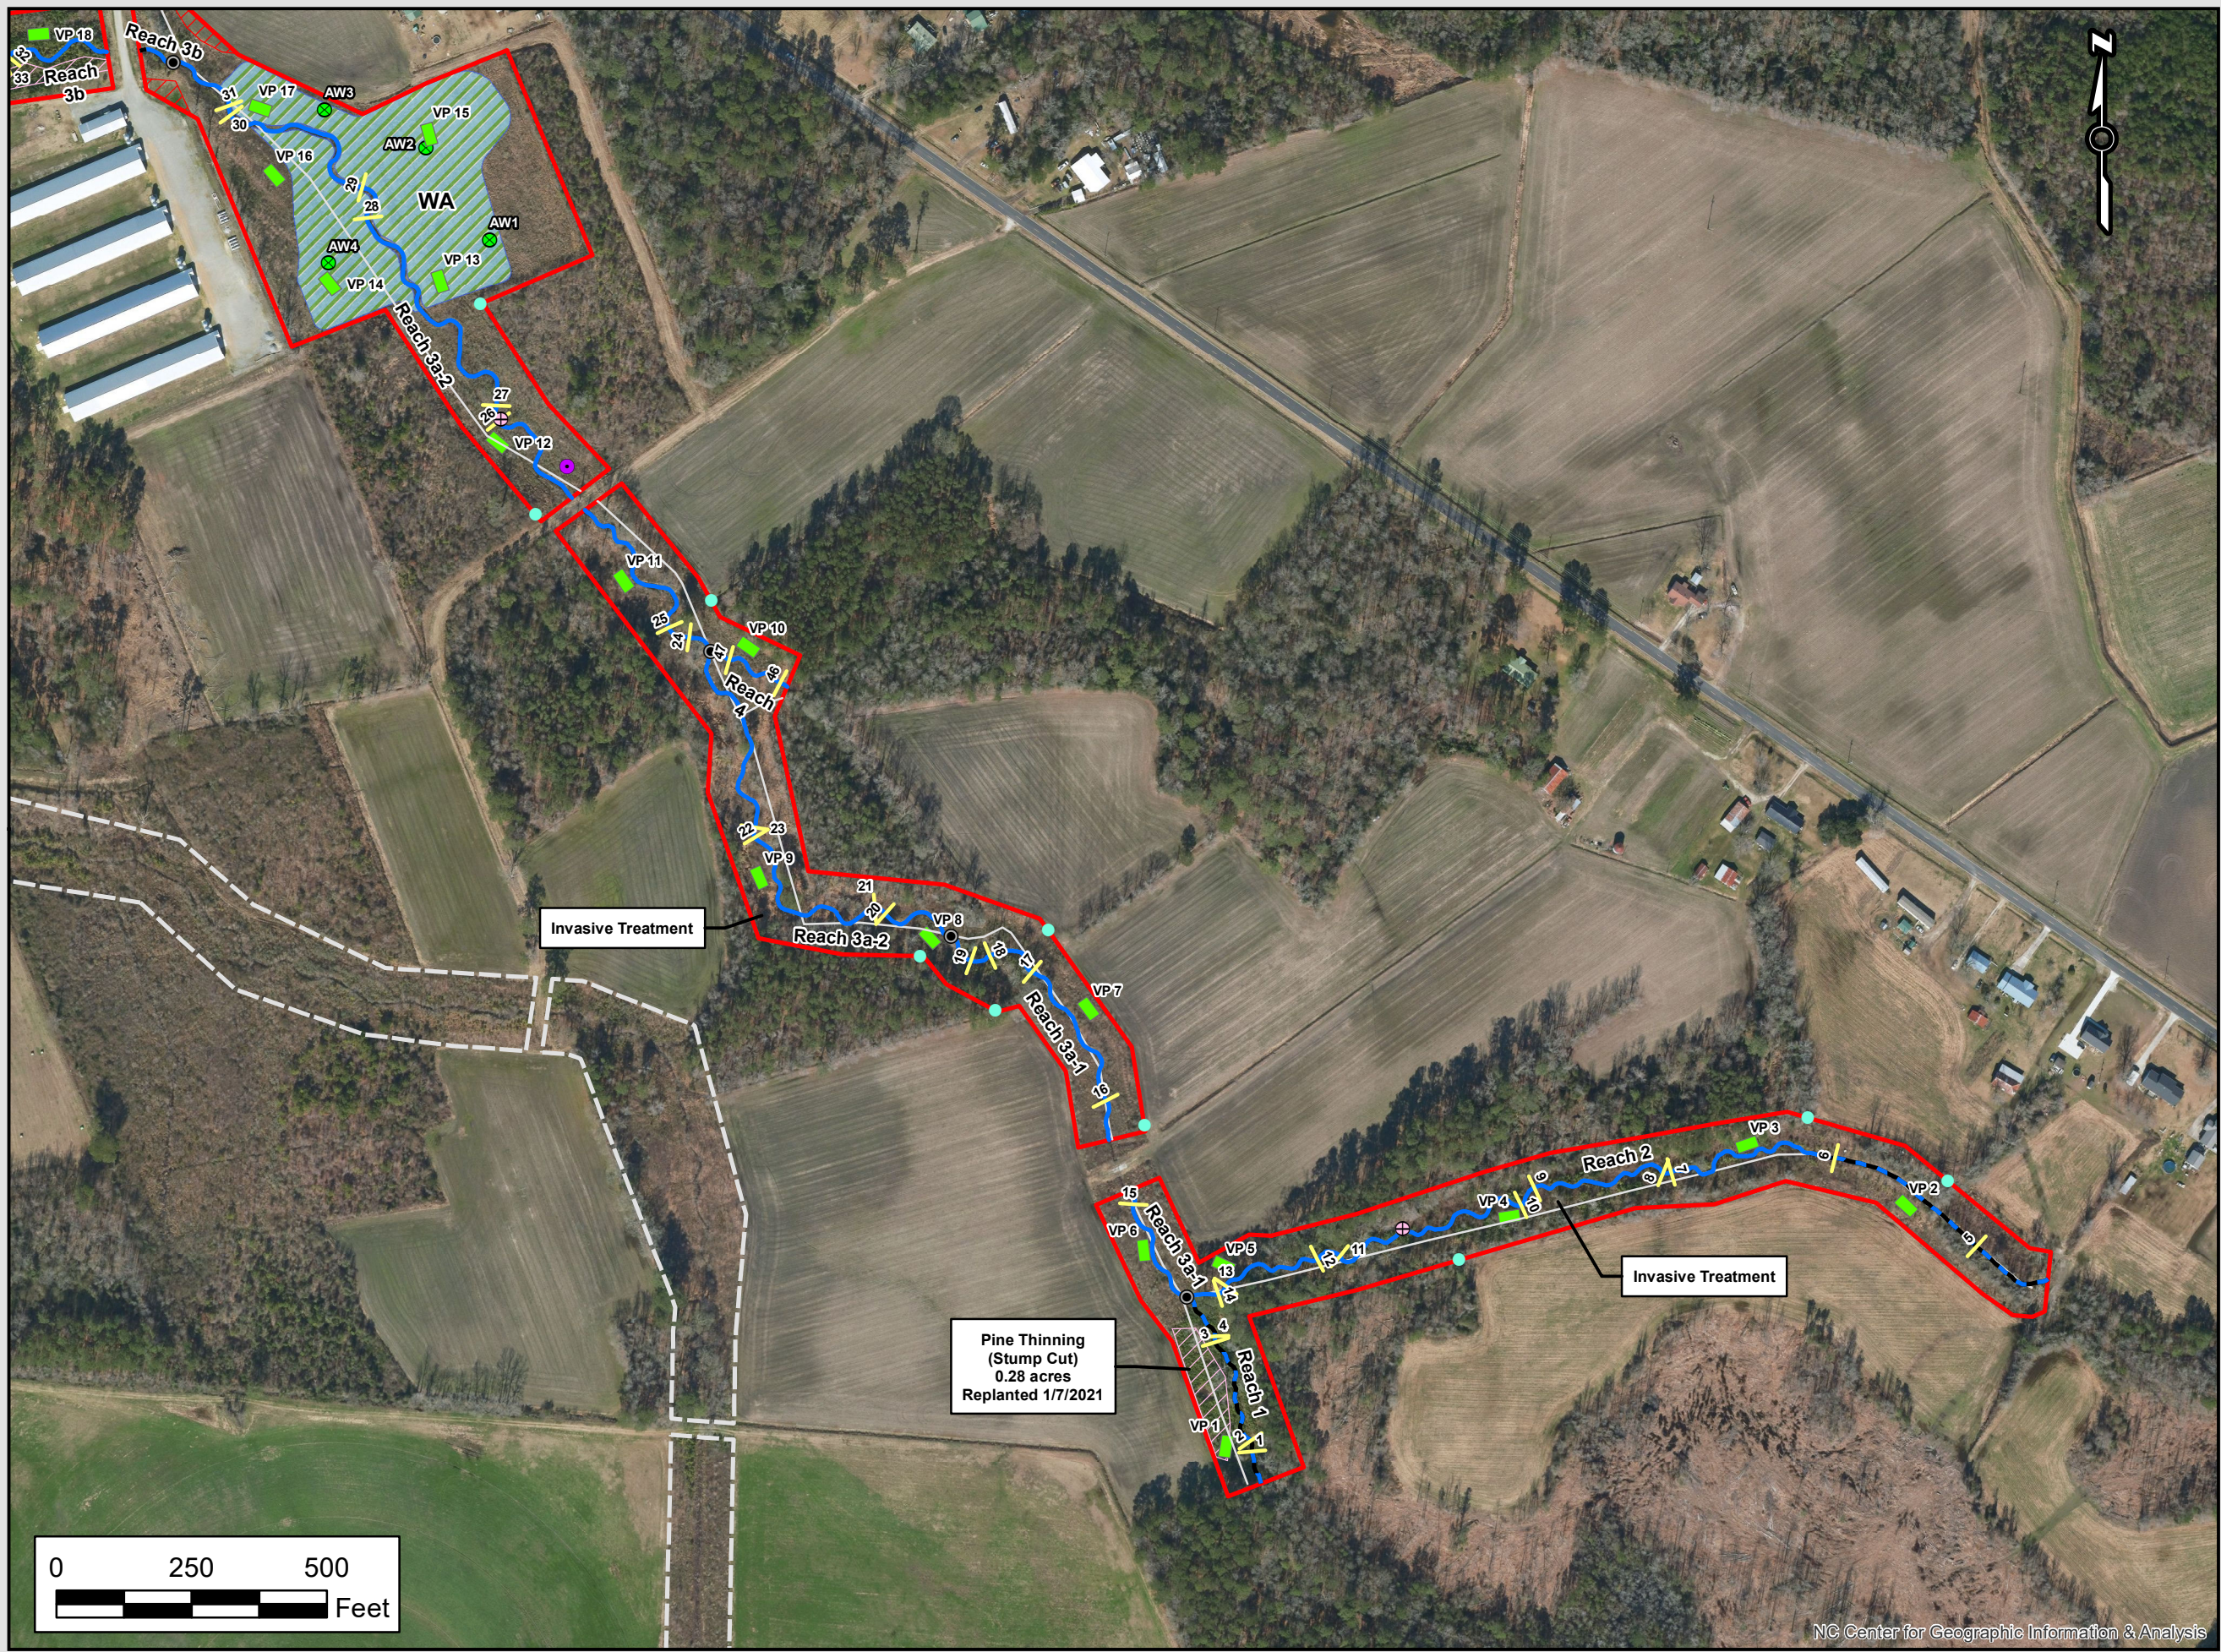

Invasive Treatment

Pine Thinning
(Stump Cut)
0.28 acres
Replanted 1/7/2021

Invasive Treatment

Table 5a
Reach ID
Assessed Length

Visual Stream Morphology Stability Assessment
Reach 1
398

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
		3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA			NA			
			2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA			NA			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
2. Thalweg centering at downstream of meander (Glide)		NA	NA	100%						
Totals										
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does <u>NOT</u> include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals										
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	4	4			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	4	4			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	4	4			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	0	0			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5b
Reach ID
Assessed Length

Visual Stream Morphology Stability Assessment
Reach 2
1914

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
	3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA	NA			100%			
		2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA	NA			100%			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
2. Thalweg centering at downstream of meander (Glide)		NA	NA	100%						
Totals										
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals										
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	14	14			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	13	13			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	14	14			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	1	1			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5c
Reach ID
Assessed Length

Visual Stream Morphology Stability Assessment
Reach 3A
3586

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
	3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA	NA			100%			
		2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA	NA			100%			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
2. Thalweg centering at downstream of meander (Glide)		NA	NA			100%				
Totals					0	0	100%	0	0	100%
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals					0	0	100%	0	0	100%
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	21	21			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	11	11			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	21	21			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	1	1			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	10	10			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5d
 Reach ID
 Assessed Length

Visual Stream Morphology Stability Assessment
 Reach 3B
 1979

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
	3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA	NA			100%			
		2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA	NA			100%			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
		2. Thalweg centering at downstream of meander (Glide)	NA	NA	100%					
Totals					0	0	100%	0	0	100%
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals					0	0	100%	0	0	100%
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	17	17			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	9	9			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	17	17			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	1	1			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	7	7			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5e
Reach ID
Assessed Length

Visual Stream Morphology Stability Assessment
Reach 3C
708

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
	3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA	NA			100%			
		2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA	NA			100%			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
		2. Thalweg centering at downstream of meander (Glide)	NA	NA			100%			
Totals					0	0	100%	0	0	100%
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	5	5			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	3	3			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	5	5			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	2	2			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5f
Reach ID
Assessed Length

Visual Stream Morphology Stability Assessment

Reach 4
173

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
	3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA	NA			100%			
		2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA	NA			100%			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
2. Thalweg centering at downstream of meander (Glide)		NA	NA	100%						
Totals					0	0	100%	0	0	100%
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	3	3			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	2	2			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	3	3			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	1	1			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5g
 Reach ID
 Assessed Length

Visual Stream Morphology Stability Assessment
 Reach 5A
 1926

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
		3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA			NA			
			2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA			NA			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
2. Thalweg centering at downstream of meander (Glide)		NA	NA	100%						
Totals										
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does <u>NOT</u> include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals										
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	22	22			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	16	16			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	22	22			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	6	6			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5h
 Reach ID
 Assessed Length

Visual Stream Morphology Stability Assessment
 Reach 5B
 409

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
	3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA	NA			100%			
		2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA	NA			100%			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
2. Thalweg centering at downstream of meander (Glide)		NA	NA	100%						
Totals					0	0	100%	0	0	100%
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	1	1			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	1	1			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	1	1			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	0	0			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 5a
 Reach ID
 Assessed Length

Visual Stream Morphology Stability Assessment
 Reach 6
 318

Major Channel Category	Channel Sub-Category	Metric	Number ¹ Stable, Performing as Intended	Total ¹ Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable ² , Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bed	1. Vertical Stability (Riffle and Run units)	1. <u>Aggradation</u> - Bar formation/growth sufficient to significantly deflect flow laterally (not to include point bars)			0	0	100%			
		2. <u>Degradation</u> - Evidence of downcutting			0	0	100%			
	2. Riffle Condition	1. <u>Texture/Substrate</u> - Riffle maintains coarser substrate	NA	NA			100%			
	3. Meander Pool Condition	1. <u>Depth</u> Sufficient (Max Pool Depth : Mean Bankfull Depth \geq 1.6)	NA	NA			100%			
		2. <u>Length</u> appropriate (>30% of centerline distance between tail of upstream riffle and head of downstream riffle)	NA	NA			100%			
	4. Thalweg Position	1. Thalweg centering at upstream of meander bend (Run)	NA	NA			100%			
2. Thalweg centering at downstream of meander (Glide)		NA	NA	100%						
Totals					0	0	100%	0	0	100%
2. Bank	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
3. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	2	2			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	2	2			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	2	2			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	0	0			100%			

¹ Bed - Coastal plain sand bed channels have a mobile bed along their entire length during geomorphically significant flows. Therefore, the number of shallows and pools, bedform shape, and thalweg position will vary by monitoring event and are not suitable indicators of stability or function.

² Percentage based on visual assessment of channel bed condition.

Table 6 **Vegetation Condition Assessment**

Planted Acreage¹

17

Vegetation Category	Definitions	Mapping Threshold	CCPV Depiction	Number of Polygons	Combined Acreage	% of Planted Acreage
1. Bare Areas	Very limited cover of both woody and herbaceous material.	0.1 acres	Red Lines	0	0.00	0.0%
2. Low Stem Density Areas	Woody stem densities clearly below target levels based on MY3, 4, or 5 stem count criteria.	0.1 acres	Orange Lines	0	0.00	0.0%
Total				0	0.00	0.0%
3. Areas of Poor Growth Rates or Vigor	Areas with woody stems of a size class that are obviously small given the monitoring year.	0.25 acres	Orange Lines	0	0.00	0.0%
Cumulative Total				0	0.00	0.0%

Easement Acreage²

37.6

Vegetation Category	Definitions	Mapping Threshold	CCPV Depiction	Number of Polygons	Combined Acreage	% of Easement Acreage
4. Invasive Areas of Concern ⁴	Areas or points (if too small to render as polygons at map scale).	1000 SF	Yellow Crosshatch	0	0.00	0.0%
5. Easement Encroachment Areas ³	Areas or points (if too small to render as polygons at map scale).	none	Red Lines	0	0.00	0.0%

¹ = Enter the planted acreage within the easement. This number is calculated as the easement acreage minus any existing mature tree stands that were not subject to supplemental planting of the understory, the channel acreage, crossings or any other elements not directly planted as part of the project effort.

² = The acreage within the easement boundaries.

³ = Encroachment may occur within or outside of planted areas and will therefore be calculated against the overall easement acreage. In the event a polygon is cataloged into items 1, 2 or 3 in the table and is the result of encroachment, the associated acreage should be tallied in the relevant item (i.e., item 1,2 or 3) as well as a parallel tally in item 5.

⁴ = Invasives may occur in or out of planted areas, but still within the easement and will therefore be calculated against the overall easement acreage. Invasives of concern/interest are listed below. The list of high concern species are those with the potential to directly outcompete native, young, woody stems in the short-term (e.g. monitoring period or shortly thereafter) or affect the community structure for existing, more established tree/shrub stands over timeframes that are slightly longer (e.g. 1-2 decades). The low/moderate concern group are those species that generally do not have this capacity over the timeframes discussed and therefore are not expected to be mapped with regularity, but can be mapped, if in the judgement of the observer their coverage, density or distribution is suppressing the viability, density, or growth of planted woody stems. Decisions as to whether remediation will be needed are based on the integration of risk factors by EEP such as species present, their coverage, distribution relative to native biomass, and the practicality of treatment. For example, even modest amounts of Kudzu or Japanese Knotweed early in the projects history will warrant control, but potentially large coverages of Microstegium in the herb layer will not likely trigger control because of the limited capacities to impact tree/shrub layers within the timeframes discussed and the potential impacts of treating extensive amounts of ground cover. Those species with the "watch list" designator in gray shade are of interest as well, but have yet to be observed across the state with any frequency. Those in *red italics* are of particular interest given their extreme risk/threat level for mapping as points where *isolated* specimens are found, particularly early in a projects monitoring history. However, areas of discreet, dense patches will of course be mapped as polygons. The symbology scheme below was one that was found to be helpful for symbolizing invasives polygons, particularly for situations where the condition for an area is somewhere between isolated specimens and dense, discreet patches. In any case, the point or polygon/area feature can be symbolized to describe things like high or low concern and species can be listed as a map inset, in legend items if the number of species are limited or in the narrative section of the executive summary.

Table 7. Stream Problem Areas			
Muddy Run II Stream and Wetland Restoration Project - Project # 95354			
Feature Issue	Station # / Range	Suspected Cause; Repair	Photo Number
N/A	N/A	N/A	N/A

Table 8. Vegetation Problem Areas			
Muddy Run II Stream and Wetland Restoration Project - Project # 95354			
Feature Category	Station Numbers	Suspected Cause; Repair	Photo Number
Low Stem Density	RB Reach 5b	Fire plow; Container tree planting (1/7/21)	1
Pine Thinning	LB Reach 3b	Pine thinning; Container tree planting (1/7/21)	2
Encroachment	Top of Reach 5b	Driving; Physical barrier & contact landowner (1/7/21)	3
Encroachment	Reach 3	Mowing; Physical barrier & planting (1/7/21)	4
Encroachment	Reach 3	Mowing; Physical barrier & planting (1/7/21)	5
Pine Thinning	Reach 1	Pine thinning; Container tree planting (1/7/21)	6

Figure 5. Stream and Vegetation Problem Area Photos

Stream Problem Area Photos

N/A

Vegetation Problem Areas Photos



Photo 1 – Low Stem Density Area - RB Reach 5b (Replanted January 2021)



Photo 2 – Pine Thinning Area - LB Reach 3b (Replanted January 2021)



Photo 3 – Encroachment - Top of Reach 5b (Repaired/Replanted January 2021)



Photo 4 – Encroachment – Reach 3 (Repaired/Replanted January 2021)



Photo 5 – Encroachment – Reach 3 (Repaired/Replanted January 2021)



Photo 6 – Pine Thinning – Reach 1 (Replanted January 2021)

Figure 4. Vegetation Plot Photos



Vegetation Plot 1 (11/03/20)



Vegetation Plot 2 (11/03/20)



Vegetation Plot 3 (11/03/20)



Vegetation Plot 4 (11/03/20)



Vegetation Plot 5 (11/03/20)



Vegetation Plot 6 (11/03/20)



Vegetation Plot 7 (11/03/20)



Vegetation Plot 8 (11/03/20)



Vegetation Plot 9 (11/03/20)



Vegetation Plot 10 (11/03/20)



Vegetation Plot 11 (11/03/20)



Vegetation Plot 12 (11/03/20)



Vegetation Plot 13 (11/03/20)



Vegetation Plot 14 (11/03/20)



Vegetation Plot 15 (11/03/20)



Vegetation Plot 16 (11/03/20)



Vegetation Plot 17 (11/03/20)



Vegetation Plot 18 (11/03/20)



Vegetation Plot 19 (11/03/20)



Vegetation Plot 20 (11/03/20)



Vegetation Plot 21 (11/03/20)



Vegetation Plot 22 (11/03/20)



Vegetation Plot 23 (11/03/20)



Vegetation Plot 24 (11/03/20)



Vegetation Plot 25 (11/03/20)



Vegetation Plot 26 (11/03/20)



Vegetation Plot 27 (11/03/20)



Vegetation Plot 28 (11/03/20)

Appendix C

Vegetation Plot Data

Table 9a. Planted Stem Count Summary

Table 9b. Planted Species Totals

Table 9c. Planted Stem Counts (Species by Plot)

Table 9a. Monitoring Year 7 Stem Count Summary

Vegetation Plot	Baseline		Year 1		Year 2			Year 3				Year 4				Year 5				Year 6				Year 7				
	Planted		Planted		Planted		Volunteers	Planted		Volunteers		Planted		Volunteers		Planted		Volunteers		Planted		Volunteers		Planted		Volunteers		
	Stems Planted	Stems/Acre Baseline	Living Stems	Stems/Acre Year 1	Living Stems	Stems/Acre Year 2	Living Stems	Total Stems/Acre Year 2	Living Stems	Stems/Acre Year 3	Living Stems	Total Stems/Acre Year 3	Living Stems	Stems/Acre Year 3	Living Stems	Total Stems/Acre Year 4	Living Stems	Stems/Acre Year 5	Living Stems	Total Stems/Acre Year 5	Living Stems	Stems/Acre Year 6	Living Stems	Total Stems/Acre Year 6	Living Stems	Stems/Acre Year 7	Living Stems	Total Stems/Acre Year 7
1	16	800	16	800	0	0	1	750	13	650	50	3150	13	650	186	9950	13	650	86	4950	12	600	2	700	9	450	0	450
2	17	850	14	700	0	0	--	550	11	550	0	550	11	550	43	2700	11	550	9	1000	11	550	0	550	11	550	4	750
3	15	750	13	650	0	0	--	550	11	550	0	550	10	500	53	3150	9	450	6	750	9	450	4	650	9	450	6	750
4	14	700	12	600	0	0	--	400	13	650	5	900	13	650	34	2350	13	650	6	950	13	650	0	650	12	600	2	700
5	16	800	12	600	0	0	--	500	11	550	0	550	13	650	21	1700	13	650	2	750	13	650	6	950	13	650	33	2300
6	17	850	14	700	0	0	--	650	13	650	0	650	13	650	7	1000	13	650	0	650	13	650	0	650	13	650	1	700
7	15	750	13	650	0	0	--	600	12	600	0	600	12	600	0	600	12	600	0	600	12	600	0	600	12	600	0	600
8	16	800	14	700	0	0	--	600	13	650	0	650	13	650	63	3800	13	650	131	7200	13	650	6	950	12	600	6	900
9	17	850	11	550	10	500	--	500	17	850	0	850	13	650	7	1000	12	600	2	700	13	650	5	900	13	650	3	800
10	14	700	9	450	0	0	1	350	6	300	1	350	8	400	2	500	8	400	0	400	8	400	1	450	8	400	1	450
11	13	650	13	650	0	0	--	550	11	550	0	550	12	600	19	1550	10	500	0	500	10	500	4	700	12	600	1	650
12	15	750	9	450	0	0	--	550	13	650	0	650	13	650	3	800	13	650	0	650	13	650	0	650	13	650	15	1400
13	16	800	14	700	0	0	--	650	14	700	0	700	13	650	16	1450	13	650	38	2550	13	650	2	750	13	650	4	850
14	14	700	10	500	0	0	--	500	9	450	0	450	9	450	129	6900	9	450	23	1600	9	450	4	650	9	450	28	1850
15	15	750	13	650	13	650	5	900	19	950	0	950	20	1000	65	4250	20	1000	12	1600	20	1000	7	1350	20	1000	0	1000
16	16	800	15	750	0	0	--	700	12	600	0	600	12	600	71	4150	12	600	73	4250	12	600	1	650	12	600	28	2000
17	15	750	10	500	11	550	1	600	12	600	0	600	12	600	7	950	12	600	4	800	14	700	0	700	15	750	9	1200
18	14	700	14	700	13	650	1	700	14	700	0	700	14	700	71	4250	13	650	45	2900	13	650	0	650	14	700	1	750
19	9	450	8	400	0	0	--	550	13	650	0	650	9	450	168	8850	9	450	48	2850	9	450	10	950	9	450	23	1600
20	10	500	7	350	0	0	--	250	8	400	1	450	8	400	76	4200	8	400	0	400	8	400	2	500	8	400	33	2050
21	18	900	16	800	15	750	--	750	12	600	0	600	13	650	12	1250	13	650	4	850	13	650	0	650	13	650	0	650
22	16	800	13	650	12	600	--	600	11	550	0	550	11	550	23	1700	11	550	18	1450	11	550	0	550	11	550	21	1600
23	13	650	11	550	12	600	--	600	14	700	35	2450	14	700	60	3700	15	750	66	4050	15	750	12	1350	15	750	65	4000
24	17	850	11	550	8	400	--	400	8	400	0	400	8	400	33	2050	8	400	39	2350	8	400	10	900	7	350	18	1250
25	16	800	12	600	11	550	--	550	21	1050	0	1050	21	1050	4	1250	20	1000	0	1000	15	750	0	750	13	650	6	950
26	11	550	7	350	6	300	--	300	20	1000	34	2700	18	900	64	4100	17	850	3	1000	15	750	11	1300	17	850	57	3700
27	19	950	17	850	16	800	--	800	16	800	0	800	16	800	12	1400	16	800	7	1150	13	650	0	650	6	300	3	450
28	17	850	17	850	15	750	--	750	14	700	0	700	15	750	68	4150	15	750	0	750	15	750	0	750	15	750	11	1300
Average	15.0	752	12.0	616	5.0	254	2	577	13.0	645	5	2989	13.0	638	47	2989	13.0	627	22	1738	12.0	613	3	768	12.0	596	14	1273
Min	9	450	7	350	0	0	1	250	6	300	0	350	8	400	0	500	8	400	0	400	8	400	0	450	6	300	0	450
Max	19	950	17	850	16	800	5	900	21	1050	50	2700	21	1050	186	9950	20	1000	131	7200	20	1000	12	1350	20	1000	65	4000

* Calculations include volunteer species

Plot Size = 40 X 22 feet = 0.020 Acres

Number Trees/Acres = # of Trees * 50

Table 9b. Planted Species Totals

Species	Common Name	Total Planted
Trees - Bare Root		
<i>Taxodium distichum</i>	Bald Cypress	1,800
<i>Fraxinus pennsylvanica</i>	Green Ash	1,900
<i>Quercus lyrata</i>	Overcup Oak	1,800
<i>Betula nigra</i>	River birch	1,800
<i>Quercus michauxii</i>	Swamp Chestnut Oak	2,200
<i>Nyssa biflora</i>	Swamp Tupelo	2,000
<i>Plantanus occidentalis</i>	American Sycamore	2,200
<i>Quercus laurifolia</i>	Laurel Oak	1,800
Total		15,500
Live Stakes		
<i>Salix nigra</i>	Black Willow	3,000
Total		3,000

Appendix D

Stream Geomorphology Data

Table 10. Morphological Parameters Summary Data

Table 11. Dimensional Morphology Summary – Cross Sections Data

Table 12. Bank Pin Array Summary Data

Cross Section Plots

Appendix D. Table 10 - Morphological Parameters Summary Data

Project Name/Number: Muddy Run II Mitigation Project/95354

Feature	Reference Reach			Existing ^{1,2}										Design						As-Built/Baseline																		
	Pool	Run	Shallow	MRII 1	MRII 2	MRII 3A	MRII 3B	MRII 3C	MRII 4	MRII 5A	MRII 5B	MRII 6	MRII 2	MRII 3A (U/S)	MRII 3A (D/S)	MRII 3B	MRII 4	MRII 5A	MRII 1	MRII 2	MRII 3A (U/S)	MRII 3A (D/S)	MRII 3B	MRII 4	MRII 5A													
				Run	Run	Run	Run	Run	Run	Run	Run	Run	Run	Run	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow	Shallow									
Drainage Area (ac)	286	286	286	68	115	227	NA/313	74/360	45	424/774	583/909	77	115	209	254	333	45	774	68	115	209	254	333	45	774	68	115	209	254	333	45	774						
NC Regional Curve Discharge (cfs)			9.3	3	5	8	NA/10	4/11	2	13/18	16/21	4																										
Design/Calculated Discharge (cfs)			13										7	14	16	10	5	40	5	7	14	16	10	5	40	5	7	14	16	10	5	40						
Dimension																																						
BF Width (ft)	10.9	8.9	7.0	4.8	8.1	6.9	7.1	8.0	4.2	6.7	9.9	6.9	7.6	9.2	12.4	9	5.6	15	9.7	11.28	10.4	11.9	9.8	8.4	14.7													
Floodprone Width (ft)	100	100	100	8.7	10.2	8.1	>50	12.9	6.1	11.9	11.6	10.0	>40	>30	>30	>30	>30	>40	>30	>50	>50	>50	>50	>40	>50													
BF Cross Sectional Area (ft ²)	11.4	8.4	5.0	2.3	4.1	2.8	2.4	3.9	2.1	6.6	11.1	6.2	5.9	8.7	15.7	8.3	3.3	22.7	3.7	10.2	11.6	16.5	8.0	6.3	23.9													
BF Mean Depth (ft)	1.0	0.9	0.8	0.5	0.5	0.4	0.3	0.5	0.5	1.0	1.1	0.9	0.78	0.9	1.3	0.9	0.6	1.5	0.4	0.9	1.1	1.4	0.9	0.8	1.6													
BF Max Depth (ft)	2.1	1.7	1.3	0.8	0.8	0.6	0.8	0.9	0.7	1.5	1.5	1.3	1.3	1.5	2.0	1.5	0.9	2.4	1.0	1.6	1.8	2.1	1.4	1.5	2.6													
Width/Depth Ratio	10.4	9.5	8.8	9.6	16.2	17.3	20.9	16.0	8.4	6.7	9.0	7.7	9.7	9.8	9.8	9.7	9.3	9.9	25.8	12.9	9.4	8.7	13.9	11.1	9.1													
Entrenchment Ratio	9.2	11.2	15.1	1.8	1.3	1.2	>2.2	1.6	1.5	1.8	1.2	1.4	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2													
Wetted Perimeter (ft)	12.8	9.7	7.4	5.2	8.3	7.1	7.4	8.3	4.6	7.6	11.4	7.8	8.1	9.8	13.2	9.6	6.0	15.9	10.1	11.9	11.2	13.1	10.4	9.1	15.9													
Hydraulic Radius (ft)	0.9	0.9	0.7	0.4	0.5	0.4	0.3	0.5	0.4	0.9	1.0	0.8	0.7	0.9	1.2	0.9	0.5	1.4	0.4	0.8	1.0	1.2	0.9	0.7	1.4													
Substrate																																						
Fine Sand			Fine Sand										Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand	Fine Sand								
Pattern																																						
	Min	Max	Med	---	---	---	---	---	---	---	---	---	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max				
Channel Beltwidth (ft)	13.6	31.8	23.1	---	---	---	---	---	---	---	---	---	14	32	17	39	22	53	16	38	10	24	27	64	7	17	14	39	16	52	21	44	18	36	8	24	19	68
Radius of Curvature (ft)	11.0	27.6	17.6	---	---	---	---	---	---	---	---	---	11	28	13	34	18	46	13	33	8	21	22	55	10	31	7	28	15	44	12	29	15	45	13	19	23	38
Radius of Curvature Ratio	1.5	3.7	2.3	---	---	---	---	---	---	---	---	---	1.5	3.7	1.5	3.7	1.5	3.7	1.5	3.7	1.5	3.7	1.5	3.7	1.0	3.2	0.6	2.5	1.4	4.2	1.0	2.4	1.6	4.5	1.5	2.3	1.6	2.6
Meander Wavelength (ft)	34.9	68.3	54.5	---	---	---	---	---	---	---	---	---	35	69	43	84	58	113	42	82	26	51	70	137	17	38	13	53	31	81	23	53	33	65	23	33	41	77
Meander Width Ratio	1.8	4.2	3.1	---	---	---	---	---	---	---	---	---	1.8	4.2	1.8	4.2	1.8	4.2	1.8	4.2	1.8	4.2	1.8	4.2	0.7	1.8	1.2	3.5	1.5	5.0	1.7	3.7	1.9	3.7	0.9	2.8	1.3	4.6
Profile																																						
Shallow Length (ft)	3.1	30.7	12.6	---	---	---	---	---	---	---	---	---	3	31	4	38	5	51	4	37	2	23	6	61	8	12	7	22	7	20	5	45	6	25	6	23	6	35
Run Length (ft)	2.2	33.2	11.3	---	---	---	---	---	---	---	---	---	2	34	3	41	4	55	3	40	2	25	4	66	8	9	5	16	8	25	5	56	5	20	4	15	8	27
Pool Length (ft)	4.2	9.5	5.8	---	---	---	---	---	---	---	---	---	4	10	5	12	7	16	5	11	3	7	8	19	8	10	14	29	10	28	13	30	13	25	12	15	8	23
Pool -to-Pool Spacing (ft)	17.5	59.8	36.3	---	---	---	---	---	---	---	---	---	18	60	22	74	29	99	21	72	13	45	35	120	15	42	36	60	18	63	25	100	17	56	43	75	15	104
Additional Reach Parameters																																						
Valley Length (ft)	274			382	1678	3301	908	745	90	1620	383	1172	1682	1524	1648	1693	175	1530	376	1682	1524	1648	1693	175	1530													
Channel Length (ft)	309			382	1678	3301	908	745	90	1620	383	1172	1828	1738	1890	1849	202	1790	398	1914	1796	1790	1979	173	1926													
Sinuosity	1.1			1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.09	1.14	1.15	1.09	1.15	1.17	1.1	1.14	1.18	1.09	1.17	0.99	1.26													
Water Surface Slope (ft/ft)	0.004			---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---													
Channel Slope (ft/ft)	0.003			0.0043	0.0021	0.0016	0.0023	0.0022	0.0034	0.0024	0.0015	0.002427	0.0017	0.0026	0.0005	0.0014	0.0049	0.0017	0.0037	0.0022	0.0038	0.001	0.003	0.008	0.0030													
Rosgen Classification	E5			G5c	F5	F5	C5	F5	G5c	G5c	G5c	G5c	E5	E5	E5	E5	E5	E5	E5	E5	E5	E5	E5	E5	E5													
*Habitat Index																																						

¹ Bankfull stage was estimated using NC Regional Curve equations and existing conditions data

Table 12.Muddy Run II Bank Pin Array Summary

Cross Section	Location	Position	Year 1	Year 2	Year 3	Year 5	Year 7
			Reading	Reading	Reading	Reading	Reading
XS 2 @ Sta. 1+35 Reach 1	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 3 @ Sta. 3+45 Reach 1	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 8 @ Sta. 8+55 Reach 2	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 10 @ Sta. 11+70 Reach 2	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 12 @ Sta. 16+40 Reach 2	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 18 @ Sta. 8+40 Reach 3A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 21 @ Sta. 11+20 Reach 3A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 25 @ Sta. 19+80 Reach 3A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 26 @ Sta. 25+90 Reach 3A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 28 @ Sta. 31+40 Reach 3A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0

Cross Section	Location	Position	Year 1	Year 2	Year 3	Year 5	Year 7
			Reading	Reading	Reading	Reading	Reading
XS 30 @ Sta. 35+60 Reach 3A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 33 @ Sta. 40+90 Reach 3B	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 36 @ Sta. 48+90 Reach 3B	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 38 @ Sta. 52+10 Reach 3B	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 40 @ Sta. 54+15 Reach 3B	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.2	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 47 @ Sta. 1+90 Reach 4	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 49 @ Sta. 2+40 Reach 5A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.6	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 50 @ Sta. 8+20 Reach 5A	US	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 53 @ Sta. 13+90 Reach 5A	US	Top	0.0	0.6 ft	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
	DS	Top	0.0	0.0	0.0	0.0	0.0
		Bottom	0.0	0.0	0.0	0.0	0.0
XS 54 @ Sta. 17+35 Reach 5A	US	Top	0.0	missing	*	*	*
		Bottom	0.0	missing	*	*	*
	DS	Top	0.0	missing	*	*	*
		Bottom	1.0	missing	*	*	*

Notes:

US - Upstream from cross section

DS - Downstream from cross section


* Did not replace after Reach 5A repair work in 2016.



Upstream



Downstream

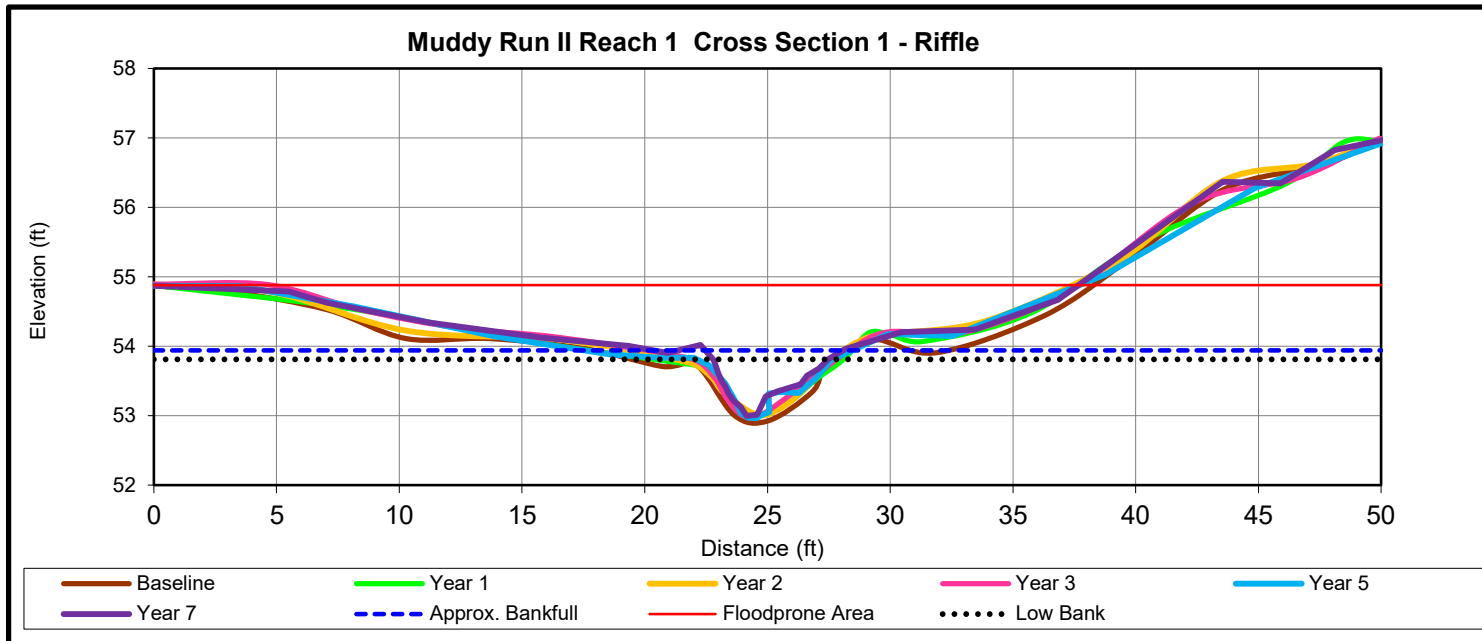

DIMENSIONS SUMMARY	Cross Section 1 (Riffle)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	53.7	53.7	53.7	53.7	53.9	53.9	
Bankfull Width (ft) ¹	6.3	4.9	5.2	5.1	8.4	5.6	
Floodprone Width (ft) ¹	30.0	30.0	30.0	30.0	31.6	37.7	
Bankfull Mean Depth (ft)	0.4	0.4	0.4	0.4	0.3	-	
Bankfull Max Depth (ft) ²	0.8	0.7	0.7	0.7	0.9	0.1	
Low Bank Elevation (ft)	-	-	-	-	-	53.8	
Bankfull Cross Sectional Area (ft ²) ²	2.7	2.0	2.1	2.0	2.7	2.1	
Bankfull Width/Depth Ratio	14.4	12.2	13.2	13.0	26.0	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.8	>6.7	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.0	1.0	


Note: Starting in MY6, the parameters denoted with 1 were calculated using the as-built cross sectional area as the basis for adjusting the bankfull elevation and the parameters denoted with 2 were calculated using the current years low top of bank as the bankfull elevation. These changes reflect the 2018 guidance that arose from the mitigation technical workgroup consisting of DMS, the IRT, and industry mitigation providers.



Upstream



Downstream

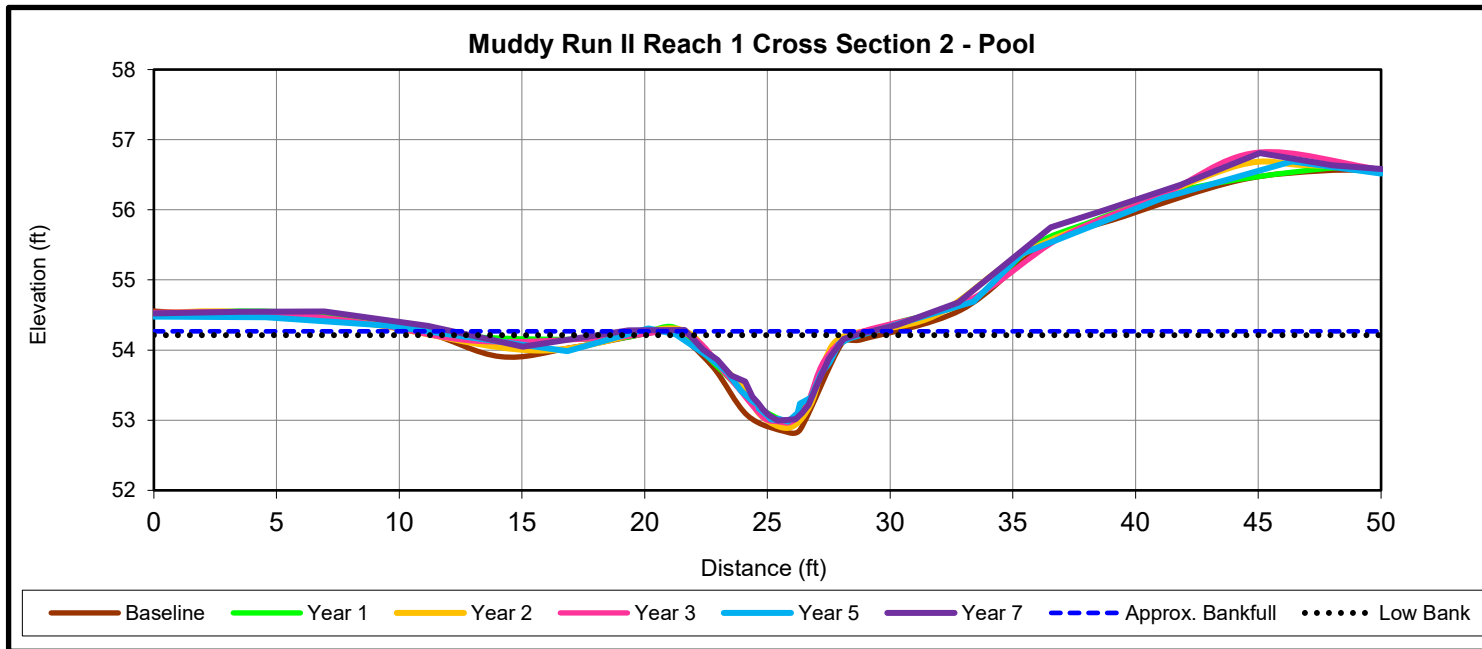


DIMENSIONS SUMMARY	Cross Section 2 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XS A ¹	54.1	54.1	54.1	54.1	54.2	54.3	
Bankfull Width (ft) ¹	6.4	5.6	6.0	6.7	7.8	7.6	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	36.3	50.0	
Bankfull Mean Depth (ft)	0.7	0.6	0.6	0.7	0.6	-	
Bankfull Max Depth (ft) ²	1.3	1.1	1.2	1.2	1.3	1.2	
Low Bank Elevation (ft)	-	-	-	-	-	54.2	
Bankfull Cross Sectional Area (ft ²) ²	4.7	3.5	3.8	4.5	4.7	4.3	
Bankfull Width/Depth Ratio	8.8	8.7	9.4	10.1	12.9	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0		N/A	N/A	



Upstream



Downstream

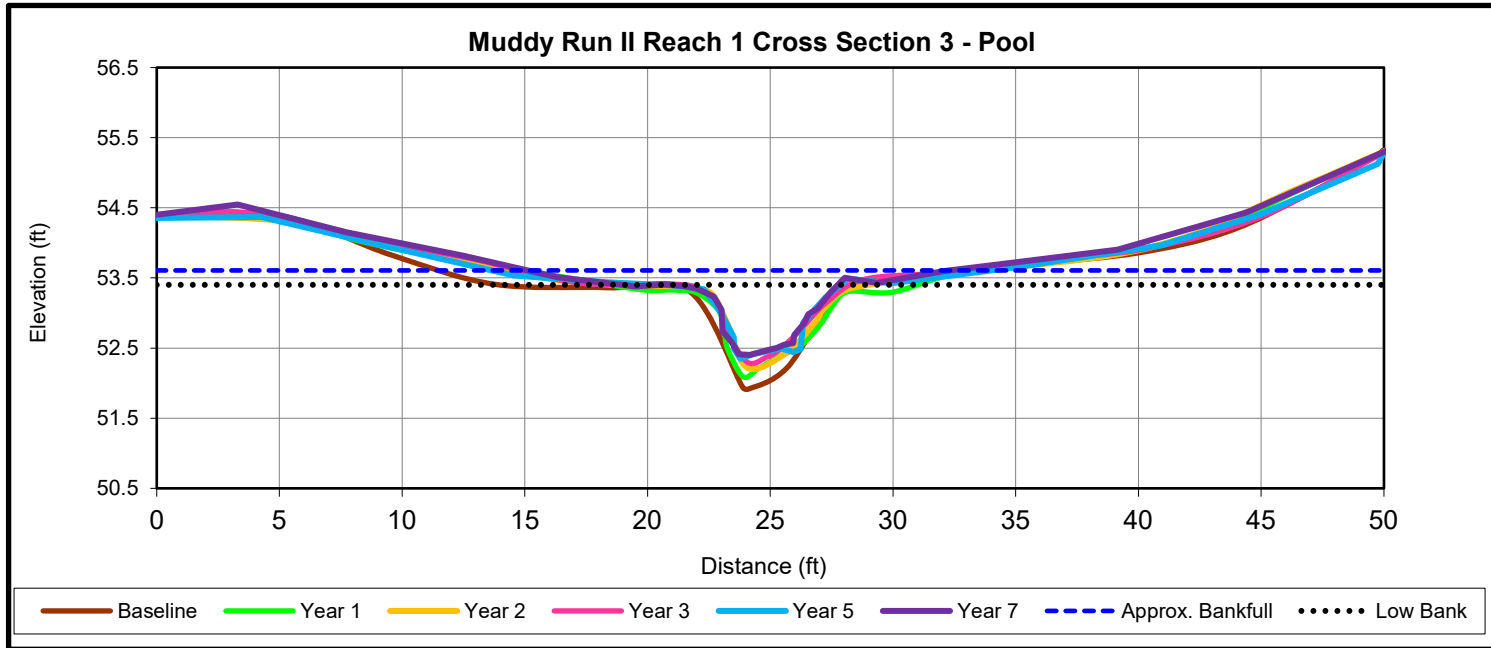


DIMENSIONS SUMMARY	Cross Section 3 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	53.3	53.3	53.3	53.3	53.5	53.6	
Bankfull Width (ft) ¹	6.3	6.2	5.7	5.9	17.0	7.3	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	46.9	50.0	
Bankfull Mean Depth (ft)	0.8	0.6	0.6	0.5	0.3	-	
Bankfull Max Depth (ft) ³	1.4	1.2	1.1	1.0	1.2	1.0	
Low Bank Elevation (ft)	-	-	-	-	-	53.4	
Bankfull Cross Sectional Area (ft ²) ²	5.0	4.0	3.3	3.1	5.0	3.5	
Bankfull Width/Depth Ratio	7.9	9.6	9.8	11.2	57.2	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

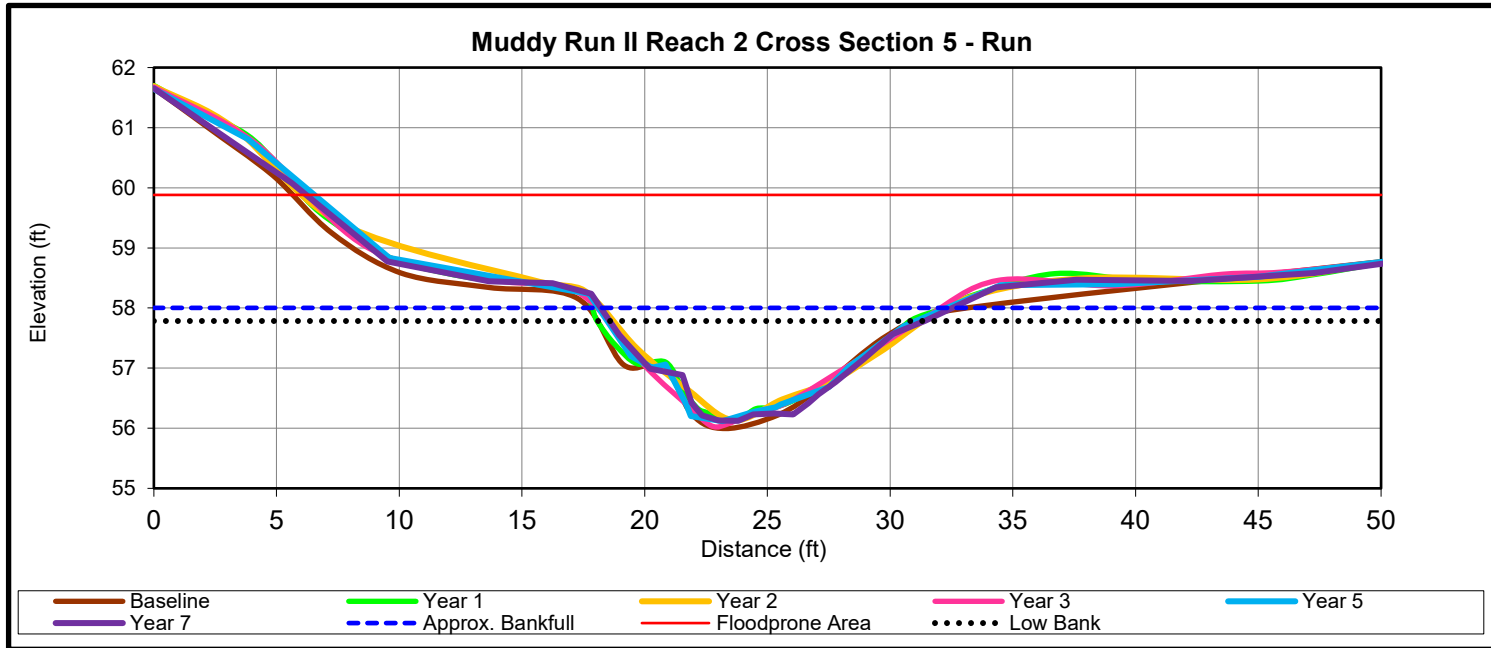


DIMENSIONS SUMMARY	Cross Section 5 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XS A ¹	58.0	58.0	58.0	58.0	58.0	58.0	
Bankfull Width (ft) ¹	14.8	14.5	14.2	14.3	14.4	14.3	
Floodprone Width (ft) ¹	45.0	45.0	45.0	45.0	43.9	44.0	
Bankfull Mean Depth (ft)	1.1	1.0	1.0	1.1	1.1	-	
Bankfull Max Depth (ft) ³	2.0	1.8	1.9	2.0	1.9	1.7	
Low Bank Elevation (ft)	-	-	-	-	-	57.8	
Bankfull Cross Sectional Area (ft ²) ²	15.6	14.5	14.7	15.4	15.6	12.6	
Bankfull Width/Depth Ratio	14.0	13.7	13.8	13.2	13.3	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.1	>3.1	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.1	0.9	



Upstream



Downstream

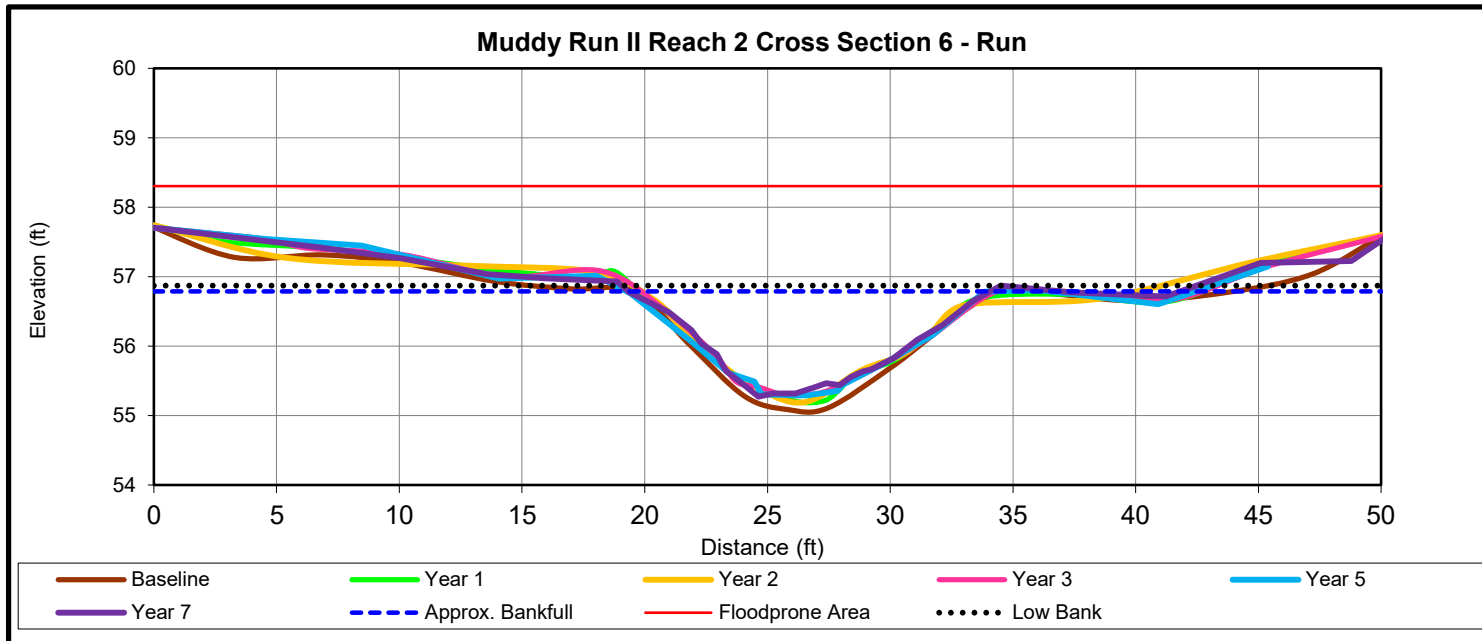

DIMENSIONS SUMMARY	Cross Section 6 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	56.6	56.6	56.6	56.6	56.7	56.8	
Bankfull Width (ft) ¹	13.5	13.4	12.7	13.1	14.3	14.8	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft) ¹	0.9	0.9	0.8	0.8	0.9	-	
Bankfull Max Depth (ft) ²	1.6	1.5	1.4	1.3	1.5	1.6	
Low Bank Elevation (ft)	-	-	-	-	-	56.9	
Bankfull Cross Sectional Area (ft ²) ²	12.7	11.5	10.2	10.3	12.7	13.9	
Bankfull Width/Depth Ratio	14.5	15.7	15.7	16.7	16.0	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.5	>3.4	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.0	1.1	


Note: Starting in MY6, the parameters denoted with 1 were calculated using the as-built cross sectional area as the basis for adjusting the bankfull elevation and the parameters denoted with 2 were calculated using the current years low top of bank as the bankfull elevation. These changes reflect the 2018 guidance that arose from the mitigation technical workgroup consisting of DMS, the IRT, and industry mitigation providers.



Upstream



Downstream

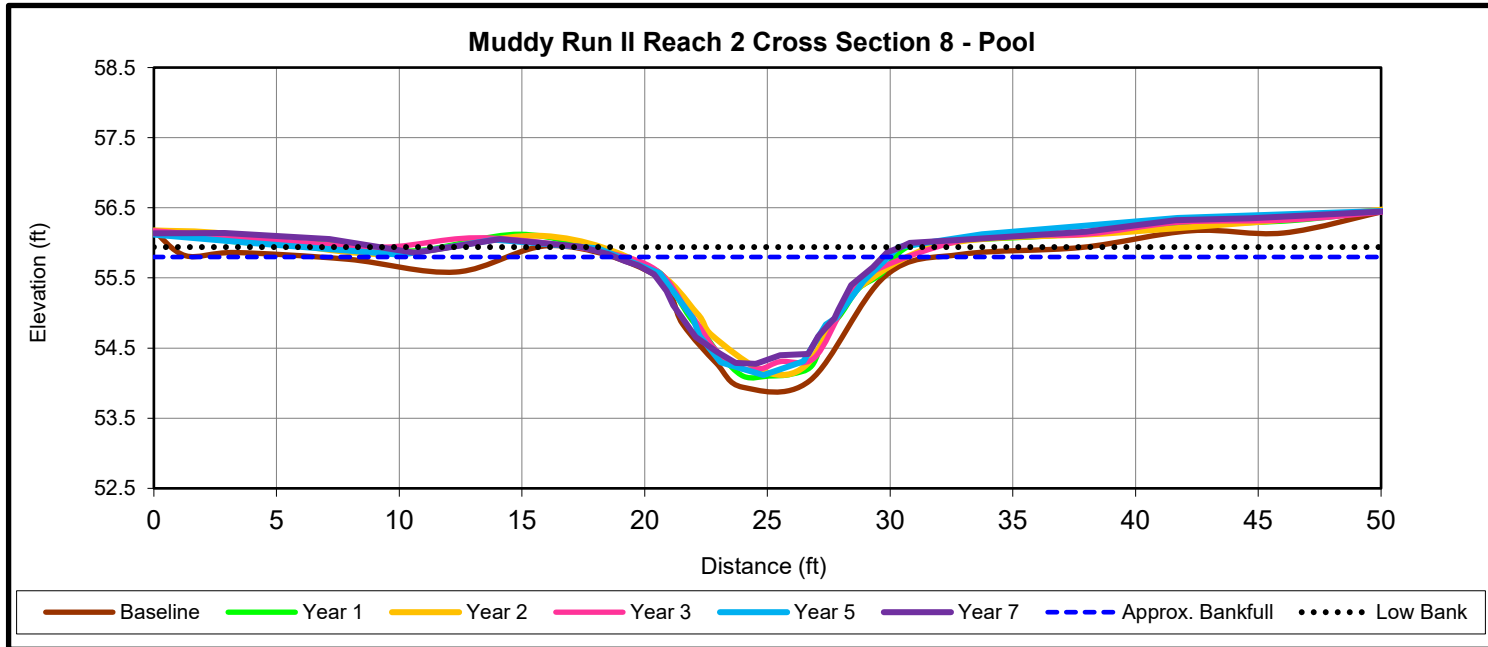


DIMENSIONS SUMMARY	Cross Section 8 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA1	55.5	55.5	55.5	55.5	55.8	55.8	
Bankfull Width (ft)1	9.4	8.8	8.8	8.6	10.6	10.9	
Floodprone Width (ft)1	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.0	0.9	0.8	0.8	0.9	-	
Bankfull Max Depth (ft)2	1.6	1.4	1.3	1.3	1.7	1.7	
Low Bank Elevation (ft)	-	-	-	-	-	55.9	
Bankfull Cross Sectional Area (ft ²)2	9.7	7.8	6.7	7.1	9.7	11.4	
Bankfull Width/Depth Ratio	9.0	10.0	11.7	10.5	11.7	-	
Bankfull Entrenchment Ratio1	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio1	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

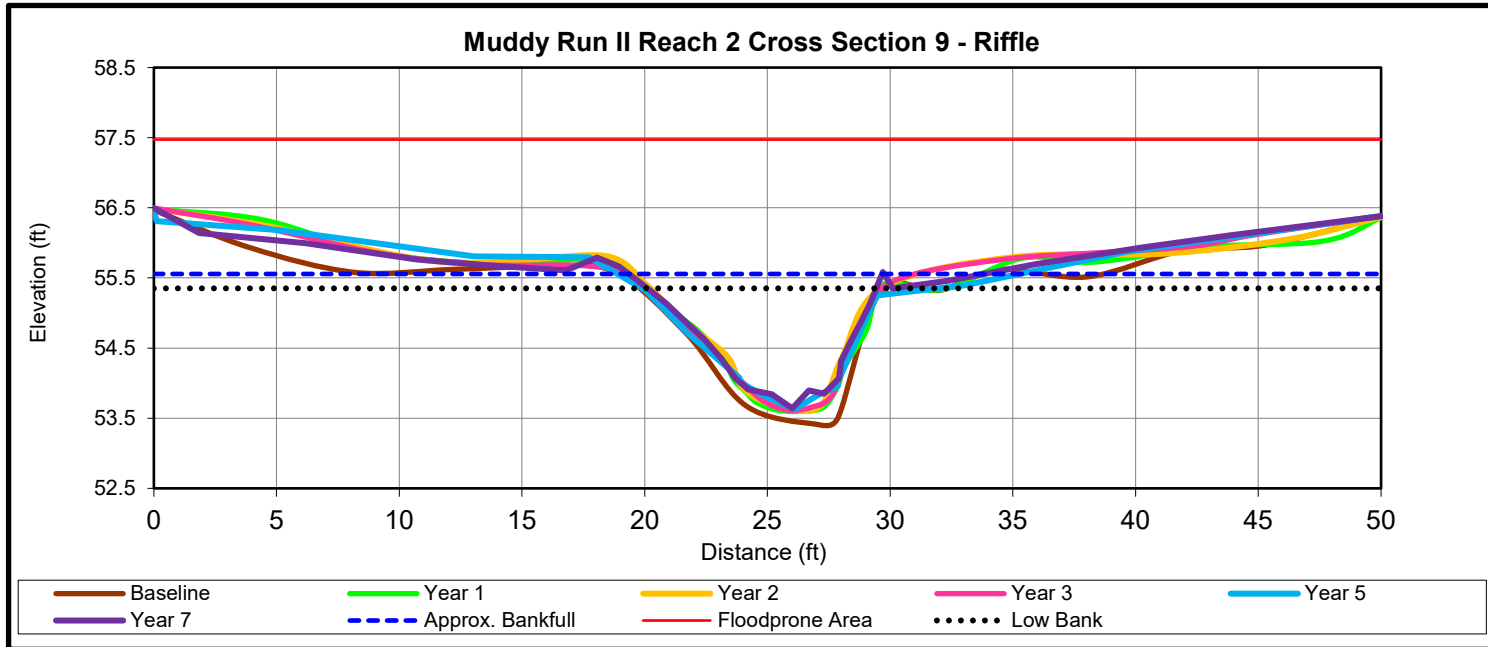


DIMENSIONS SUMMARY	Cross Section 9 (Riffle)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	55.3	55.3	55.3	55.3	55.4	55.6	
Bankfull Width (ft) ¹	9.8	9.5	9.2	9.7	14.3	10.7	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.2	1.1	1.0	1.0	0.8	-	
Bankfull Max Depth (ft) ³	1.9	1.8	1.6	1.7	1.8	1.7	
Low Bank Elevation (ft)	-	-	-	-	-	55.4	
Bankfull Cross Sectional Area (ft ²) ²	11.3	10.2	9.0	9.5	11.3	9.2	
Bankfull Width/Depth Ratio	8.5	8.8	9.5	9.9	18.1	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.5	>4.7	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.9	



Upstream



Downstream

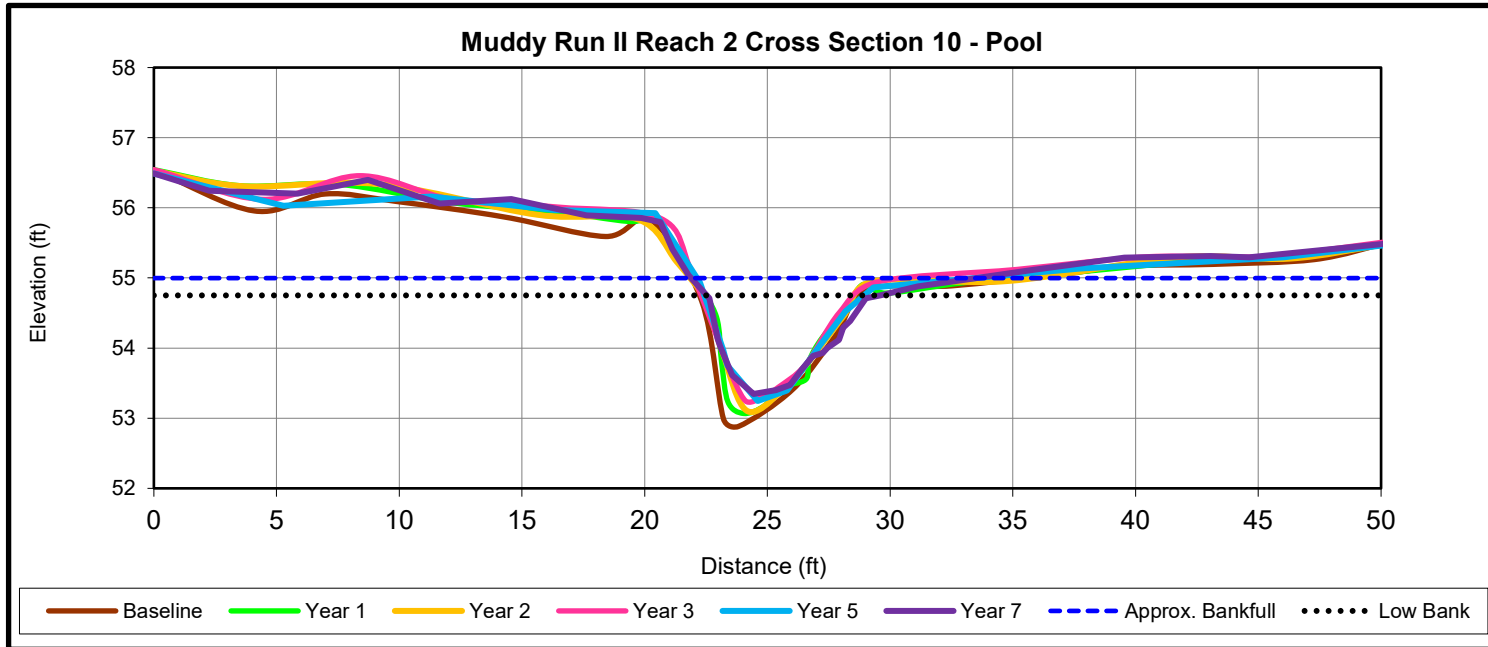


DIMENSIONS SUMMARY	Cross Section 10 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XS A ¹	54.8	54.8	54.8	54.8	55.0	55.0	
Bankfull Width (ft) ¹	7.0	6.7	6.7	6.7	12.4	10.7	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.1	1.1	0.9	0.9	0.6	-	
Bankfull Max Depth (ft) ²	1.9	1.8	1.7	1.6	1.8	1.4	
Low Bank Elevation (ft)	-	-	-	-	-	54.8	
Bankfull Cross Sectional Area (ft ²) ²	8.0	7.1	6.2	5.9	8.0	5.9	
Bankfull Width/Depth Ratio	6.1	6.3	7.3	7.7	19.2	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

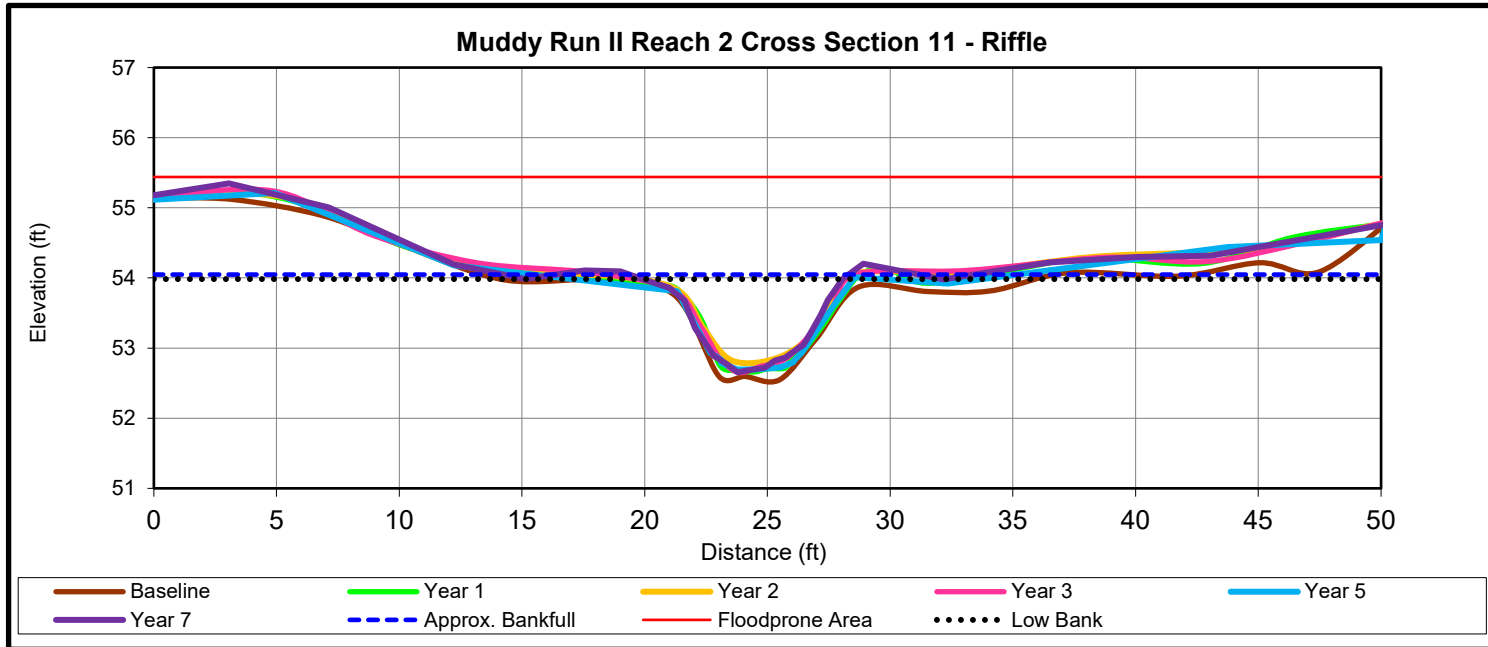


DIMENSIONS SUMMARY	Cross Section 11 (Riffle)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	53.9	53.9	53.9	53.9	54.0	54.1	
Bankfull Width (ft) ¹	9.0	7.2	7.7	8.0	11.0	9.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	0.7	0.8	0.6	0.7	0.6	-	
Bankfull MaxDepth (ft) ²	1.3	1.2	1.1	1.2	1.3	1.3	
Low Bank Elevation (ft)	-	-	-	-	-	-	
Bankfull Cross Sectional Area (ft ²) ²	6.7	5.6	5.0	5.5	6.7	6.2	
Bankfull Width/Depth Ratio	12.2	9.4	12.0	11.6	18.1	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	2.2	>2.2	>4.0	>5.6	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	1.0	



Upstream



Downstream

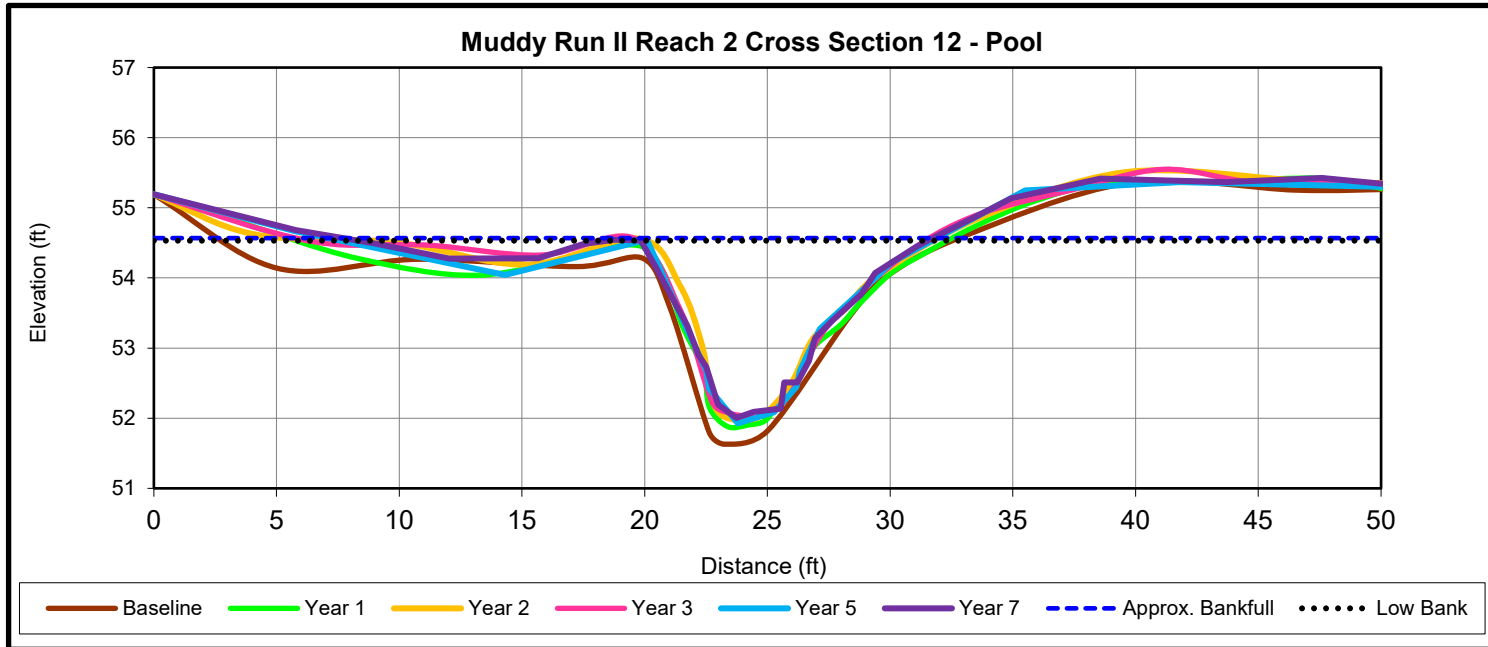


DIMENSIONS SUMMARY	Cross Section 12 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	54.3	54.3	54.3	54.3	54.6	54.6	
Bankfull Width (ft) ¹	11.3	10.2	10.4	10.4	11.8	13.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.4	1.2	1.2	1.2	1.3	-	
Bankfull Max Depth (ft) ²	2.6	2.3	2.3	2.3	2.6	2.5	
Low Bank Elevation (ft)	-	-	-	-	-	N/A	
Bankfull Cross Sectional Area (ft ²) ^{2,3}	15.5	12.7	12.0	13.0	15.5	15.1	
Bankfull Width/Depth Ratio	8.3	8.2	9.0	8.4	9.0	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

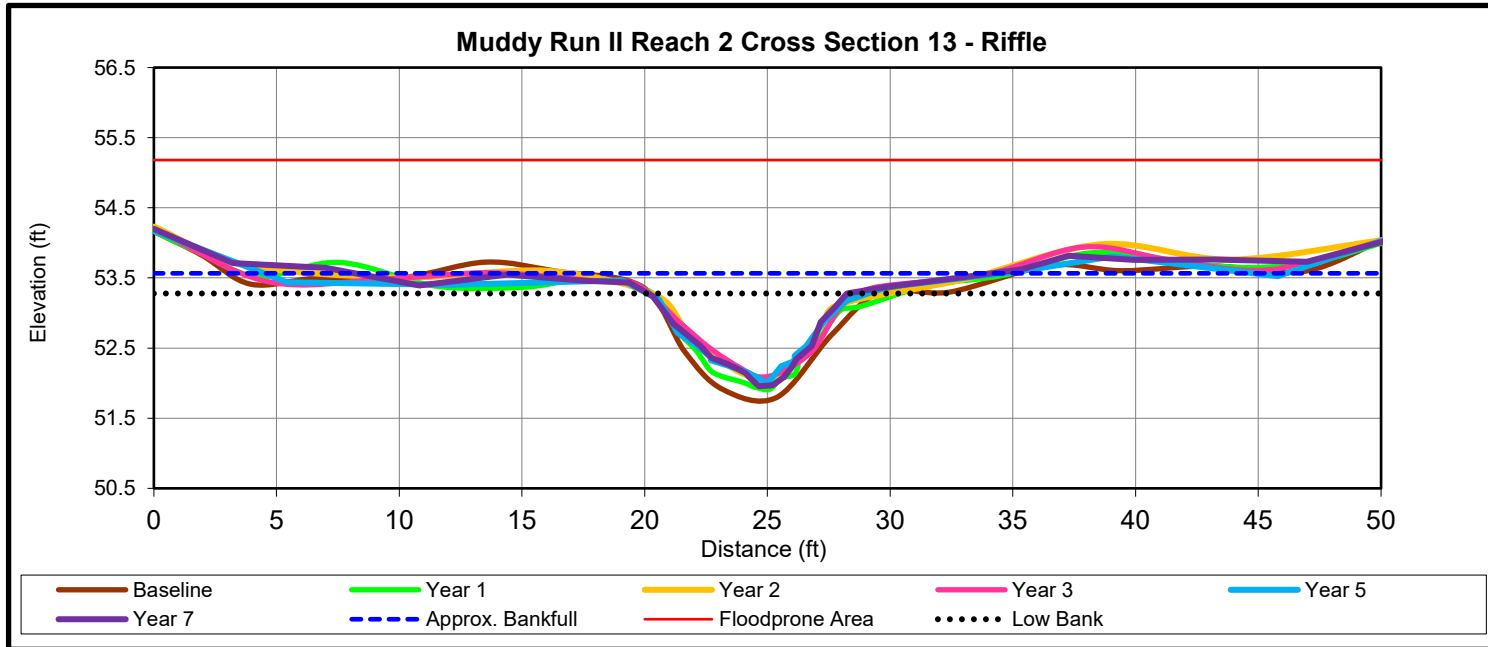


DIMENSIONS SUMMARY	Cross Section 13 (Riffle)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	53.3	53.3	53.3	53.3	53.5	53.6	
Bankfull Width (ft) ¹	12.1	10.2	10.2	9.0	27.0	8.9	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	0.7	0.8	0.6	0.7	0.3	-	
Bankfull Max Depth (ft) ²	1.5	1.5	1.3	1.2	1.5	1.3	
Low Bank Elevation (ft)	-	-	-	-	-	-	
Bankfull Cross Sectional Area (ft ²) ^{2,3}	8.7	8.2	6.1	6.1	8.7	6.1	
Bankfull Width/Depth Ratio	17.0	12.8	17.2	13.2	84.1	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>1.8	>5.7	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.8	



Upstream



Downstream

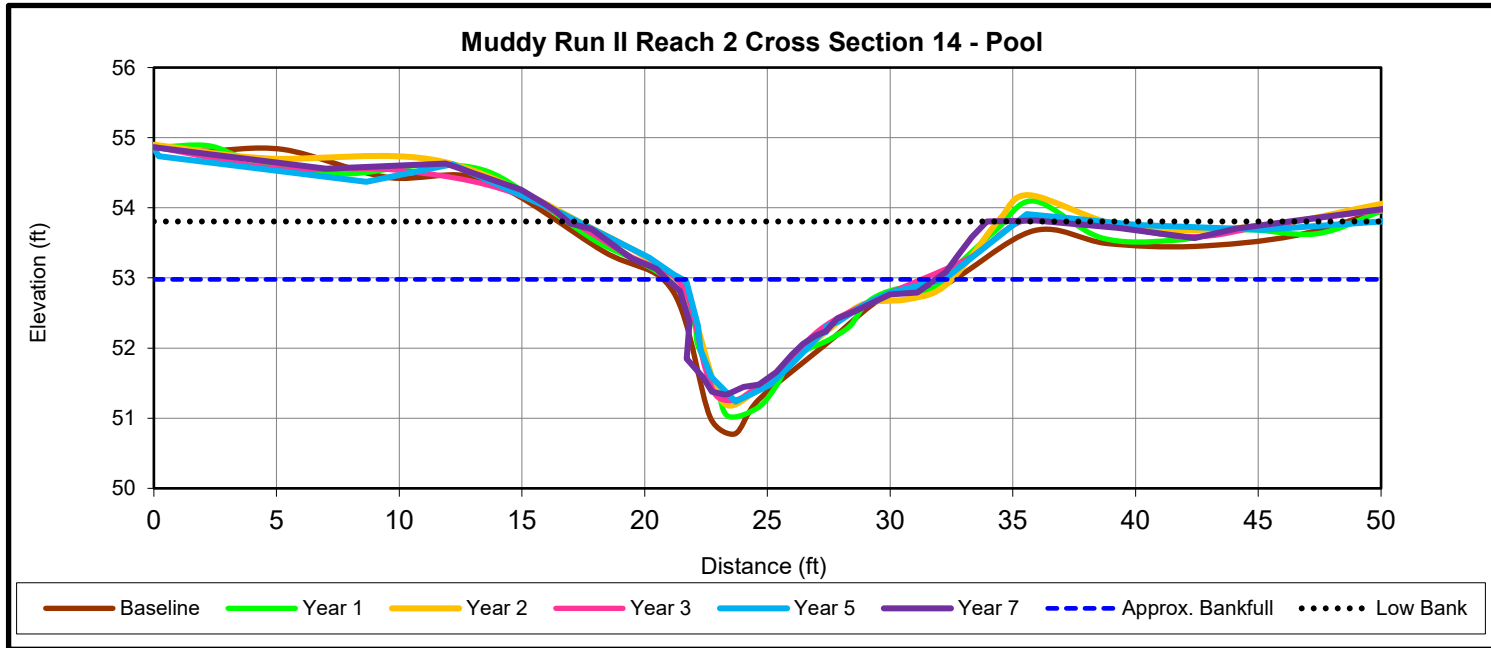


DIMENSIONS SUMMARY	Cross Section 14 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XS A ¹	52.8	52.8	52.8	52.8	53.0	53.0	
Bankfull Width (ft) ¹	9.0	7.8	10.1	8.5	11.0	10.9	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.0	0.9	0.7	0.8	0.8	-	
Bankfull Max Depth (ft) ²	2.0	1.8	1.5	1.5	1.8	2.5	
Low Bank Elevation (ft)	-	-	-	-	-	N/A	
Bankfull Cross Sectional Area (ft ²) ^{2,3}	8.9	7.8	6.8	6.8	8.9	20.4	
Bankfull Width/Depth Ratio	9.2	9.9	15.0	10.6	13.6	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

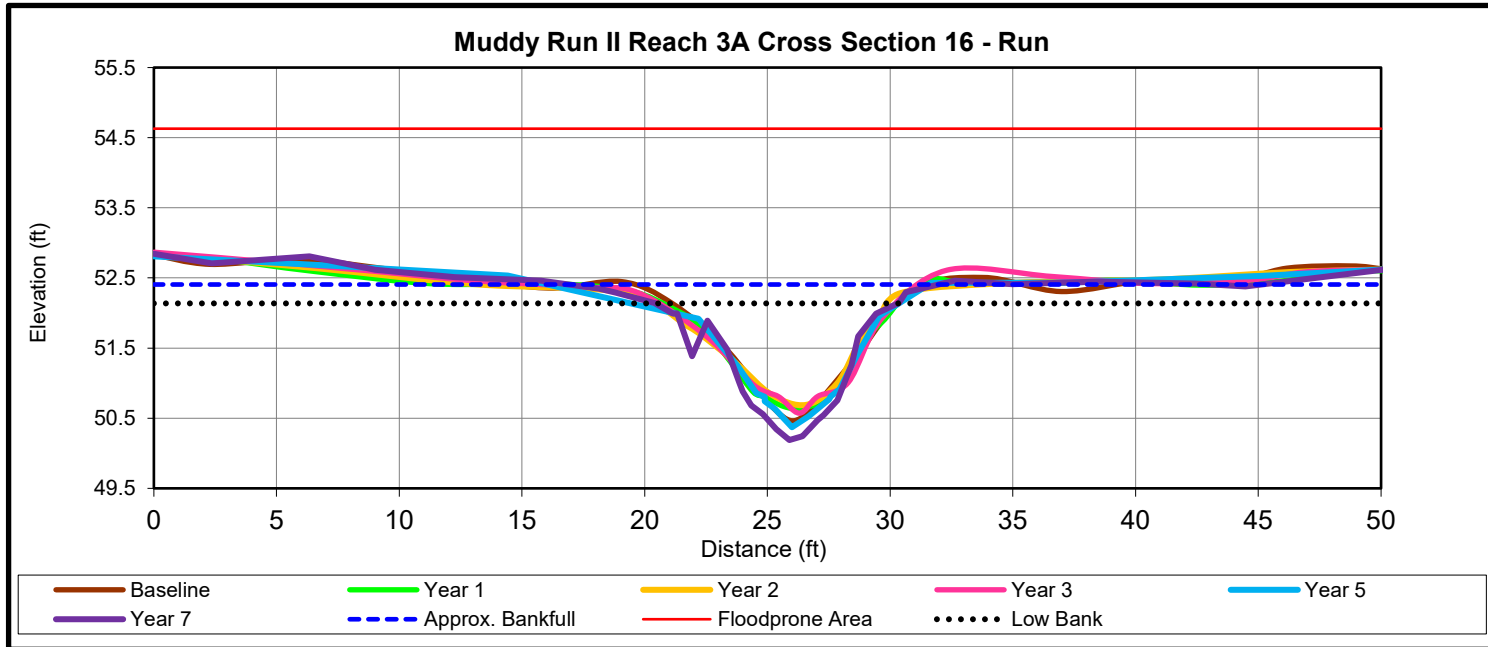


DIMENSIONS SUMMARY	Cross Section 16 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XS A ¹	52.3	52.3	52.3	52.3	52.3	52.4	
Bankfull Width (ft) ¹	11.3	11.6	12.2	11.6	13.0	7.1	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	0.9	0.9	0.8	0.9	0.8	-	
Bankfull Max Depth (ft) ²	1.9	1.7	1.6	1.7	1.9	2.0	
Low Bank Elevation (ft)	-	-	-	-	-	52.1	
Bankfull Cross Sectional Area (ft ²) ²	9.8	9.9	9.4	9.9	9.8	7.9	
Bankfull Width/Depth Ratio	13.0	13.6	15.8	13.6	17.3	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.9	>7.1	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.8	0.9	



Upstream



Downstream

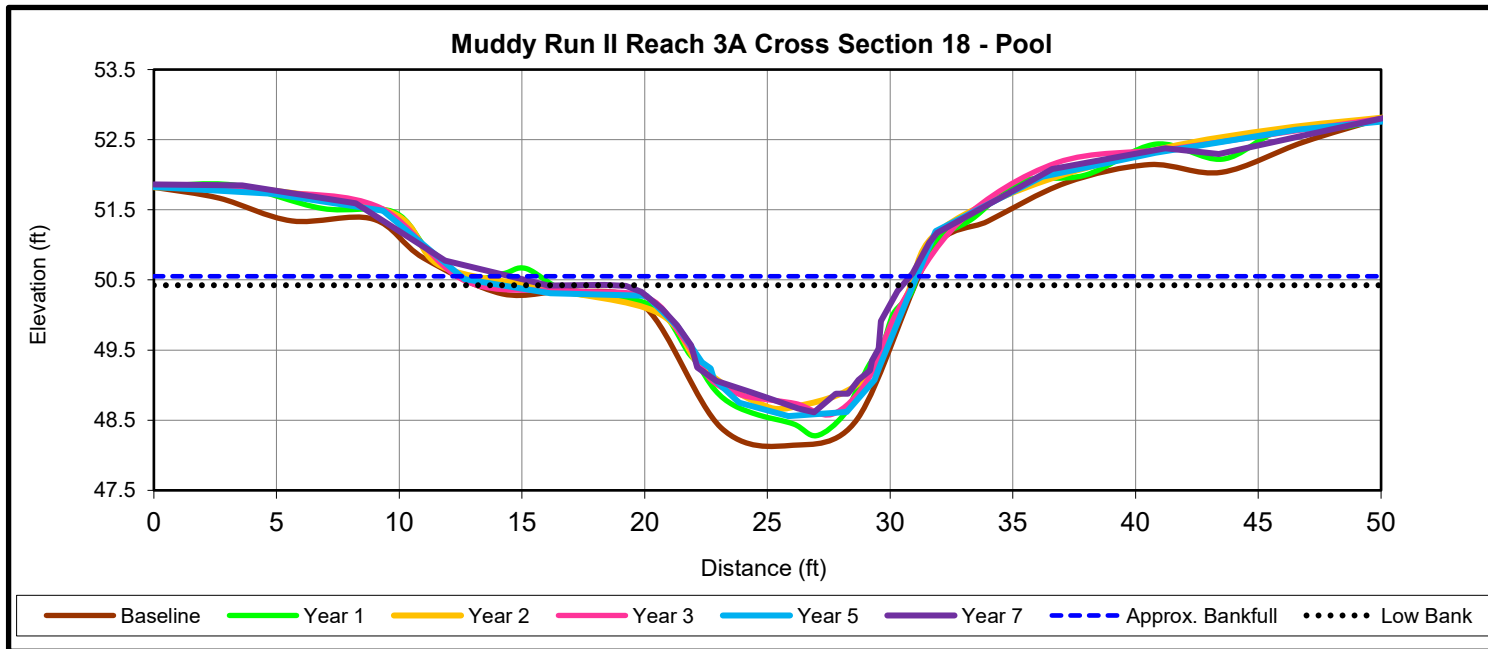


DIMENSIONS SUMMARY	Cross Section 18 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XS A1	50.1	50.1	50.1	50.1	50.4	50.6	
Bankfull Width (ft)1	10.6	9.9	10.7	9.9	16.1	12.5	
Floodprone Width (ft)1	50.0	50.0	50.0	50.0	40.0	50.0	
Bankfull Mean Depth (ft)	1.3	1.1	0.9	1.0	0.9	-	
Bankfull Max Depth (ft)2	2.0	1.8	1.4	1.5	1.8	1.8	
Low Bank Elevation (ft)	-	-	-	-	-	N/A	
Bankfull Cross Sectional Area (ft ²)2	14.2	11.3	9.6	10.0	14.2	12.6	
Bankfull Width/Depth Ratio	7.9	8.7	12.1	9.8	18.3	-	
Bankfull Entrenchment Ratio1	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio1	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

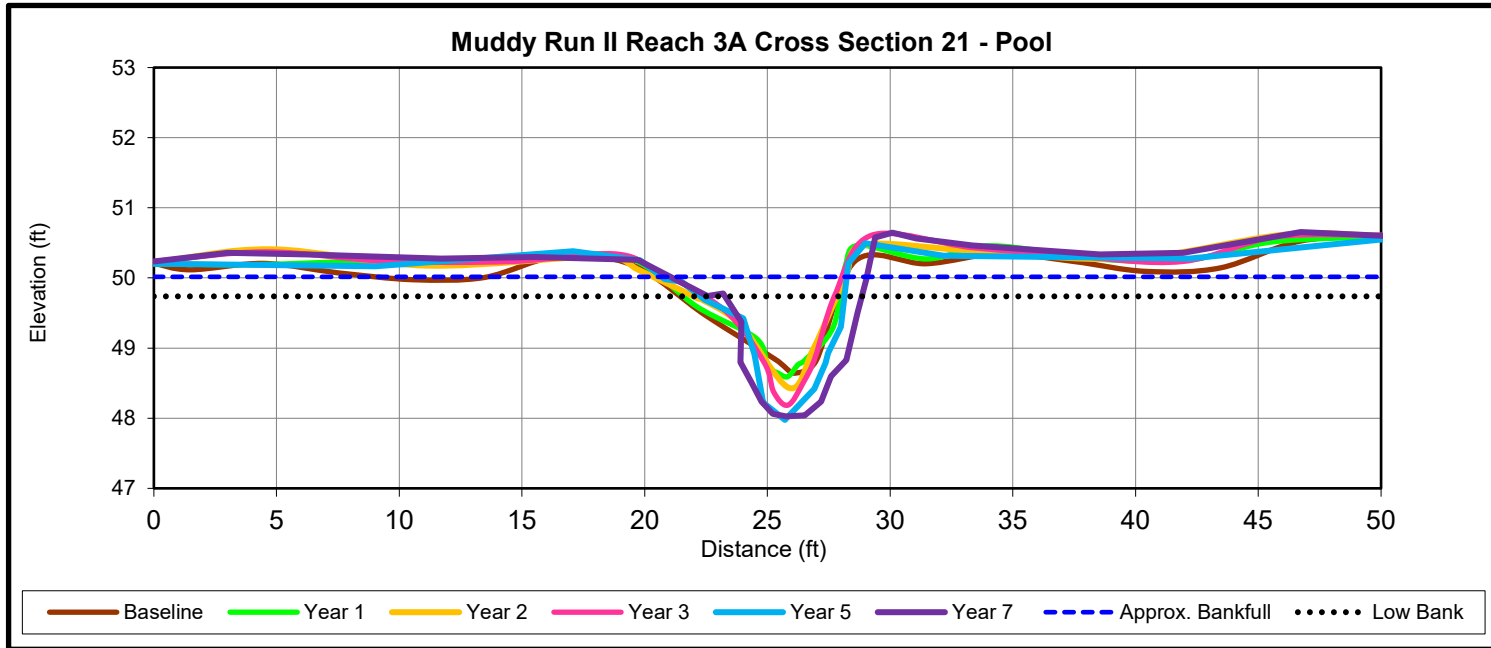


DIMENSIONS SUMMARY	Cross Section 21 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	50.3	50.3	50.3	50.3	50.2	50.0	
Bankfull Width (ft) ¹	11.7	9.1	10.0	9.6	8.3	8.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	0.7	0.9	0.8	0.8	1.0	-	
Bankfull Max Depth (ft) ²	1.7	1.7	1.9	2.1	2.2	1.7	
Low Bank Elevation (ft)	-	-	-	-	-	49.7	
Bankfull Cross Sectional Area (ft ²)	8.6	8.1	7.9	8.1	8.6	6.6	
Bankfull Width/Depth Ratio	16.0	10.2	12.8	11.4	8.1	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

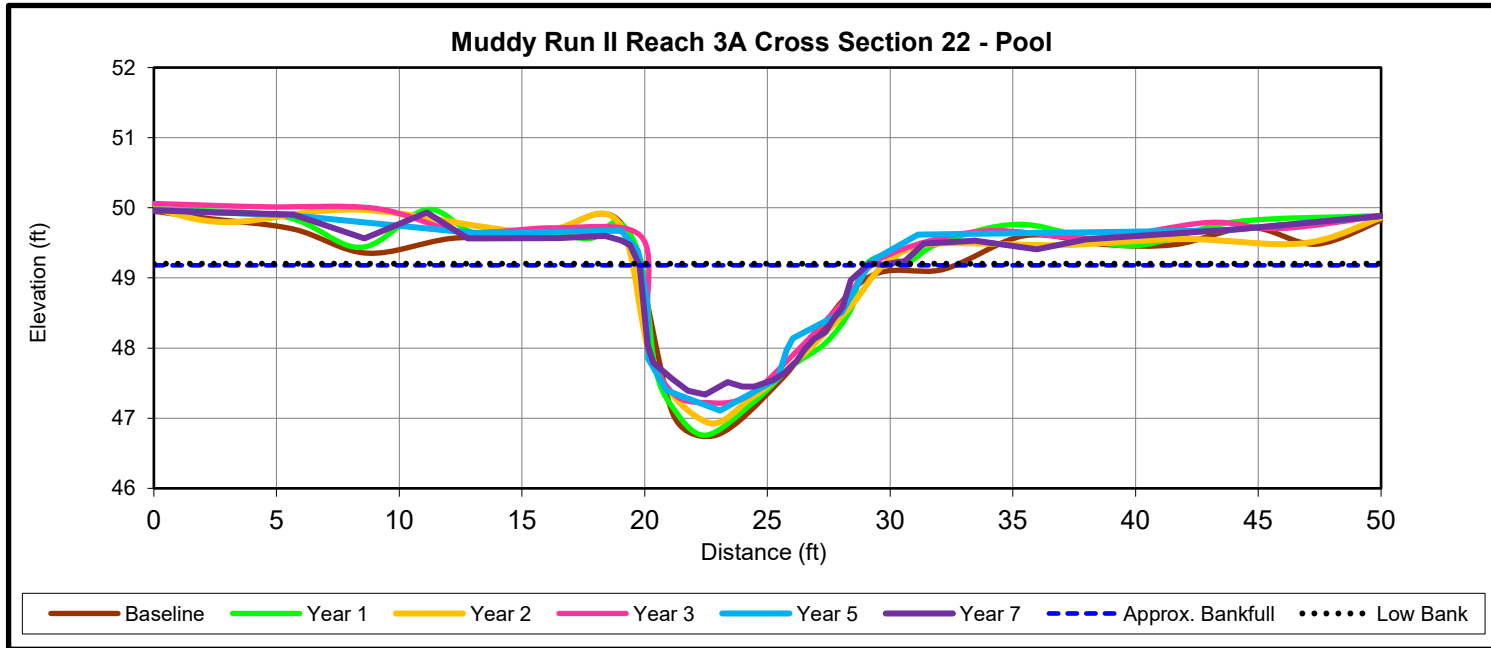


DIMENSIONS SUMMARY	Cross Section 22 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	49.0	49.0	49.0	49.0	49.1	49.2	
Bankfull Width (ft) ¹	9.3	9.3	9.9	9.0	9.2	9.3	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.3	1.6	1.2	1.2	1.3	-	
Bankfull Max Depth (ft) ²	2.2	2.4	2.1	1.8	2.0	1.9	
Low Bank Elevation (ft)	-	-	-	-	-	49.2	
Bankfull Cross Sectional Area (ft ²) ³	12.3	14.5	12.1	10.9	12.3	12.5	
Bankfull Width/Depth Ratio	7.0	6.0	8.0	7.4	6.9	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

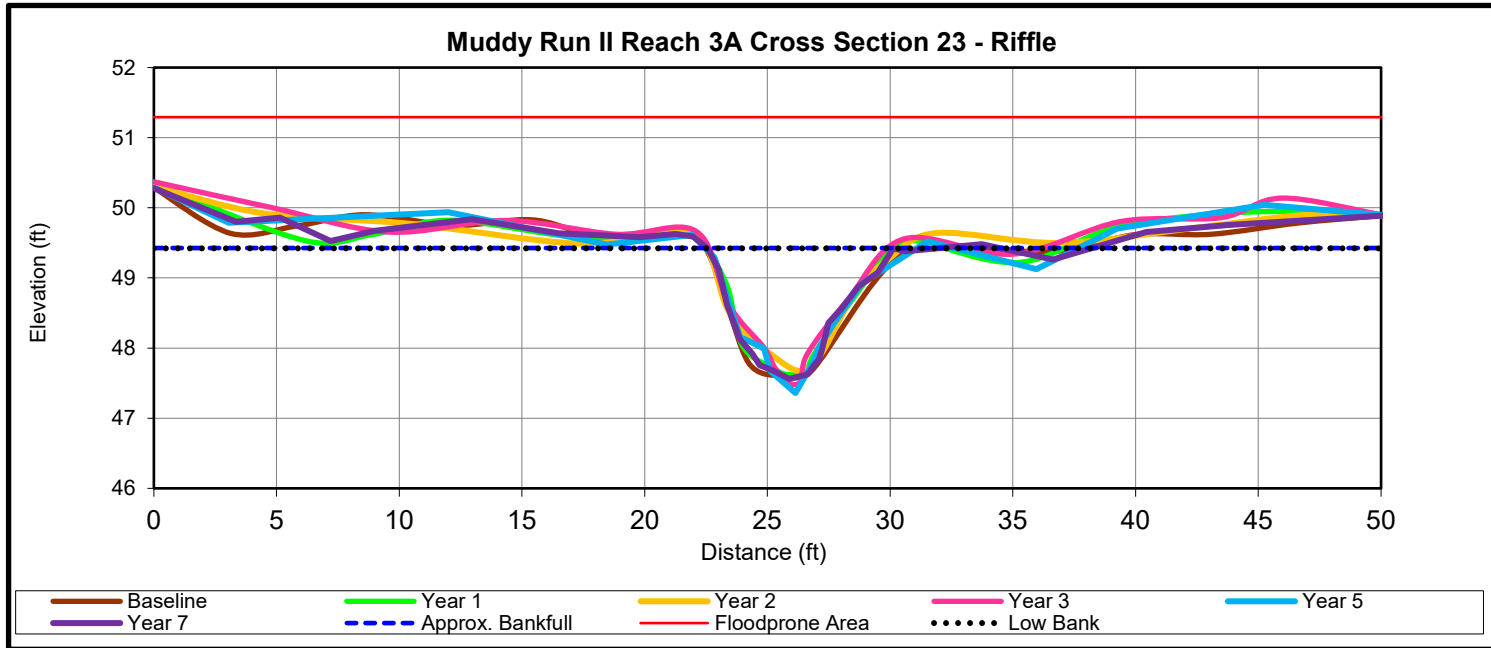


DIMENSIONS SUMMARY	Cross Section 23 (Riffle)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	49.3	49.3	49.3	49.3	49.4	49.4	
Bankfull Width (ft) ¹	7.8	7.7	7.7	7.3	8.6	7.6	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.1	1.0	0.9	0.9	1.0	-	
Bankfull Max Depth (ft) ²	1.7	1.8	1.6	1.8	2.1	1.9	
Low Bank Elevation (ft)	-	-	-	-	-	49.4	
Bankfull Cross Sectional Area (ft ²) ³	8.3	7.9	6.9	6.7	8.3	8.2	
Bankfull Width/Depth Ratio	7.4	7.5	8.6	8.0	8.9	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>5.8	>6.6	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.1	1.0	



Upstream



Downstream

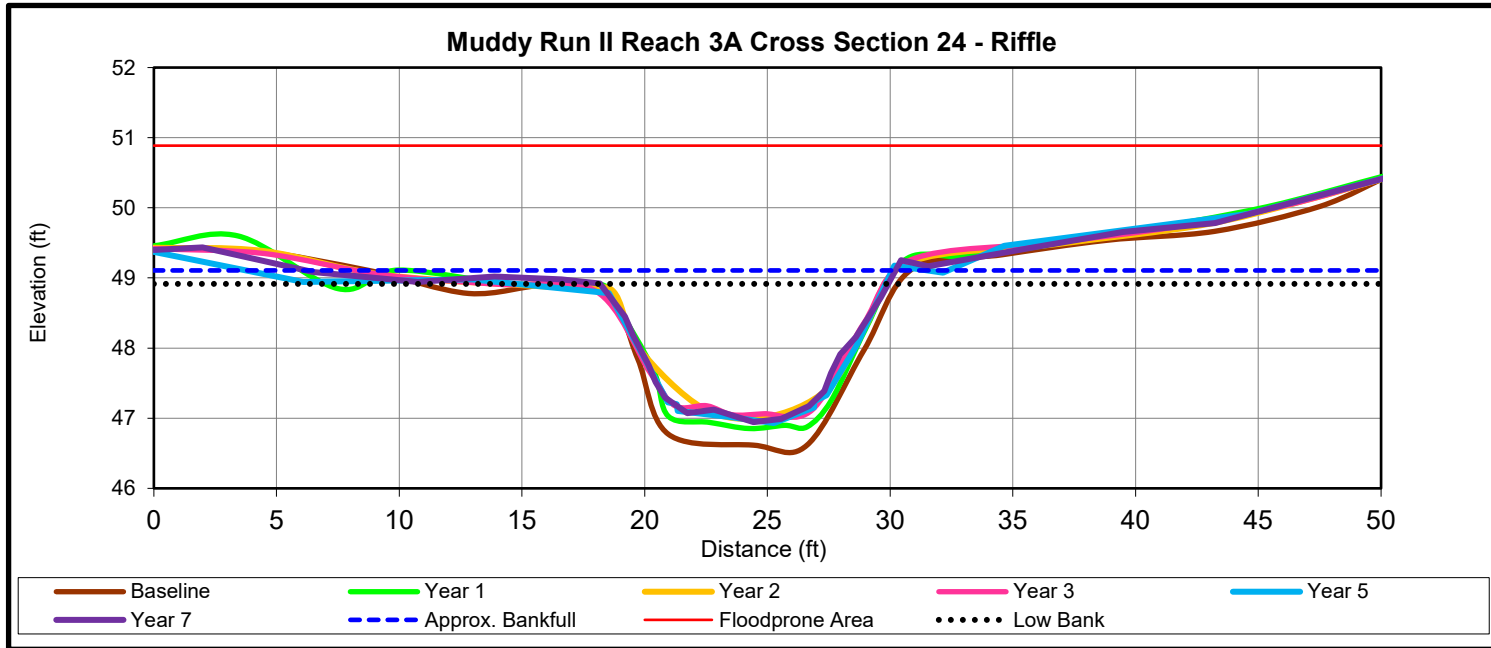


DIMENSIONS SUMMARY	Cross Section 24 (Riffle)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	48.8	48.8	48.8	48.8	49.0	49.1	
Bankfull Width (ft) ¹	11.7	11.8	11.3	11.9	24.6	12.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.5	1.4	1.2	1.2	0.7	-	
Bankfull Max Depth (ft) ²	2.1	2.0	1.8	1.7	2.1	2.0	
Low Bank Elevation (ft)	-	-	-	-	-	48.9	
Bankfull Cross Sectional Area (ft ²) ³	18.0	17.1	13.7	14.6	18.0	15.8	
Bankfull Width/Depth Ratio	7.6	8.2	9.3	9.7	33.6	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>2.0	>4.2	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.9	



Upstream



Downstream

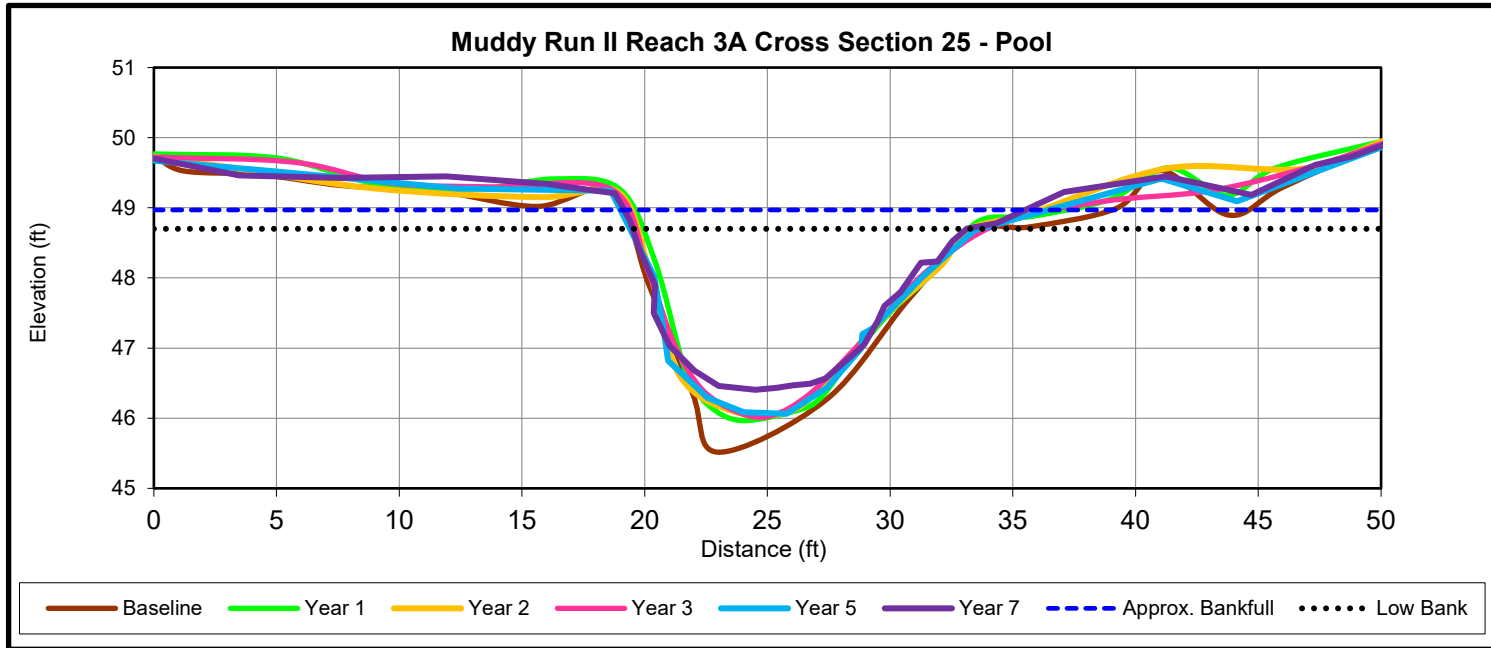


DIMENSIONS SUMMARY	Cross Section 25 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	48.7	48.7	48.7	48.7	48.8	49.0	
Bankfull Width (ft) ¹	14.1	13.9	13.8	14.7	15.7	16.3	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.8	1.7	1.7	1.5	1.6	-	
Bankfull Max Depth (ft) ²	3.1	2.8	2.6	2.7	2.8	2.3	
Low Bank Elevation (ft)	-	-	-	-	-	48.7	
Bankfull Cross Sectional Area (ft ²) ³	25.0	24.3	22.9	22.6	25.0	21.0	
Bankfull Width/Depth Ratio	7.9	8.0	8.3	9.6	9.8	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

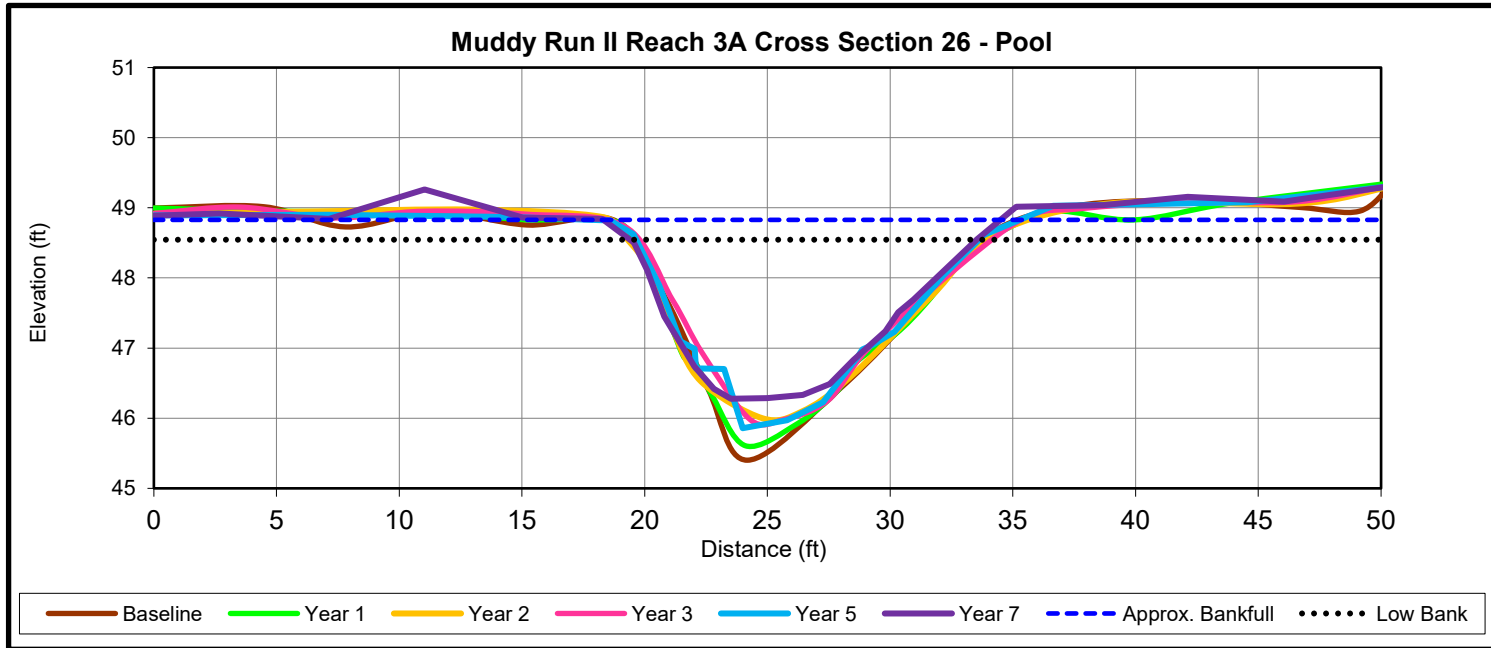


DIMENSIONS SUMMARY	Cross Section 26 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	48.6	48.6	48.6	48.6	48.8	48.8	
Bankfull Width (ft) ¹	14.9	15.7	15.0	15.1	16.0	16.2	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.7	1.6	1.5	1.5	1.5	-	
Bankfull Max Depth (ft) ²	3.2	3.1	2.6	2.6	2.9	2.3	
Low Bank Elevation (ft)	-	-	-	-	-	48.5	
Bankfull Cross Sectional Area (ft ²) ³	24.9	25.7	23.2	21.9	24.9	20.6	
Bankfull Width/Depth Ratio	8.9	9.6	9.7	10.3	10.4	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

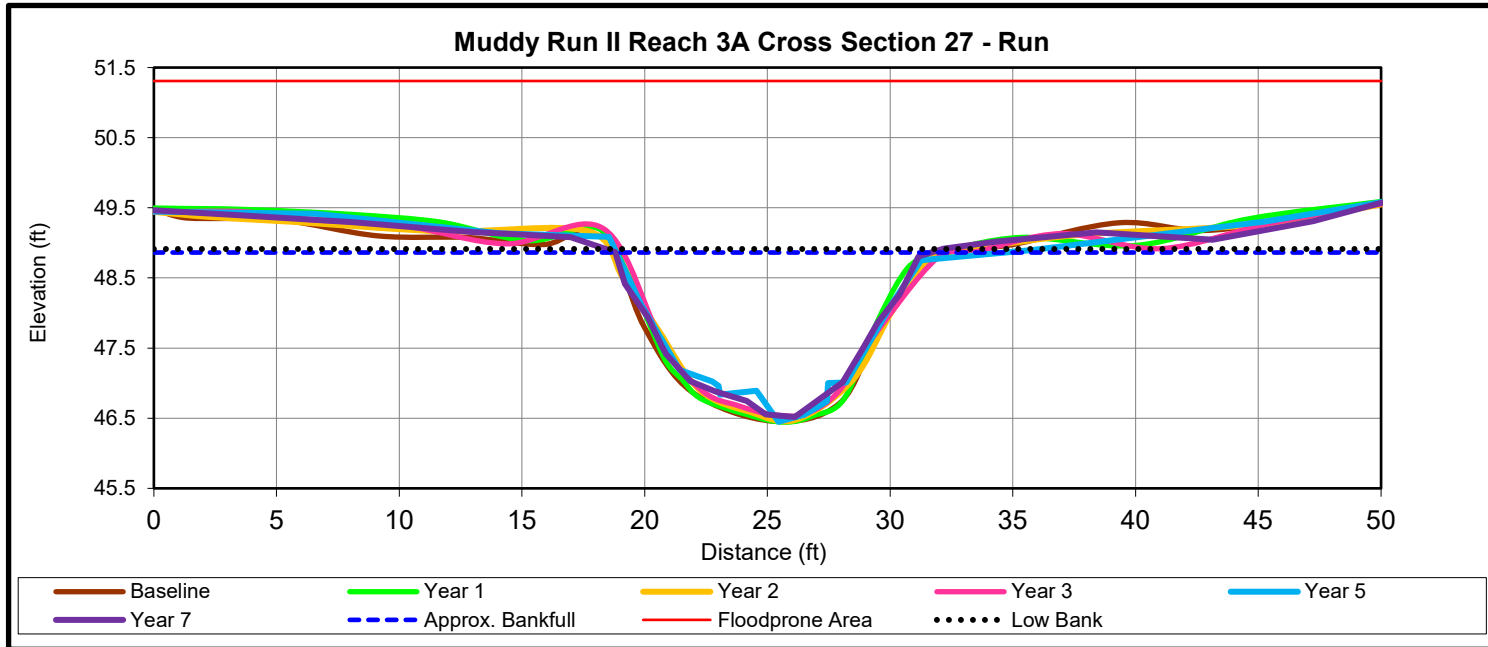


DIMENSIONS SUMMARY	Cross Section 27 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	48.8	48.8	48.8	48.8	48.9	48.9	
Bankfull Width (ft) ¹	12.7	12.4	13.7	13.3	16.3	12.9	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.5	1.5	1.4	1.4	1.2	-	
Bankfull Max Depth (ft) ²	2.3	2.3	2.3	2.2	2.4	2.4	
Low Bank Elevation (ft)	-	-	-	-	-	48.9	
Bankfull Cross Sectional Area (ft ²) ³	19.4	18.9	19.3	19.1	19.4	20.1	
Bankfull Width/Depth Ratio	8.3	8.1	9.7	9.2	13.6	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.1	>3.9	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	1.0	



Upstream



Downstream

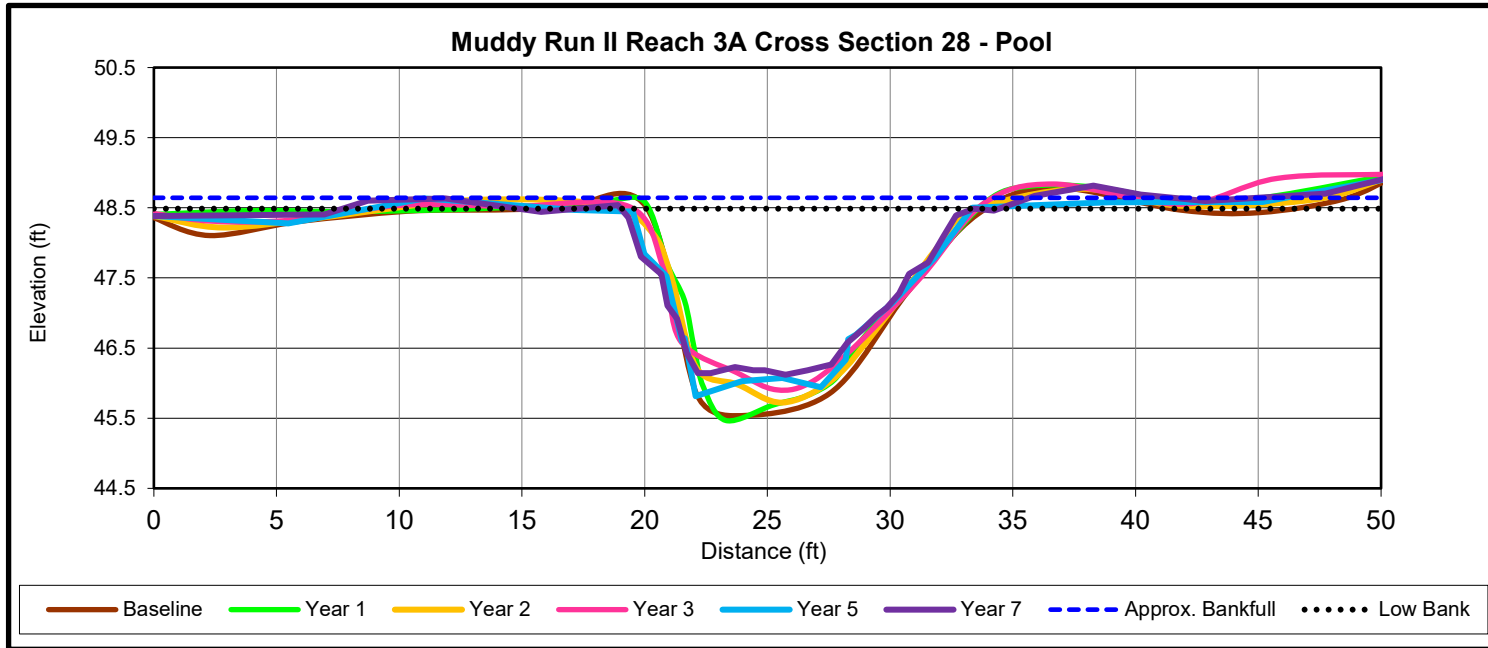


DIMENSIONS SUMMARY	Cross Section 28 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	48.4	48.4	48.4	48.4	48.5	48.6	
Bankfull Width (ft) ¹	13.4	13.3	14.0	13.9	21.6	14.5	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.8	1.7	1.6	1.6	1.1	-	
Bankfull Max Depth (ft) ²	2.9	2.9	2.7	2.5	2.7	2.4	
Low Bank Elevation (ft)	-	-	-	-	-	48.5	
Bankfull Cross Sectional Area (ft ²) ³	24.6	23.2	22.2	21.8	24.6	22.3	
Bankfull Width/Depth Ratio	7.3	7.6	8.8	8.9	19.1	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

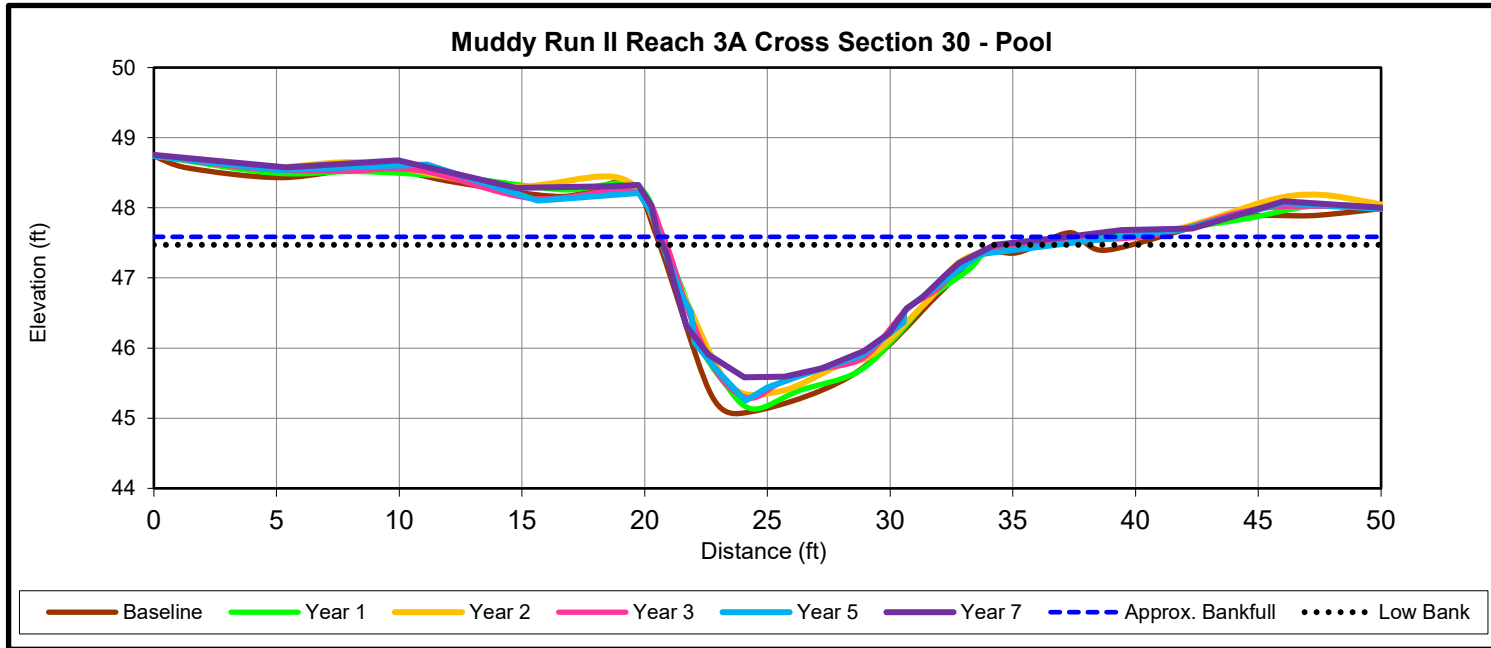


DIMENSIONS SUMMARY	Cross Section 30 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	47.4	47.4	47.4	47.4	47.5	47.6	
Bankfull Width (ft) ¹	12.9	13.1	14.0	13.2	17.3	16.8	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.4	1.3	1.2	1.2	1.1	-	
Bankfull Max Depth (ft) ²	2.3	2.2	2.0	2.1	2.3	1.9	
Low Bank Elevation (ft)	-	-	-	-	-	47.5	
Bankfull Cross Sectional Area (ft ²) ³	18.4	17.4	16.6	16.3	18.4	16.6	
Bankfull Width/Depth Ratio	9.1	9.8	11.9	10.7	16.3	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

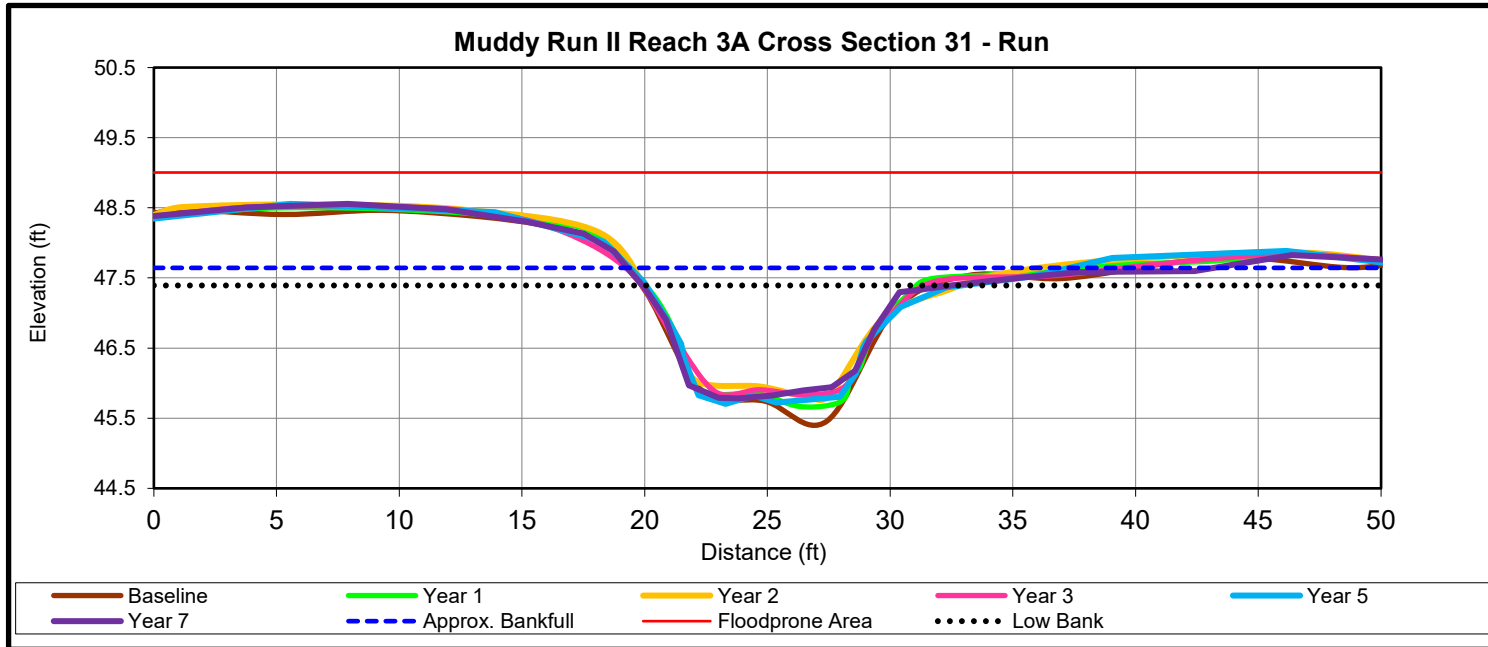


DIMENSIONS SUMMARY	Cross Section 31 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	47.5	47.5	47.5	47.5	47.6	47.6	
Bankfull Width (ft) ¹	13.7	14.2	14.3	14.7	16.6	13.3	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.2	1.0	1.0	0.9	0.9	-	
Bankfull Max Depth (ft) ²	2.1	1.9	1.7	1.7	1.9	1.6	
Low Bank Elevation (ft)	-	-	-	-	-	47.4	
Bankfull Cross Sectional Area (ft ²) ²	15.8	14.6	13.8	13.7	15.8	12.6	
Bankfull Width/Depth Ratio	11.9	13.8	14.8	15.9	17.5	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3	>3.8	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.9	



Upstream



Downstream

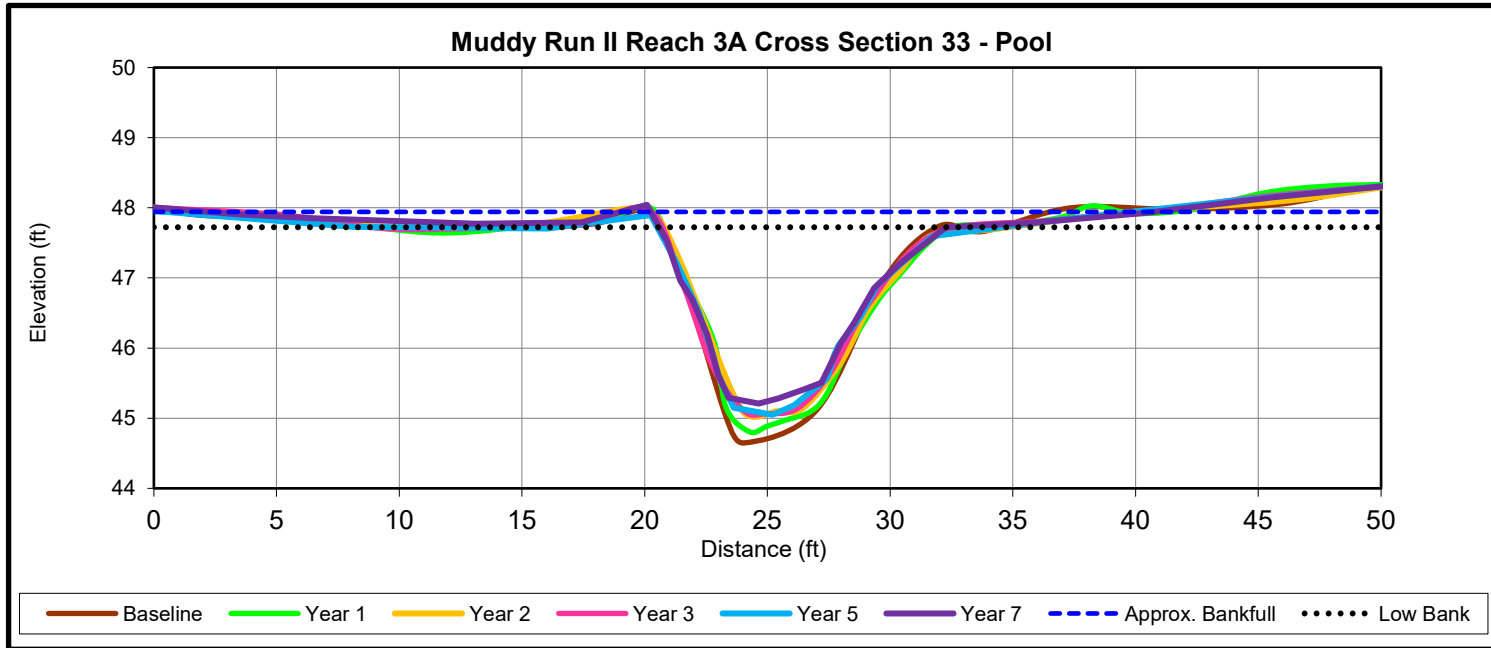


DIMENSIONS SUMMARY	Cross Section 33 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	47.7	47.7	47.7	47.7	47.9	47.9	
Bankfull Width (ft) ¹	11.5	12.0	13.5	13.0	17.2	12.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.7	1.6	1.3	1.4	1.1	-	
Bankfull Max Depth (ft) ³	3.1	2.9	2.6	2.6	2.8	2.5	
Low Bank Elevation (ft)	-	-	-	-	-	N/A	
Bankfull Cross Sectional Area (ft ²) ²	19.5	19.0	17.3	17.8	19.5	16.9	
Bankfull Width/Depth Ratio	6.8	7.6	10.5	9.5	15.1	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

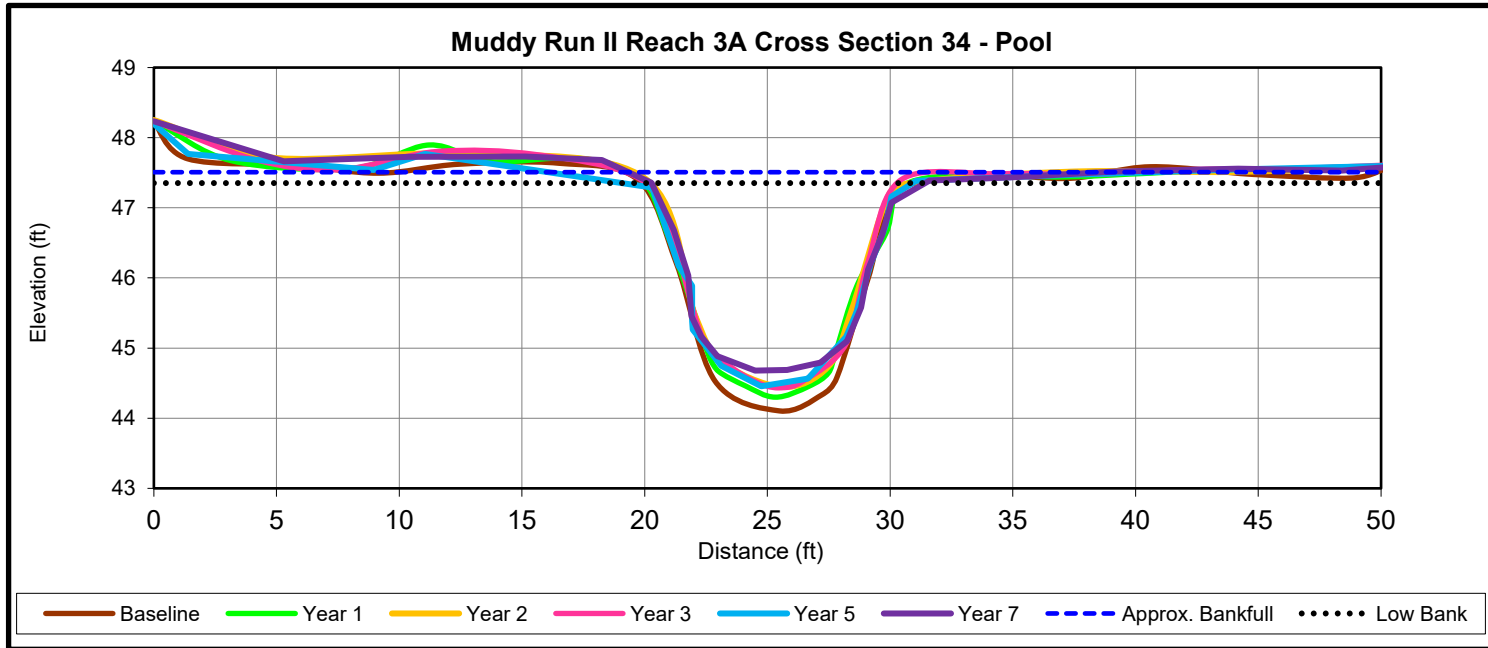


DIMENSIONS SUMMARY	Cross Section 34 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	47.2	47.2	47.2	47.2	47.4	47.5	
Bankfull Width (ft) ¹	10.4	10.5	9.9	10.1	16.2	12.3	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	2.1	1.9	1.8	1.8	1.3	-	
Bankfull Max Depth (ft) ³	3.1	3.0	2.8	2.8	3.0	2.7	
Low Bank Elevation (ft)	-	-	-	-	-	47.4	
Bankfull Cross Sectional Area (ft ²) ²	21.4	20.5	18.2	18.6	21.4	19.6	
Bankfull Width/Depth Ratio	5.0	5.4	5.4	5.5	12.3	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

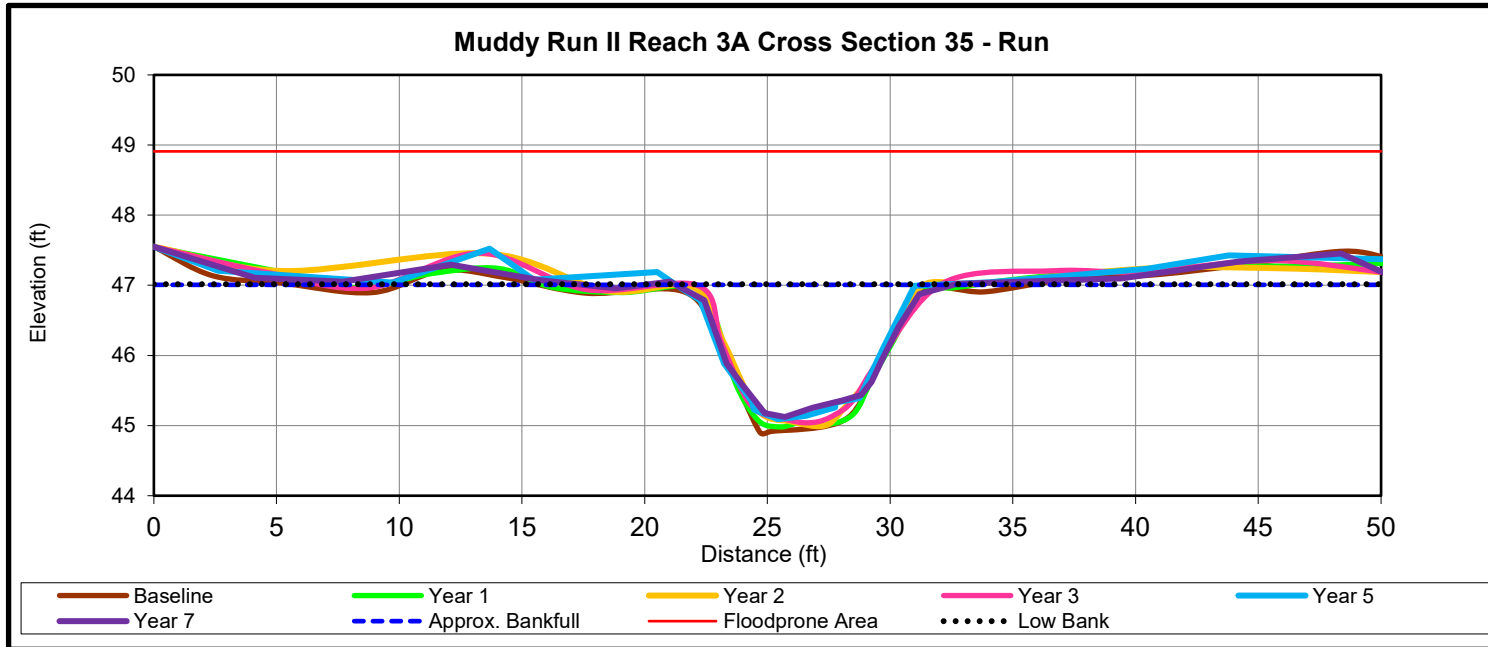


DIMENSIONS SUMMARY	Cross Section 35 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	46.9	46.9	46.9	46.9	47.0	47.0	
Bankfull Width (ft) ¹	9.5	8.8	9.0	9.6	10.9	11.4	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.3	1.3	1.2	1.2	1.1	-	
Bankfull Max Depth (ft) ³	2.0	1.9	1.9	1.9	1.9	1.9	
Low Bank Elevation (ft)	-	-	-	-	-	47.0	
Bankfull Cross Sectional Area (ft ²) ²	12.1	11.7	11.1	11.4	12.1	12.2	
Bankfull Width/Depth Ratio	7.4	6.7	7.4	8.0	9.8	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>4.6	>4.4	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.1	1.0	



Upstream



Downstream

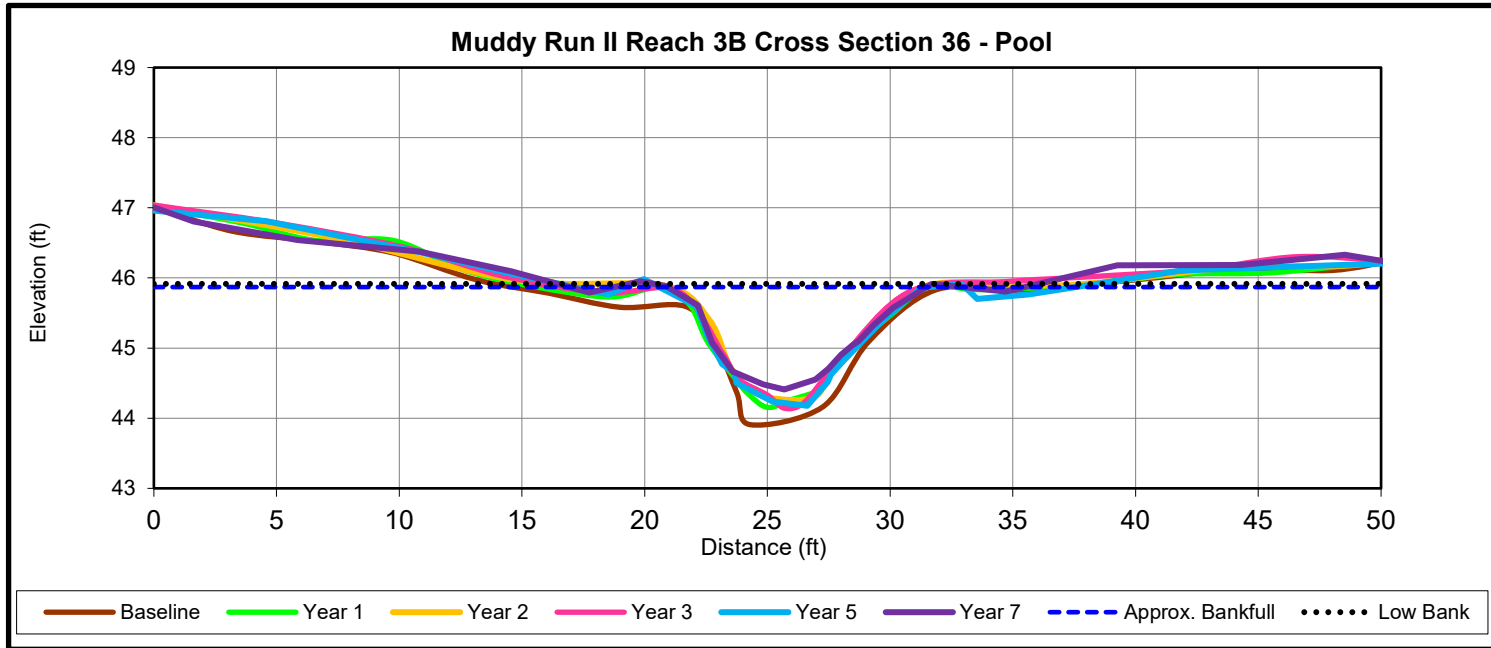


DIMENSIONS SUMMARY	Cross Section 36 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	45.6	45.6	45.6	45.6	45.8	45.9	
Bankfull Width (ft) ¹	9.3	9.0	8.6	8.4	9.7	10.5	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	0.9	0.9	0.8	0.8	0.9	-	
Bankfull Max Depth (ft) ³	1.7	1.5	1.3	1.5	1.6	1.5	
Low Bank Elevation (ft)	-	-	-	-	-	45.9	
Bankfull Cross Sectional Area (ft ²) ²	8.7	8.1	6.7	6.9	8.7	9.2	
Bankfull Width/Depth Ratio	9.9	10.1	11.0	10.3	10.9	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

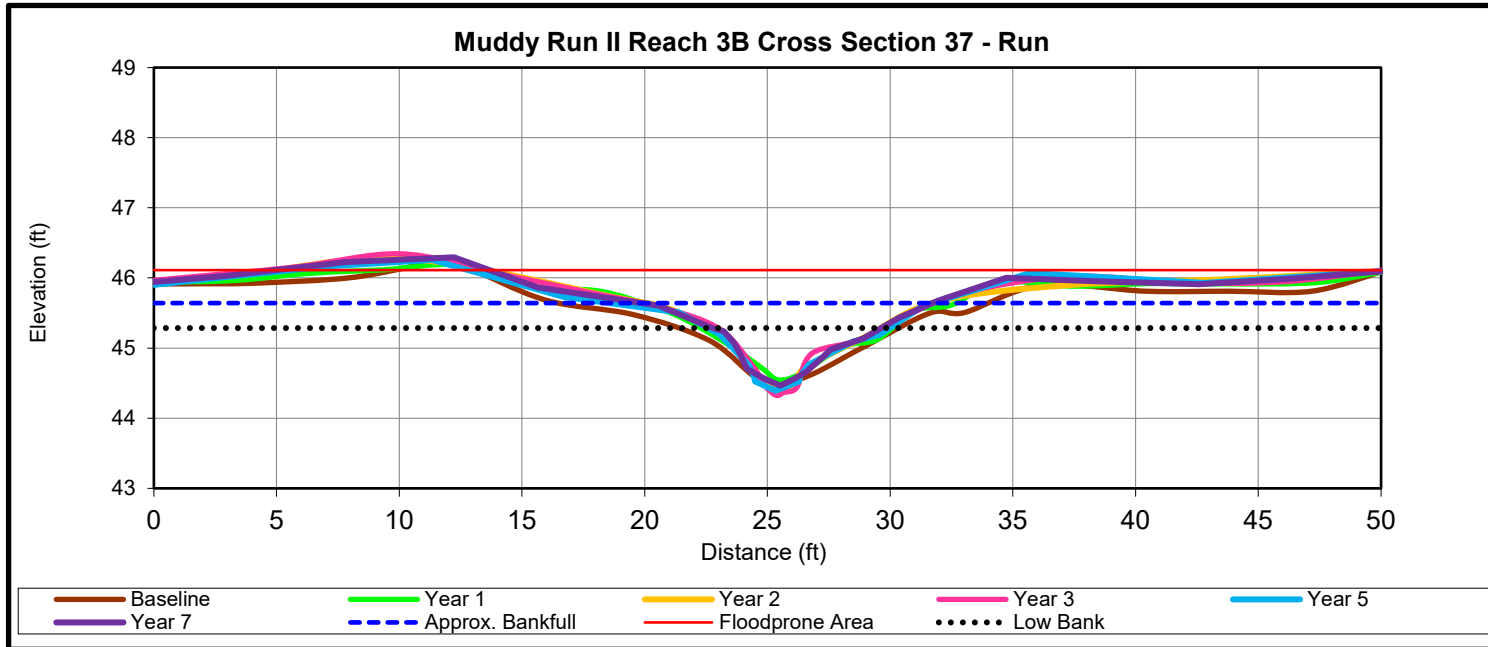


DIMENSIONS SUMMARY	Cross Section 37 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	45.5	45.5	45.5	45.5	45.6	45.6	
Bankfull Width (ft) ¹	12.4	11.9	9.7	9.7	12.1	12.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	0.5	0.5	0.5	0.5	0.5	-	
Bankfull Max Depth (ft) ³	1.0	1.1	1.1	1.2	1.2	1.2	
Low Bank Elevation (ft)	-	-	-	-	-	45.3	
Bankfull Cross Sectional Area (ft ²) ²	6.1	5.8	4.8	4.6	6.1	2.8	
Bankfull Width/Depth Ratio	25.4	24.4	19.4	20.5	24.3	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>4.1	>4.2	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.7	



Upstream



Downstream

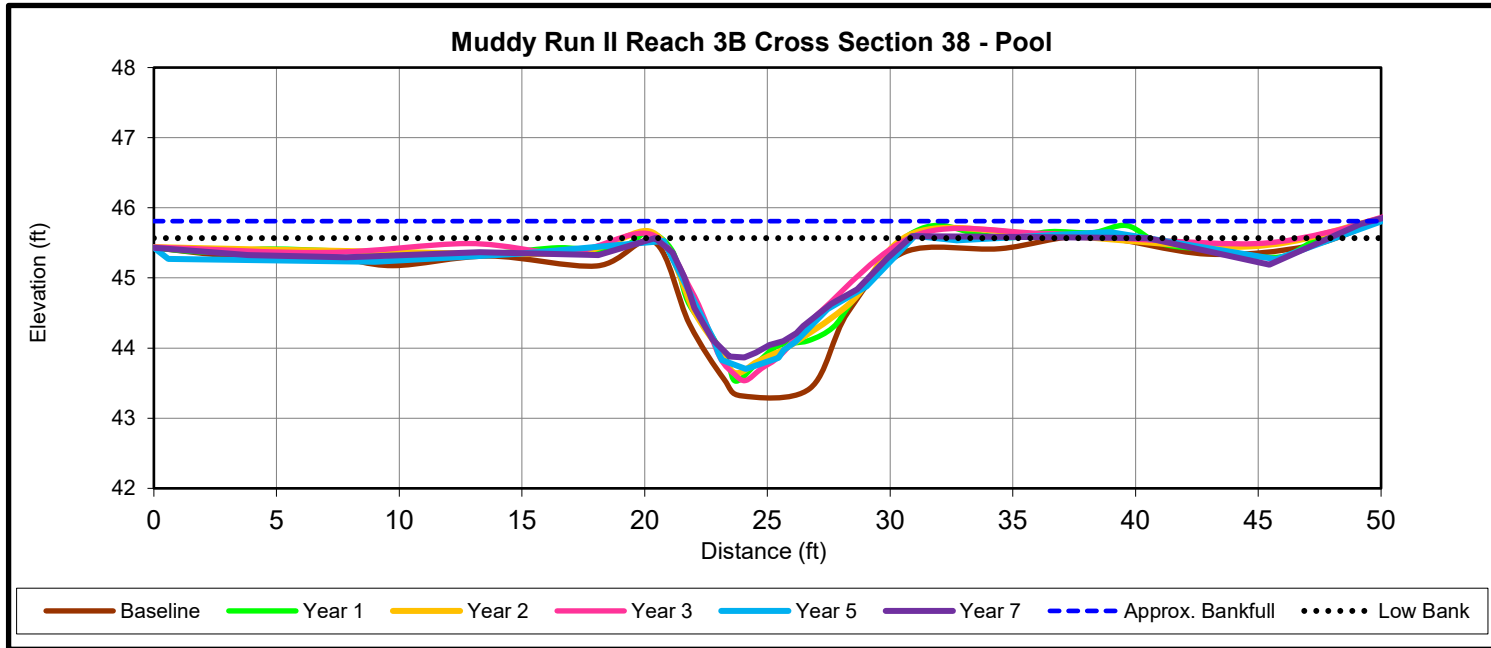


DIMENSIONS SUMMARY	Cross Section 38 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	45.4	45.4	45.4	45.4	45.5	45.8	
Bankfull Width (ft) ¹	10.0	8.8	9.6	10.2	10.0	10.5	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.3	1.1	1.0	0.9	1.0	-	
Bankfull Max Depth (ft) ³	2.0	1.8	1.8	1.9	1.8	1.7	
Low Bank Elevation (ft)	-	-	-	-	-	45.6	
Bankfull Cross Sectional Area (ft ²) ²	12.6	9.2	9.6	9.1	10.5	10.1	
Bankfull Width/Depth Ratio	7.9	8.4	9.7	11.4	9.6	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

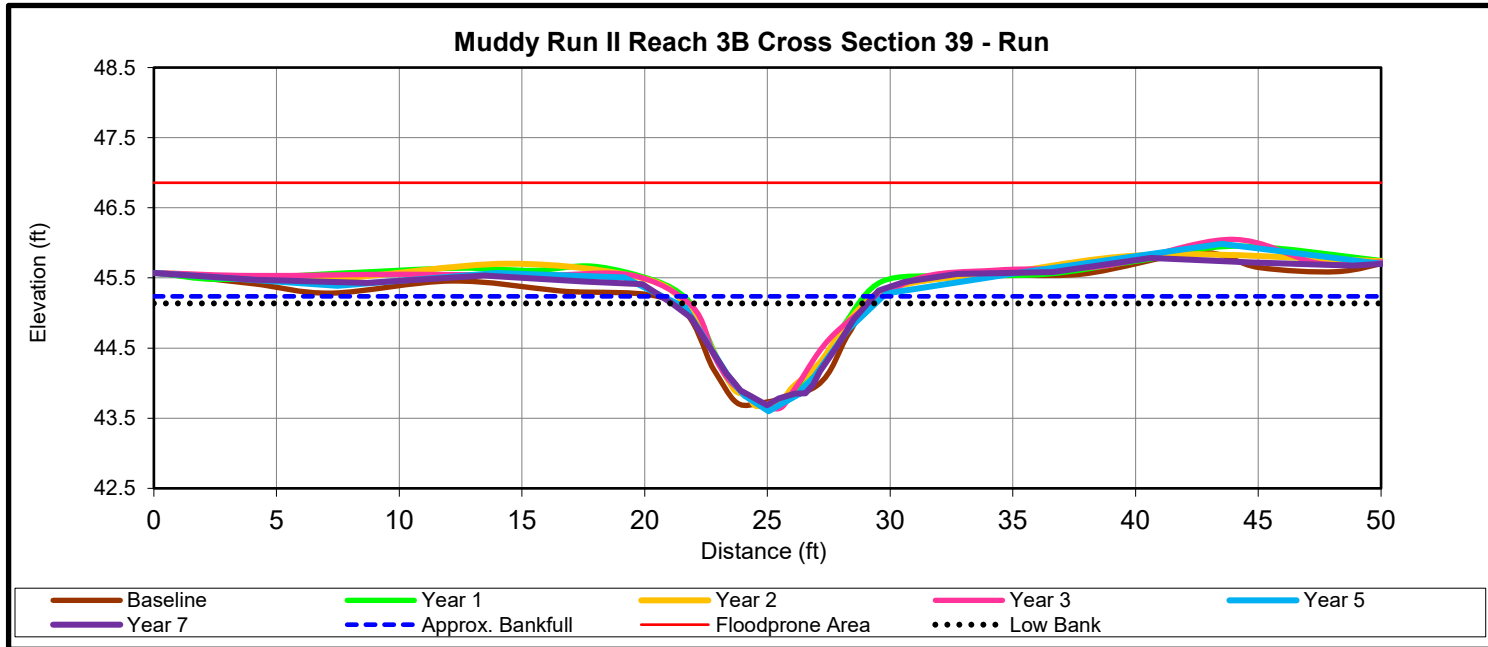


DIMENSIONS SUMMARY	Cross Section 39 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	45.2	45.2	45.2	45.2	45.2	45.2	
Bankfull Width (ft) ¹	8.2	7.2	8.2	8.4	8.9	8.7	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	0.9	0.9	0.8	0.8	0.9	-	
Bankfull Max Depth (ft) ³	1.5	1.5	1.5	1.6	1.6	1.5	
Low Bank Elevation (ft)	-	-	-	-	1.5	45.1	
Bankfull Cross Sectional Area (ft ²) ²	7.6	6.5	6.9	6.7	7.6	6.7	
Bankfull Width/Depth Ratio	8.7	7.9	9.7	10.4	10.5	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>5.6	>5.8	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.9	



Upstream



Downstream

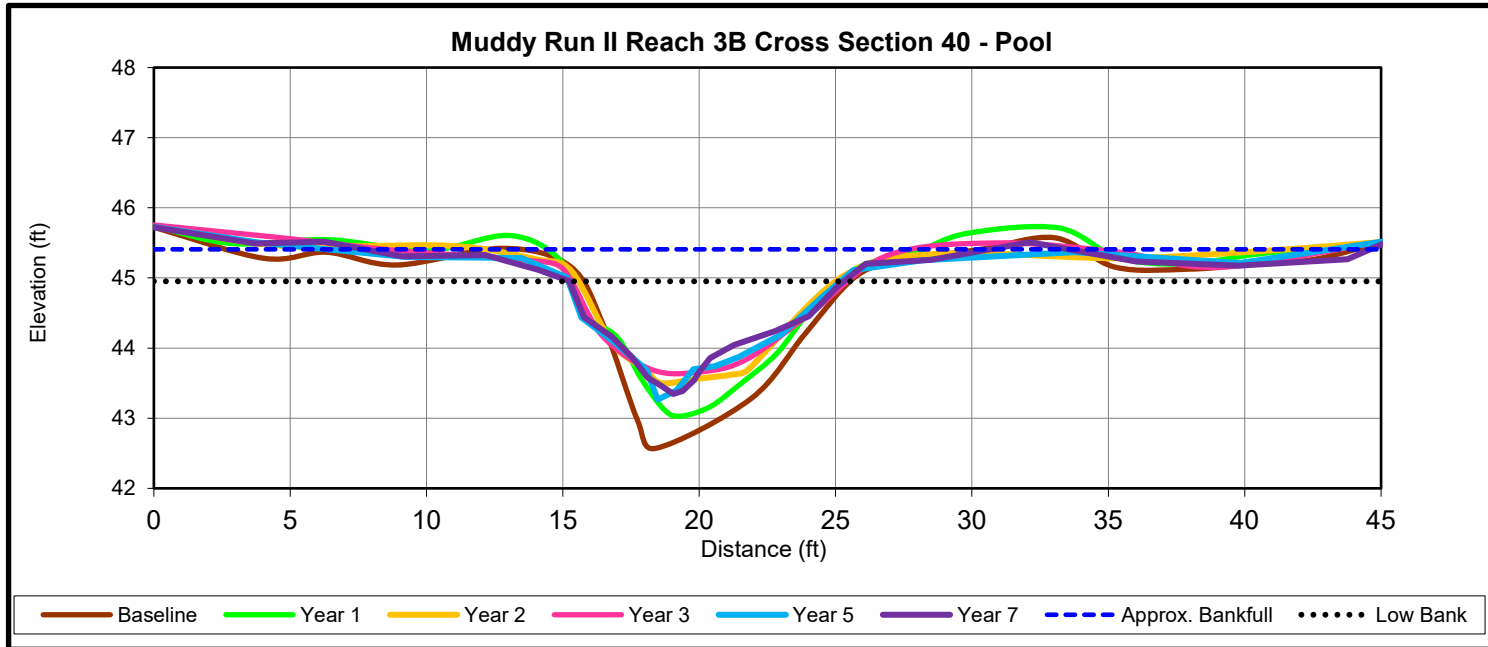


DIMENSIONS SUMMARY	Cross Section 40 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	45.0	45.0	45.0	45.0	45.3	45.4	
Bankfull Width (ft) ¹	10.3	10.3	9.7	10.6	24.6	14.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	45.0	45.0	
Bankfull Mean Depth (ft)	1.4	1.1	1.0	0.9	0.6	-	
Bankfull Max Depth (ft) ¹	2.5	2.0	1.5	1.3	2.1	1.6	
Low Bank Elevation (ft)	-	-	-	-	-	45.0	
Bankfull Cross Sectional Area (ft ²) ¹	14.3	11.7	9.5	9.3	14.3	8.7	
Bankfull Width/Depth Ratio	7.4	9.0	9.9	12.1	42.2	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

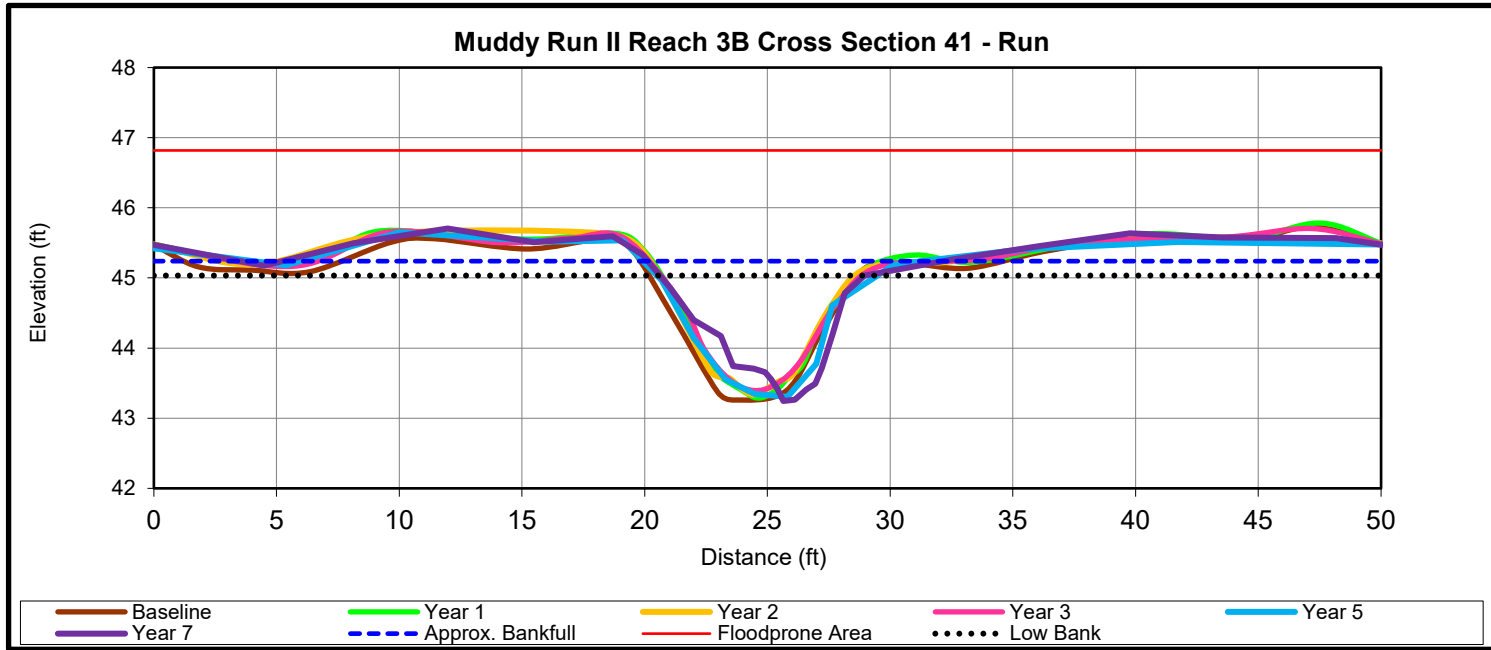


DIMENSIONS SUMMARY	Cross Section 41 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	45.1	45.1	45.1	45.1	45.2	45.2	
Bankfull Width (ft) ¹	8.9	8.5	8.6	9.0	9.9	13.7	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.1	1.1	1.0	0.9	1.0	-	
Bankfull Max Depth (ft) ²	1.9	1.8	1.8	1.7	1.9	1.8	
Low Bank Elevation (ft)	-	-	-	-	-	45.0	
Bankfull Cross Sectional Area (ft ²) ²	10.2	9.0	8.8	8.6	10.2	8.1	
Bankfull Width/Depth Ratio	7.8	8.0	8.3	9.5	9.5	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>5.1	>3.6	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.7	0.9	



Upstream



Downstream

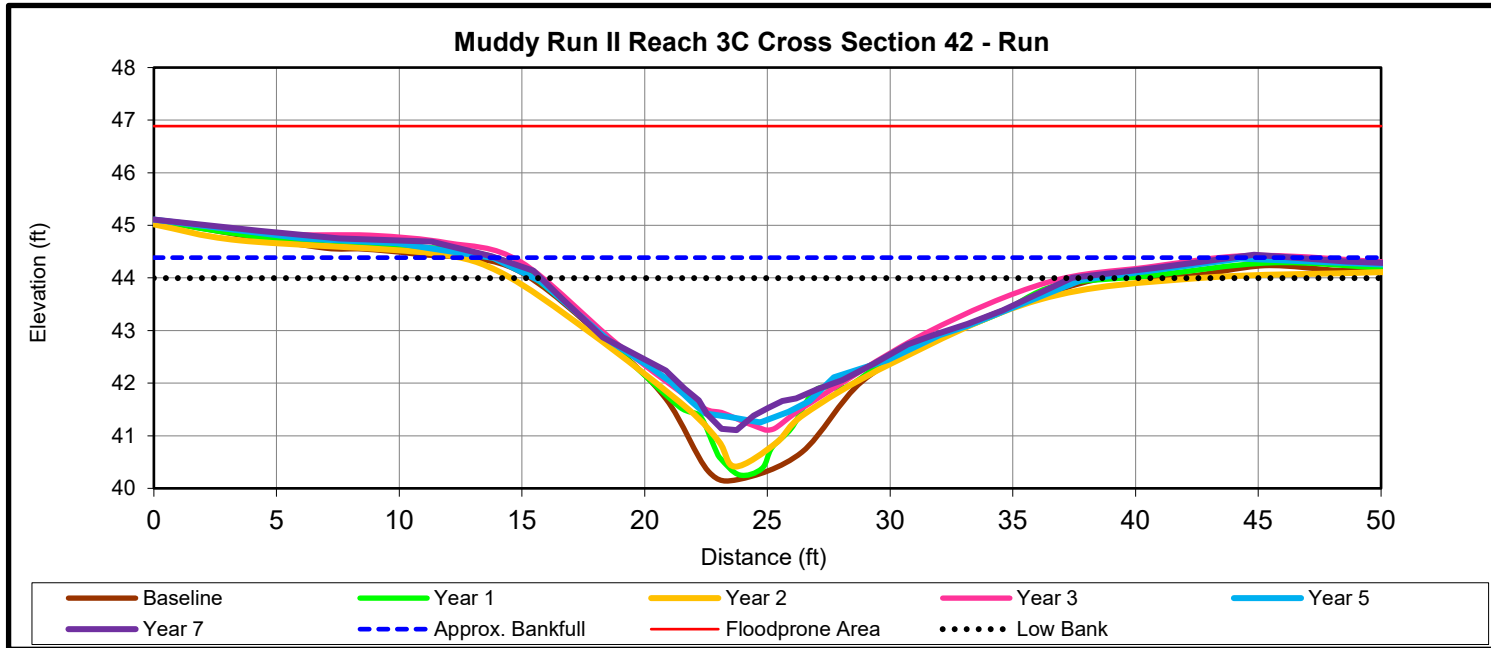


DIMENSIONS SUMMARY	Cross Section 42 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	44.0	44.0	44.0	44.0	44.5	44.4	
Bankfull Width (ft) ¹	23.5	24.1	28.1	21.9	34.3	23.5	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.7	1.5	1.4	1.4	1.2	-	
Bankfull Max Depth (ft) ²	3.8	3.7	3.6	2.9	3.3	2.9	
Low Bank Elevation (ft)	-	-	-	-	-	44.0	
Bankfull Cross Sectional Area (ft ²) ²	39.7	35.7	38.3	31.0	39.7	31.0	
Bankfull Width/Depth Ratio	13.9	16.2	20.6	15.4	29.6	-	
Bankfull Entrenchment Ratio ¹	2.1	2.1	1.8	>2.2	>1.5	>2.1	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.8	0.9	



Upstream



Downstream

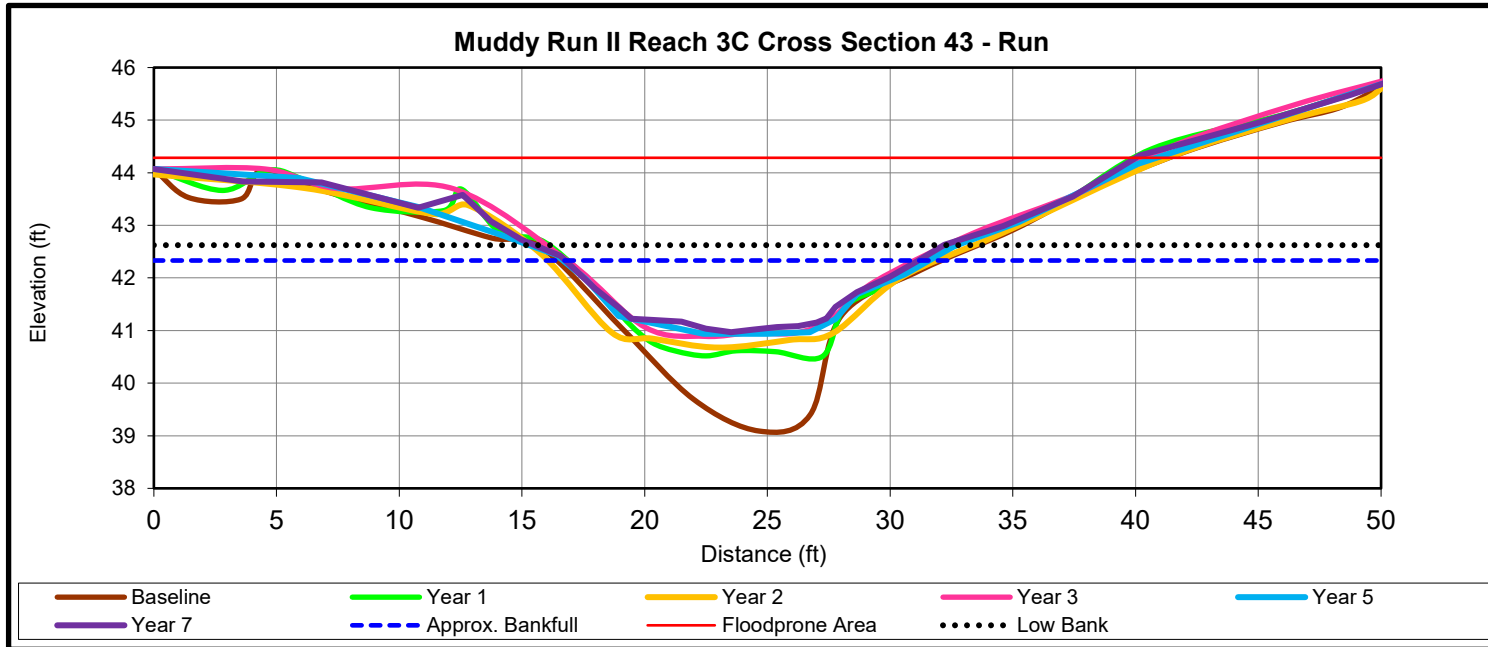


DIMENSIONS SUMMARY	Cross Section 43 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	41.3	41.3	41.3	41.3	42.2	42.3	
Bankfull Width (ft) ¹	9.4	9.2	10.6	8.3	14.4	14.4	
Floodprone Width (ft) ¹	29.0	29.0	15.0	15.0	28.6	30.2	
Bankfull Mean Depth (ft)	1.4	0.7	0.4	0.3	0.9	-	
Bankfull Max Depth (ft) ²	2.2	0.9	0.6	0.4	1.3	1.7	
Low Bank Elevation (ft)	-	-	-	-	-	42.6	
Bankfull Cross Sectional Area (ft ²) ²	13.2	6.5	4.7	2.5	13.2	17.7	
Bankfull Width/Depth Ratio	6.7	13.2	23.9	28.0	15.6	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	1.4	>2.2	>2	>2.1	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.1	1.2	



Upstream



Downstream

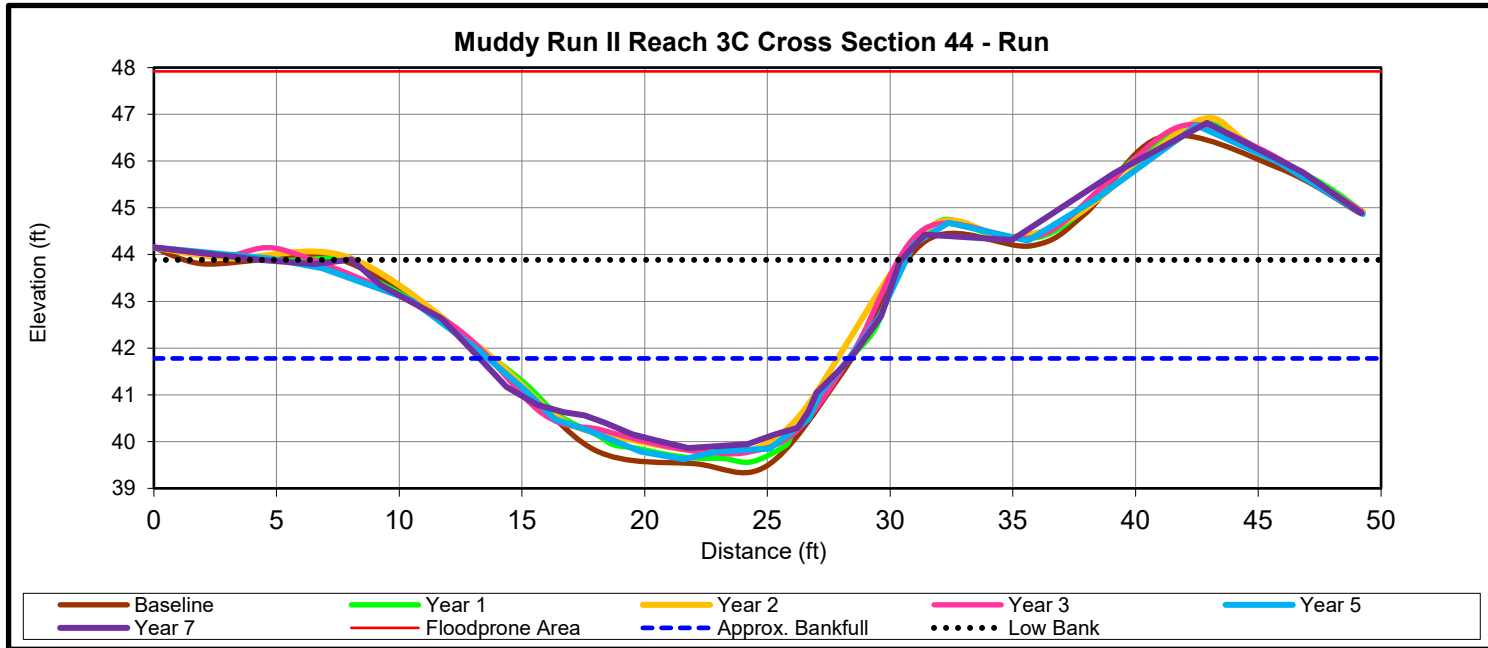


DIMENSIONS SUMMARY	Cross Section 44 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	41.5	41.5	41.5	41.5	41.6	41.8	
Bankfull Width (ft) ¹	13.723	13.5	13.2	13.9	14.2	15.1	
Floodprone Width (ft) ¹	22.0	22.0	20.0	20.0	23.0	21.8	
Bankfull Mean Depth (ft)	1.4	1.3	1.2	1.2	1.4	-	
Bankfull Max Depth (ft) ²	2.0	2.0	1.7	1.7	2.0	4.0	
Low Bank Elevation (ft)	-	-	-	-	-	43.9	
Bankfull Cross Sectional Area (ft ²) ²	19.6	18.0	15.2	16.8	19.6	59.2	
Bankfull Width/Depth Ratio	9.6	10.1	11.0	11.4	10.3	-	
Bankfull Entrenchment Ratio ¹	1.6	1.6	1.5	>2.2	>1.6	>1.4	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.7	2.1	



Upstream



Downstream

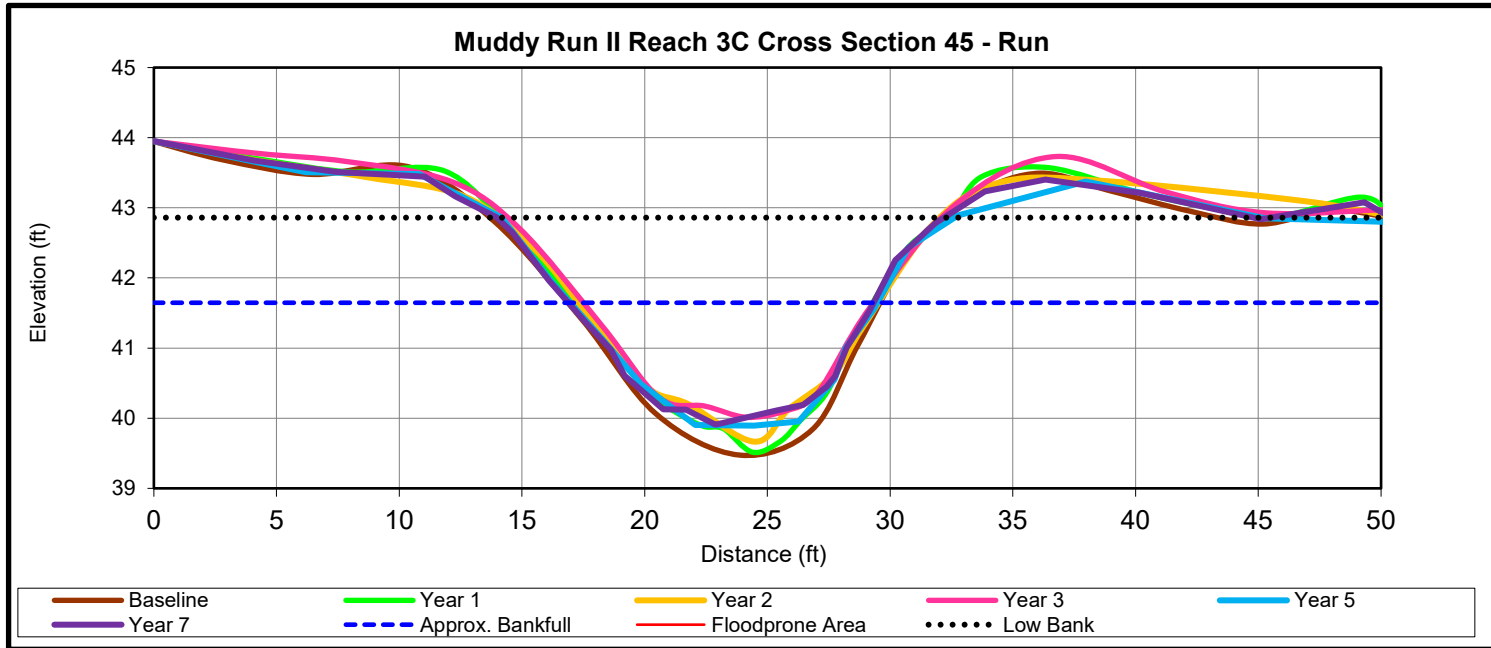


DIMENSIONS SUMMARY	Cross Section 45 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	41.4	41.4	41.4	41.4	41.6	41.7	
Bankfull Width (ft) ¹	11.8	11.5	11.2	10.8	12.4	12.4	
Floodprone Width (ft) ¹	35.3	35.3	30.0	30.0	37.0	38.7	
Bankfull Mean Depth (ft)	1.2	1.2	1.0	1.0	1.2	-	
Bankfull Max Depth (ft) ²	1.9	2.0	1.7	1.4	1.7	3.0	
Low Bank Elevation (ft)	-	-	-	-	-	42.9	
Bankfull Cross Sectional Area (ft ²) ²	14.6	13.8	11.3	10.4	14.6	32.8	
Bankfull Width/Depth Ratio	9.5	9.6	11.1	11.2	10.5	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.0	>3.1	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.5	1.7	



Upstream



Downstream

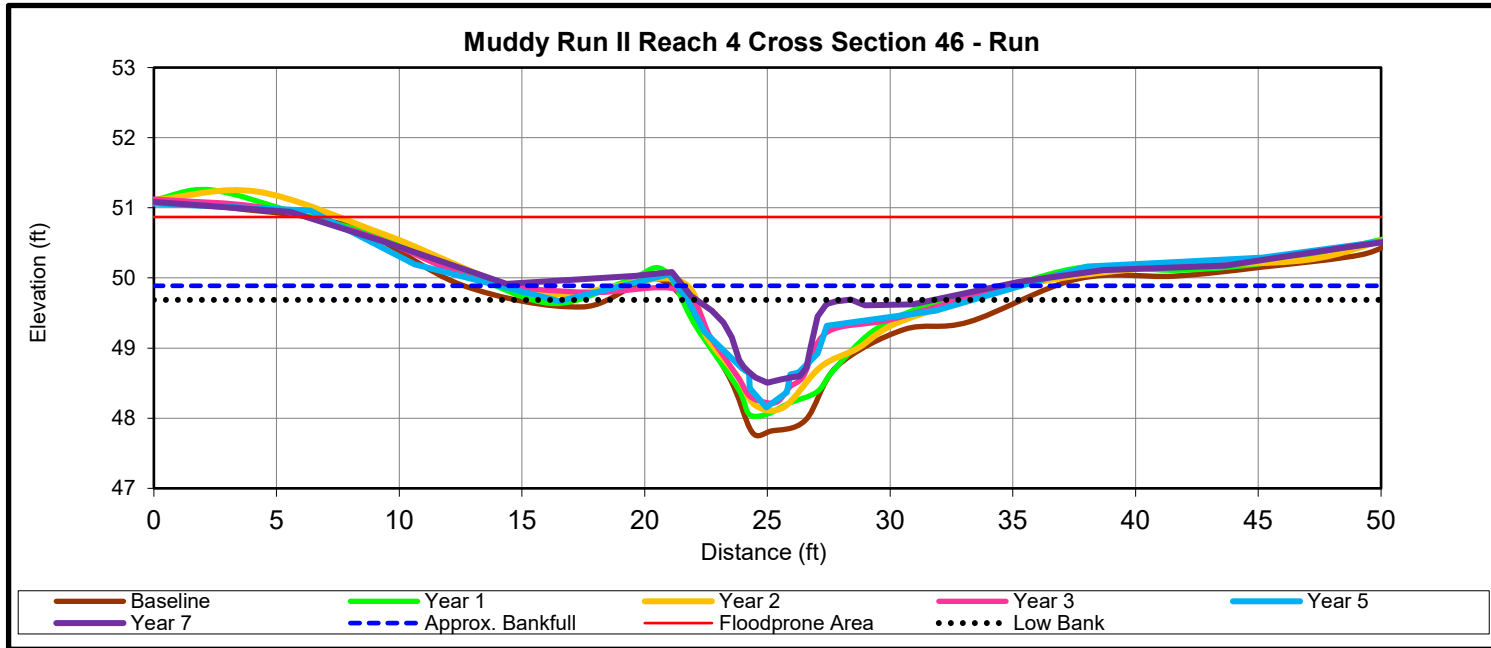


DIMENSIONS SUMMARY	Cross Section 46 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	49.3	49.3	49.3	49.3	49.7	49.9	
Bankfull Width (ft) ¹	8.4	7.2	7.8	6.0	11.6	13.0	
Floodprone Width (ft) ¹	42.5	42.5	42.5	42.5	50.0	50.0	
Bankfull Mean Depth (ft)	0.8	0.7	0.6	0.6	0.5	-	
Bankfull Max Depth (ft) ²	1.5	1.2	1.1	1.1	1.5	1.2	
Low Bank Elevation (ft)	-	-	-	-	-	49.7	
Bankfull Cross Sectional Area (ft ²) ²	6.3	5.1	4.7	3.4	6.3	3.9	
Bankfull Width/Depth Ratio	11.1	10.2	12.9	10.7	21.1	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>4.3	>3.9	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.8	0.9	



Upstream



Downstream

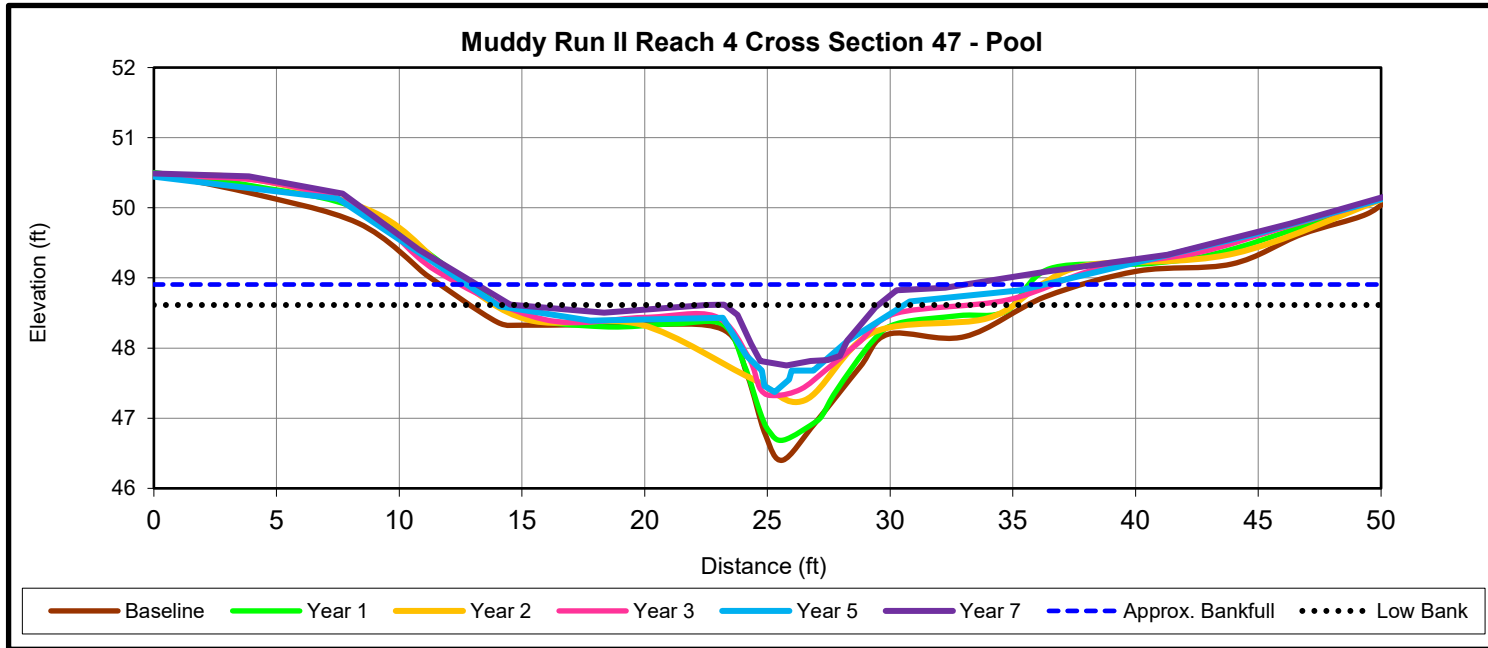


DIMENSIONS SUMMARY	Cross Section 47 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	48.2	48.2	48.2	48.2	48.6	48.9	
Bankfull Width (ft) ¹	6.7	6.3	8.6	5.7	16.4	10.6	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	38.0	50.0	
Bankfull Mean Depth (ft)	0.9	0.8	0.5	0.5	1.2	-	
Bankfull Max Depth (ft) ²	1.8	1.5	0.9	0.9	1.2	0.9	
Low Bank Elevation (ft)	-	-	-	-	-	48.6	
Bankfull Cross Sectional Area (ft ²) ²	6.0	5.3	4.2	2.9	6.0	3.6	
Bankfull Width/Depth Ratio	7.3	7.4	17.7	11.3	44.8	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

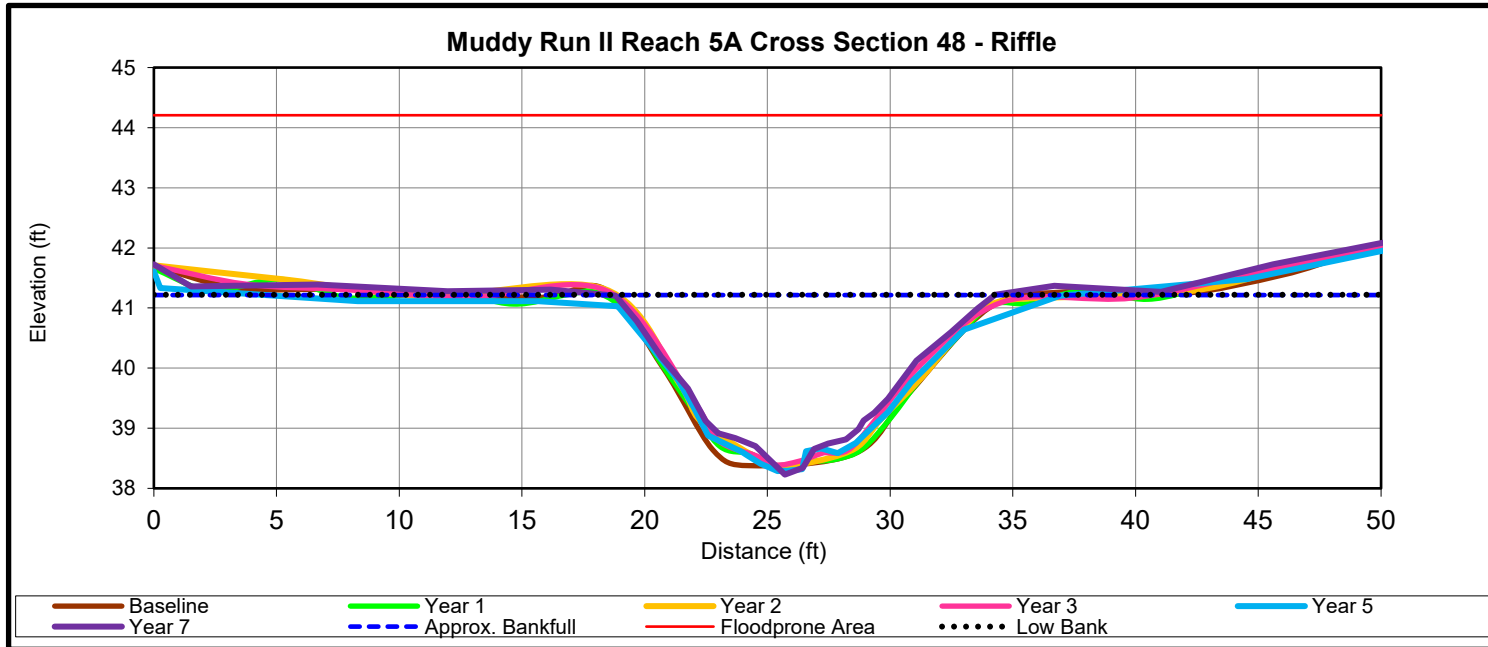


DIMENSIONS SUMMARY	Cross Section 48 (Riffle)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	41.0	41.0	41.0	41.0	41.1	41.2	
Bankfull Width (ft) ¹	15.1	15.0	15.1	15.3	17.9	15.5	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.7	1.7	1.6	1.5	1.4	-	
Bankfull Max Depth (ft) ²	2.6	2.7	2.6	2.6	2.8	3.0	
Low Bank Elevation (ft)	-	-	-	-	-	41.2	
Bankfull Cross Sectional Area (ft ²) ²	25.3	24.8	24.0	23.4	25.3	25.3	
Bankfull Width/Depth Ratio	9.0	9.1	9.5	10.0	12.7	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>2.8	>3.3	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.8	1.0	



Upstream



Downstream

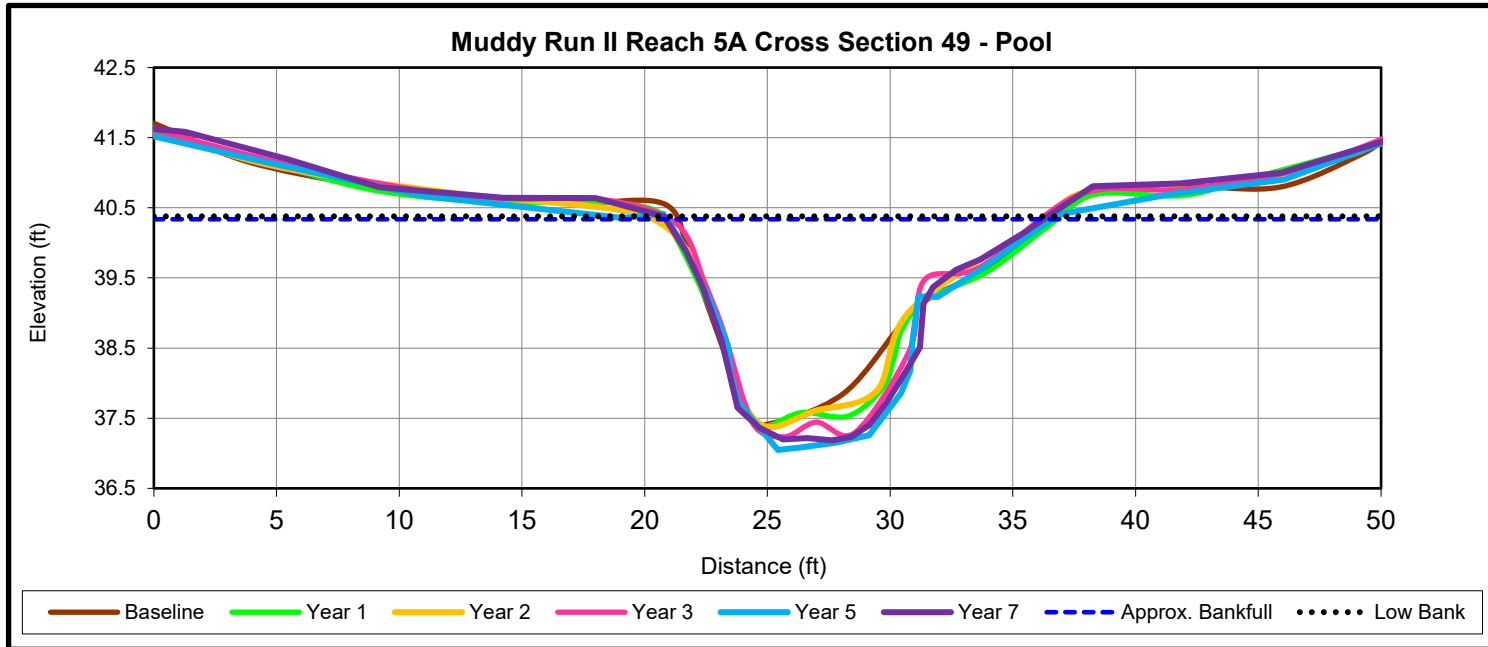


DIMENSIONS SUMMARY	Cross Section 49 (Pool)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	40.5	40.5	40.5	40.5	40.3	40.3	
Bankfull Width (ft) ¹	16.6	17.0	19.3	17.6	15.4	15.4	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.7	1.7	1.4	1.6	1.8	-	
Bankfull Max Depth (ft) ²	3.1	3.1	3.1	3.3	3.2	3.2	
Low Bank Elevation (ft)	-	-	-	-	-	40.4	
Bankfull Cross Sectional Area (ft ²) ²	27.4	28.5	27.3	28.3	27.4	28.0	
Bankfull Width/Depth Ratio	10.0	10.2	13.7	11.0	8.6	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

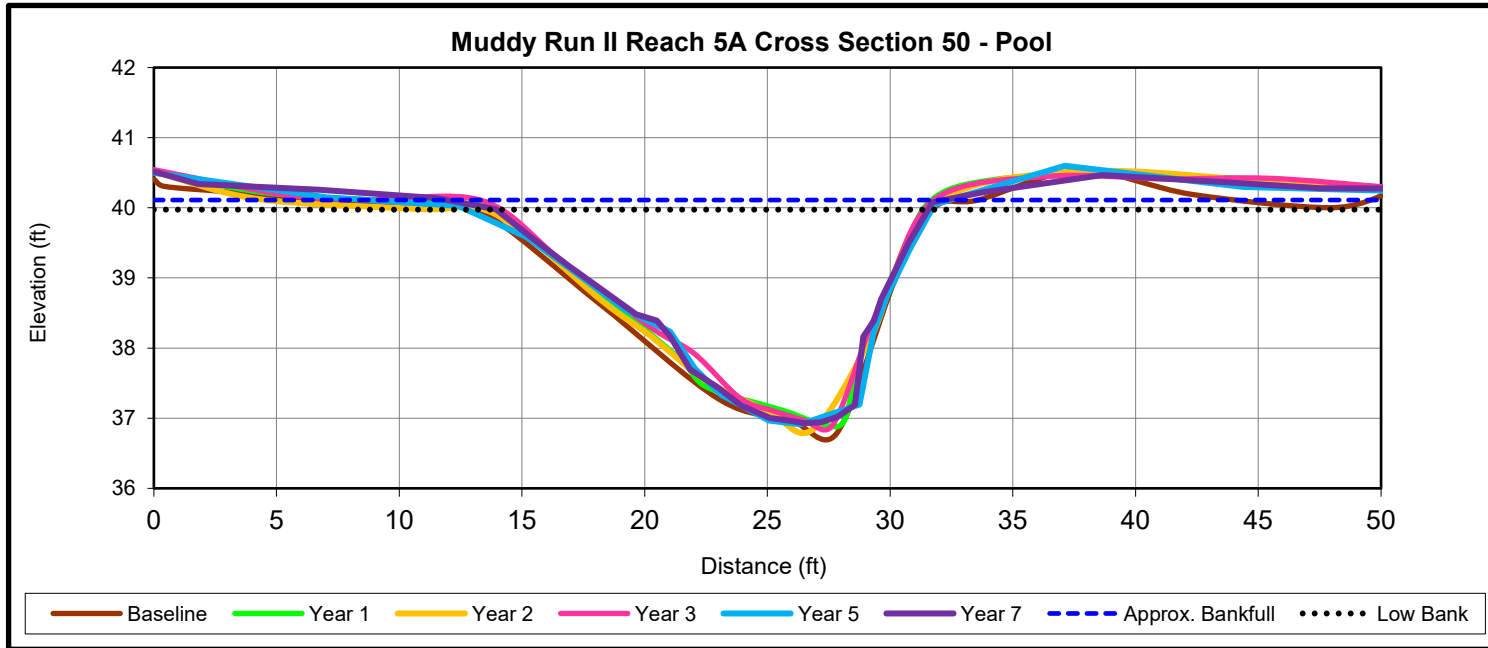


	Cross Section 50 (Pool)						
DIMENSIONS SUMMARY	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bank full Elevation (ft) - Based on AB-XSA ¹	40.0	40.0	40.0	40.0	40.1	40.1	
Bankfull Width (ft) ¹	18.5	17.7	21.6	17.8	21.6	20.3	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	1.8	1.7	1.5	1.7	1.5	-	
Bankfull Max Depth (ft) ²	3.2	3.1	3.2	3.1	3.2	3.0	
Low Bank Elevation (ft)	-	-	-	-	-	40.0	
Bankfull Cross Sectional Area (ft ²) ²	32.9	30.7	31.7	30.2	32.9	30.3	
Bankfull Width/Depth Ratio	10.4	10.2	14.7	10.6	14.2	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	



Upstream



Downstream

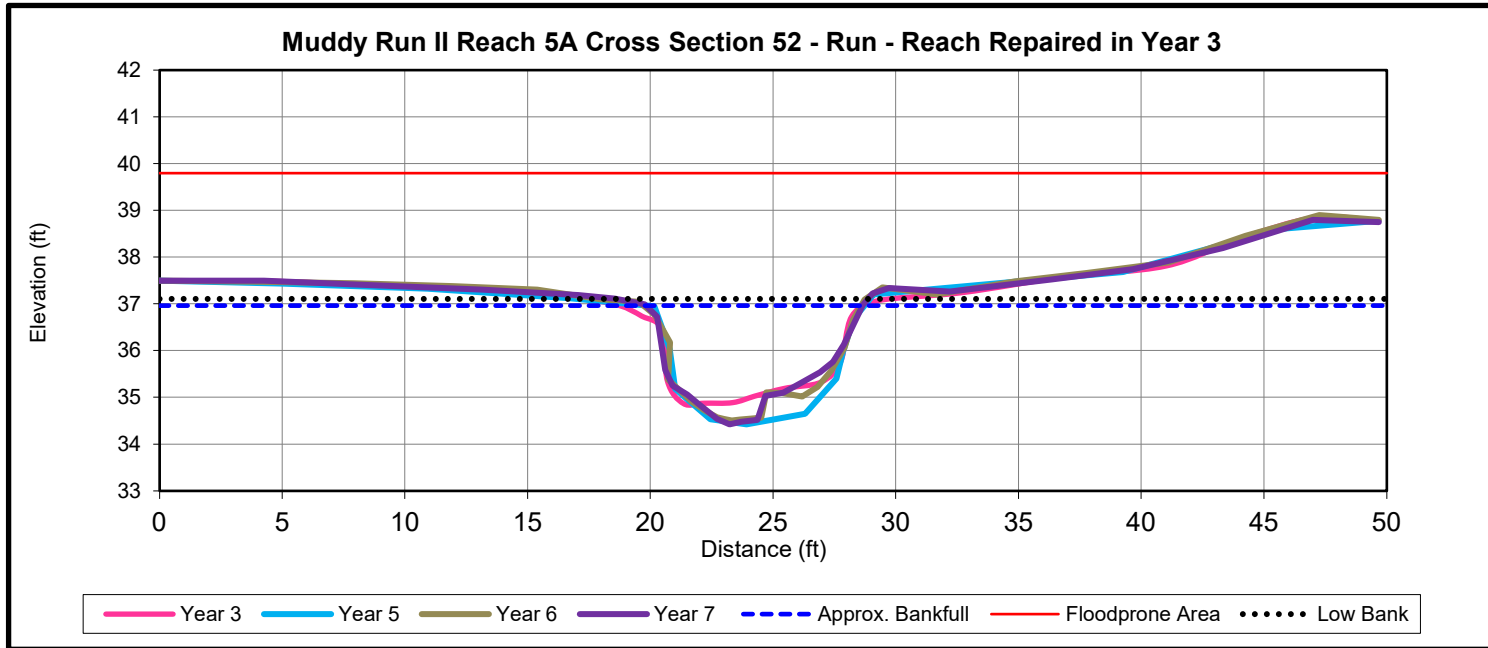


DIMENSIONS SUMMARY	Cross Section 52 (Run)						
	Base	MY1	MY2	MY3*	MY5	MY6	MY7
Bankfull Elevation (ft) - Based on AB-XSA ¹	39.8	39.8	39.8	37.0	36.8	36.9	37.0
Bankfull Width (ft) ¹	17.7	17.8	19.3	10.6	8.1	8.8	8.8
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	>49.7	49.7
Bankfull Mean Depth (ft)	1.8	2.1	2.7	1.4	1.8	-	-
Bankfull Max Depth (ft) ²	3.1	4.5	5.9	2.1	2.3	2.5	2.7
Low Bank Elevation (ft)	-	-	-	-	-	37.0	37.1
Bankfull Cross Sectional Area (ft ²) ³	31.8	36.9	52.3	14.6	14.6	15.5	16.0
Bankfull Width/Depth Ratio	9.9	8.6	7.1	7.7	4.5	-	-
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>6.1	>5.7	>5.6
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	1.1	1.0	1.1



Upstream



Downstream

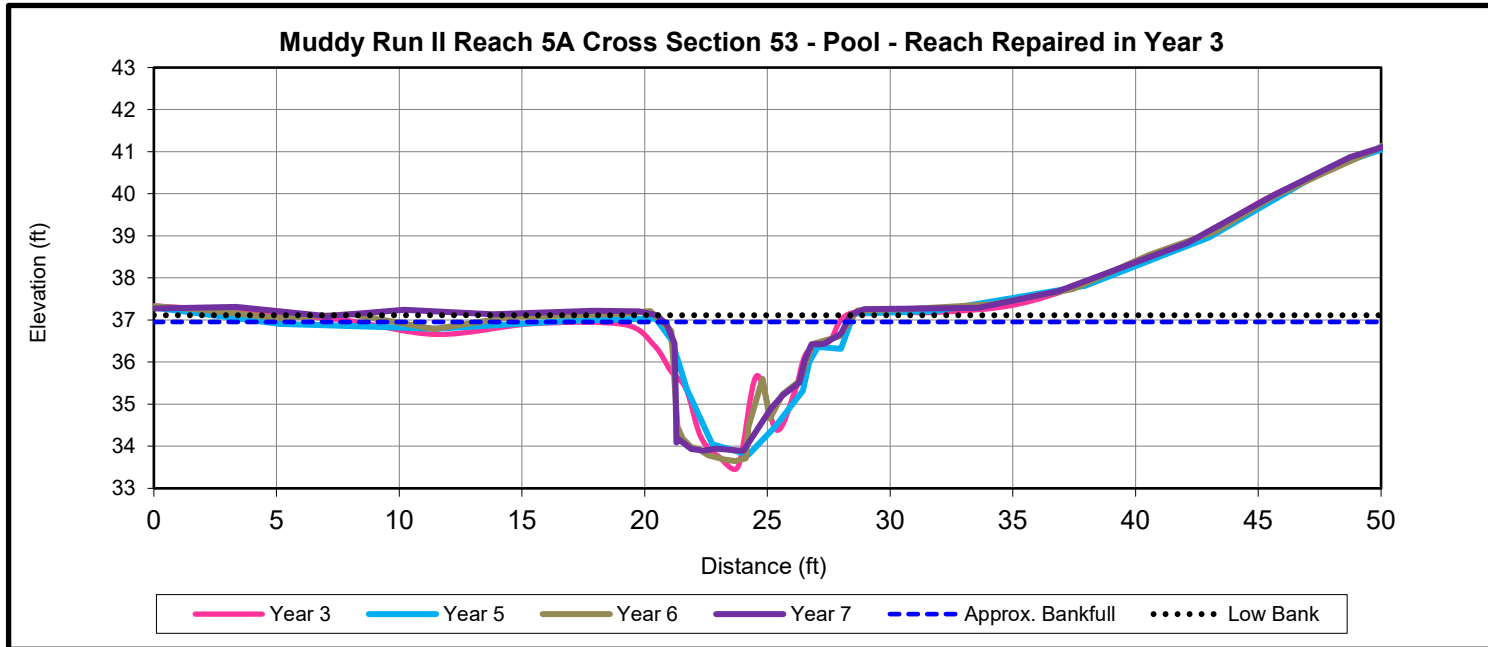


DIMENSIONS SUMMARY	Cross Section 53 (Pool)						
	Base	MY1	MY2	MY3*	MY5	MY6	MY7
Bankfull Elevation (ft) - Based on AB-XS-A ¹	39.7	39.7	39.7	36.9	36.9	36.9	37.0
Bankfull Width (ft) ¹	17.4	17.9	18.1	8.9	7.7	N/A	7.2
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	45.0	N/A	50.0
Bankfull Mean Depth (ft)	1.9	2.1	2.2	1.5	1.8	-	-
Bankfull Max Depth (ft) ²	3.5	3.8	4.1	3.4	3.1	3.5	3.2
Low Bank Elevation (ft)	-	-	-	-	-	37.2	37.1
Bankfull Cross Sectional Area (ft ²) ²	33.8	37.1	39.0	13.6	13.6	15.8	15.6
Bankfull Width/Depth Ratio	9.0	8.6	8.4	5.8	4.3	-	-
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	N/A
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	N/A



Upstream



Downstream

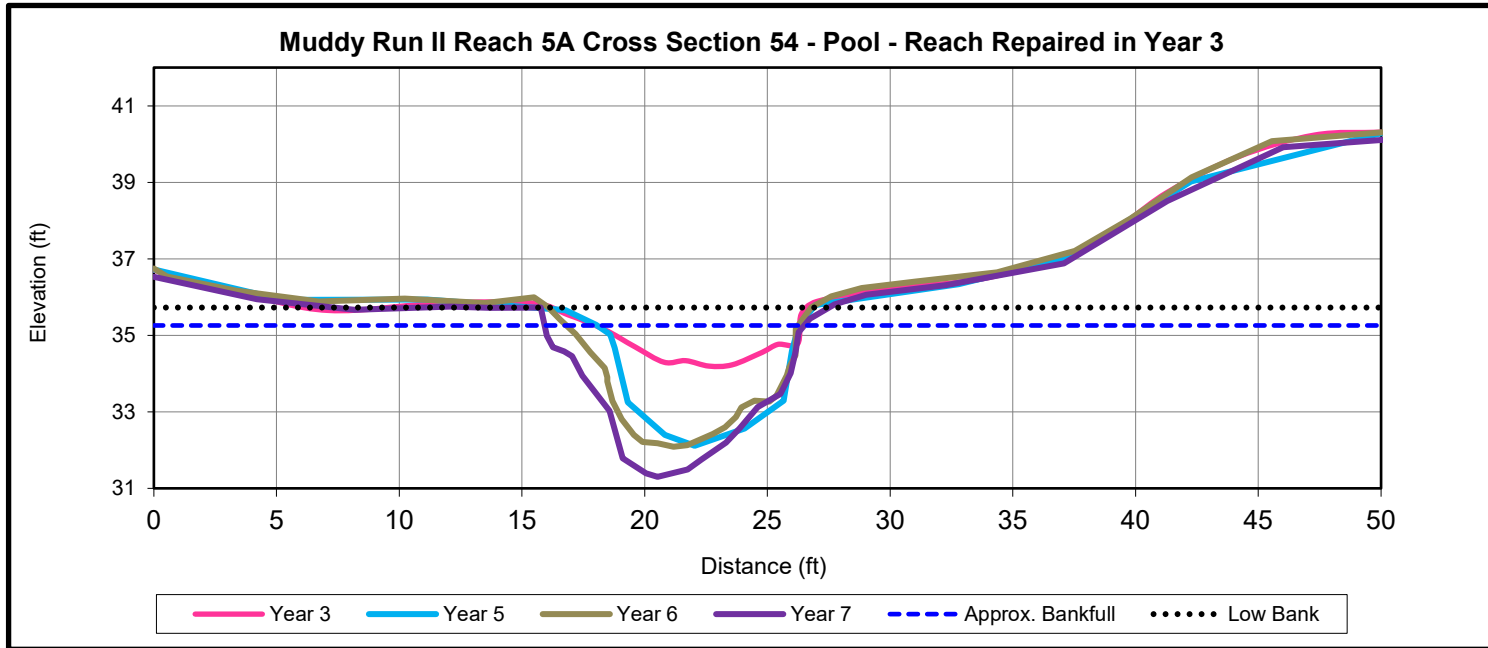


DIMENSIONS SUMMARY	Cross Section 54 (Pool)						
	Base	MY1	MY2	MY3*	MY5	MY6	MY7
Bankfull Elevation (ft) - Based on AB-XSA ¹	38.8	38.8	38.8	35.9	34.4	34.3	35.3
Bankfull Width (ft) ¹	15.7	16.7	20.3	11.5	7.0	N/A	10.6
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	34.0	N/A	50.0
Bankfull Mean Depth (ft)	1.7	2.0	2.2	1.0	1.7	-	-
Bankfull Max Depth (ft) ²	2.9	4.0	4.4	1.7	2.3	3.9	4.4
Low Bank Elevation (ft)	-	-	-	-	-	36.0	35.7
Bankfull Cross Sectional Area (ft ^{2,3})	26.1	32.7	45.2	11.7	11.7	27.9	31.4
Bankfull Width/Depth Ratio	9.5	8.5	9.1	11.3	4.2	-	-
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	N/A	N/A	N/A
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	N/A	N/A	N/A



Upstream



Downstream

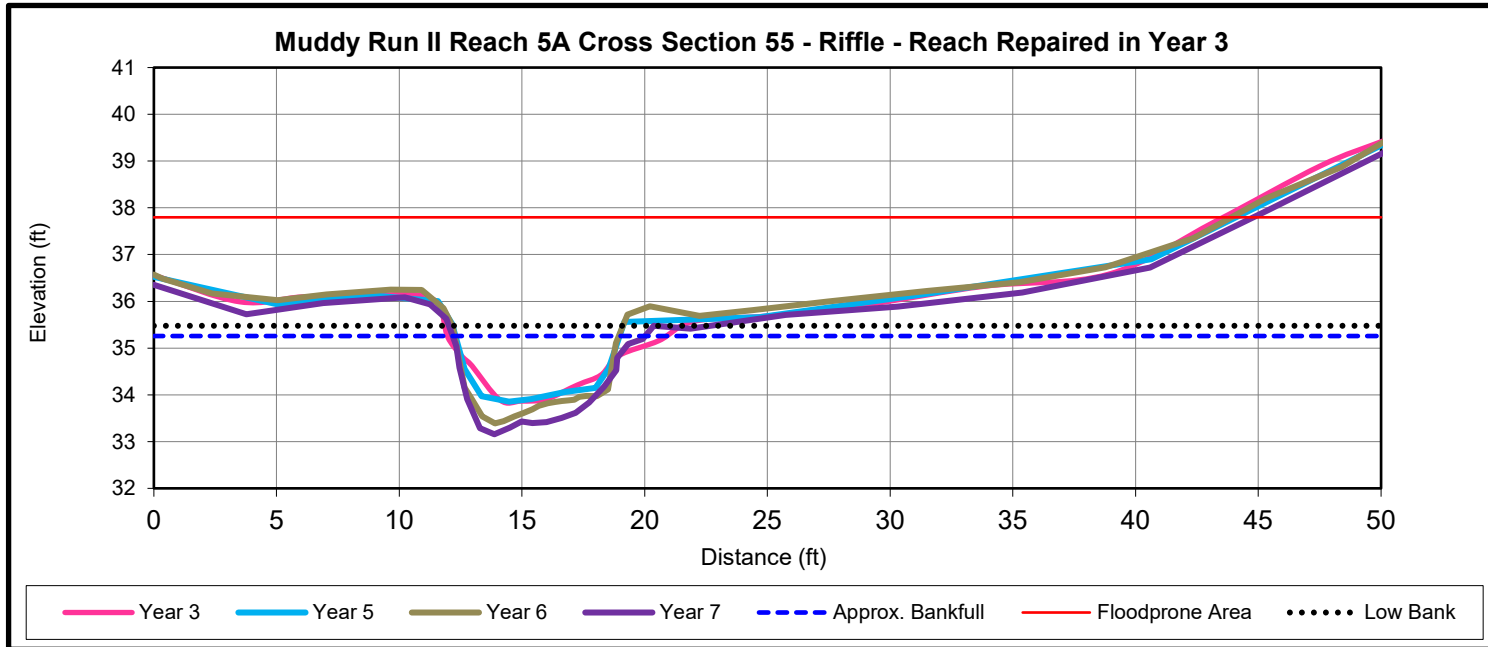


DIMENSIONS SUMMARY	Cross Section 55 (Riffle)						
	Base	MY1	MY2	MY3*	MY5	MY6	MY7
Bankfull Elevation (ft) - Based on AB-XSA ¹	38.0	38.0	38.0	35.6	35.7	35.5	35.6
Bankfull Width (ft) ¹	9.7	14.8	20.8	10.2	12.7	6.9	8.4
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	43.0	>42.9	45.7
Bankfull Mean Depth (ft)	1.4	2.2	2.1	1.0	0.8	-	-
Bankfull Max Depth (ft) ²	2.2	3.0	3.3	1.7	1.8	2.5	2.3
Low Bank Elevation (ft)	-	-	-	-	-	35.9	35.5
Bankfull Cross Sectional Area (ft ²) ³	13.6	33.3	44.4	10.5	10.5	13.8	12.7
Bankfull Width/Depth Ratio	7.0	6.6	9.7	9.9	15.4	-	-
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.4	>6.2	>5.4
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	1.2	1.0



Upstream



Downstream

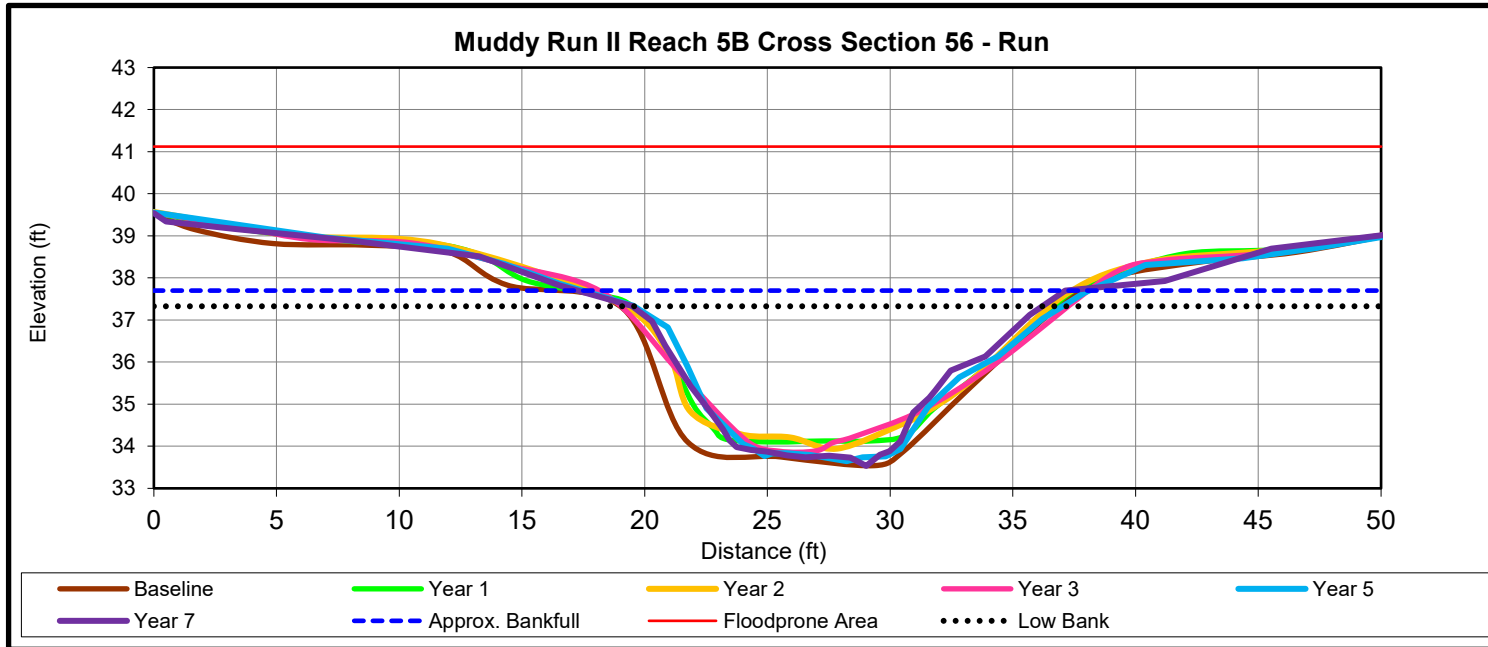


DIMENSIONS SUMMARY	Cross Section 56 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	37.3	37.3	37.3	37.3	37.7	37.7	
Bankfull Width (ft) ¹	17.6	17.0	17.5	18.4	20.2	20.0	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	2.6	2.2	2.2	2.1	2.2	-	
Bankfull Max Depth (ft) ²	3.7	3.2	3.3	3.4	4.0	3.8	
Low Bank Elevation (ft)	-	-	-	-	-	37.3	
Bankfull Cross Sectional Area (ft ²) ³	45.3	38.0	37.9	38.1	45.3	38.4	
Bankfull Width/Depth Ratio	6.9	7.6	8.0	8.8	9.0	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>2.5	>2.5	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.9	



Upstream



Downstream

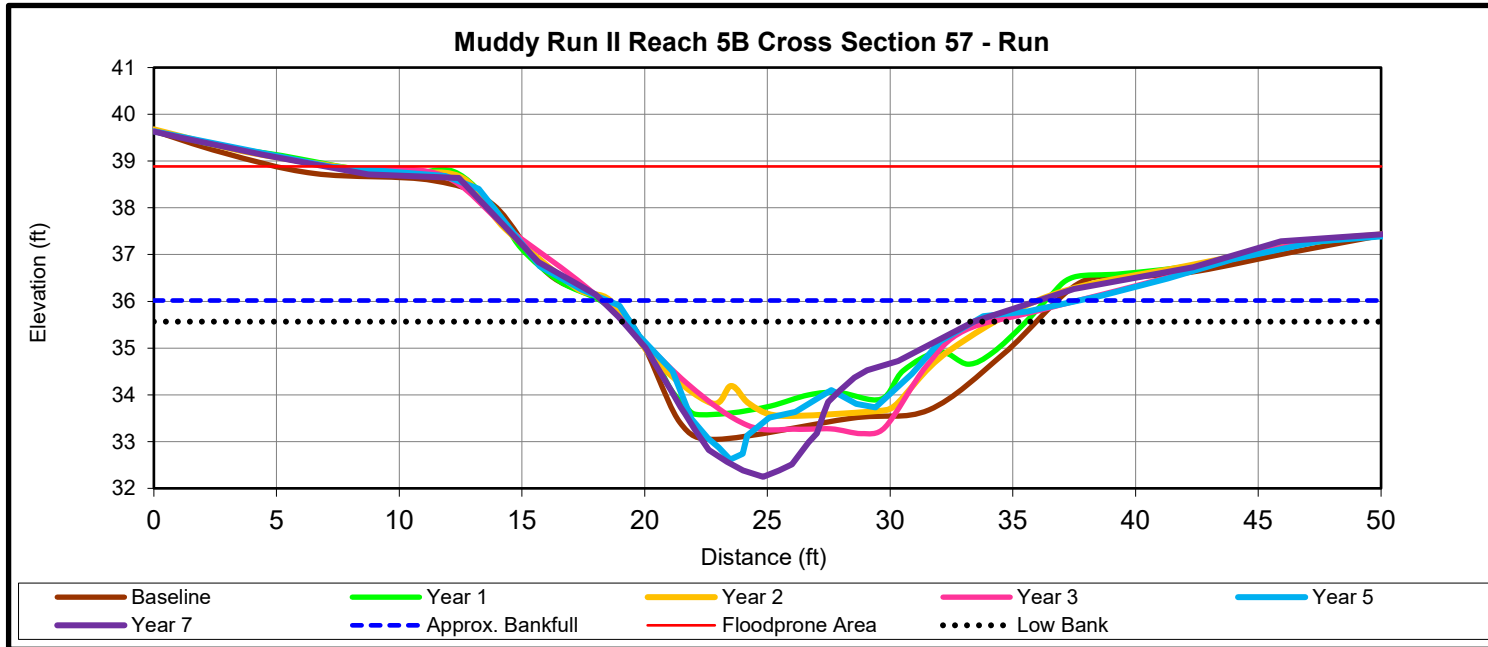


DIMENSIONS SUMMARY	Cross Section 57 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XSA ¹	35.7	35.7	35.7	35.7	36.1	36.0	
Bankfull Width (ft) ¹	17.0	16.8	16.0	16.4	20.6	17.8	
Floodprone Width (ft) ¹	37.5	37.5	37.5	37.5	50.0	50.0	
Bankfull Mean Depth (ft)	1.8	1.3	1.4	1.5	1.5	-	
Bankfull Max Depth (ft) ²	2.6	2.1	2.1	2.5	3.5	3.3	
Low Bank Elevation (ft)	-	-	-	-	-	35.6	
Bankfull Cross Sectional Area (ft ²) ^{2,3}	30.7	22.4	22.7	24.8	30.7	23.5	
Bankfull Width/Depth Ratio	9.4	12.5	11.2	10.9	13.9	-	
Bankfull Entrenchment Ratio ¹	2.2	2.2	>2.2	>2.2	>2.4	>2.8	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	0.9	



Upstream



Downstream

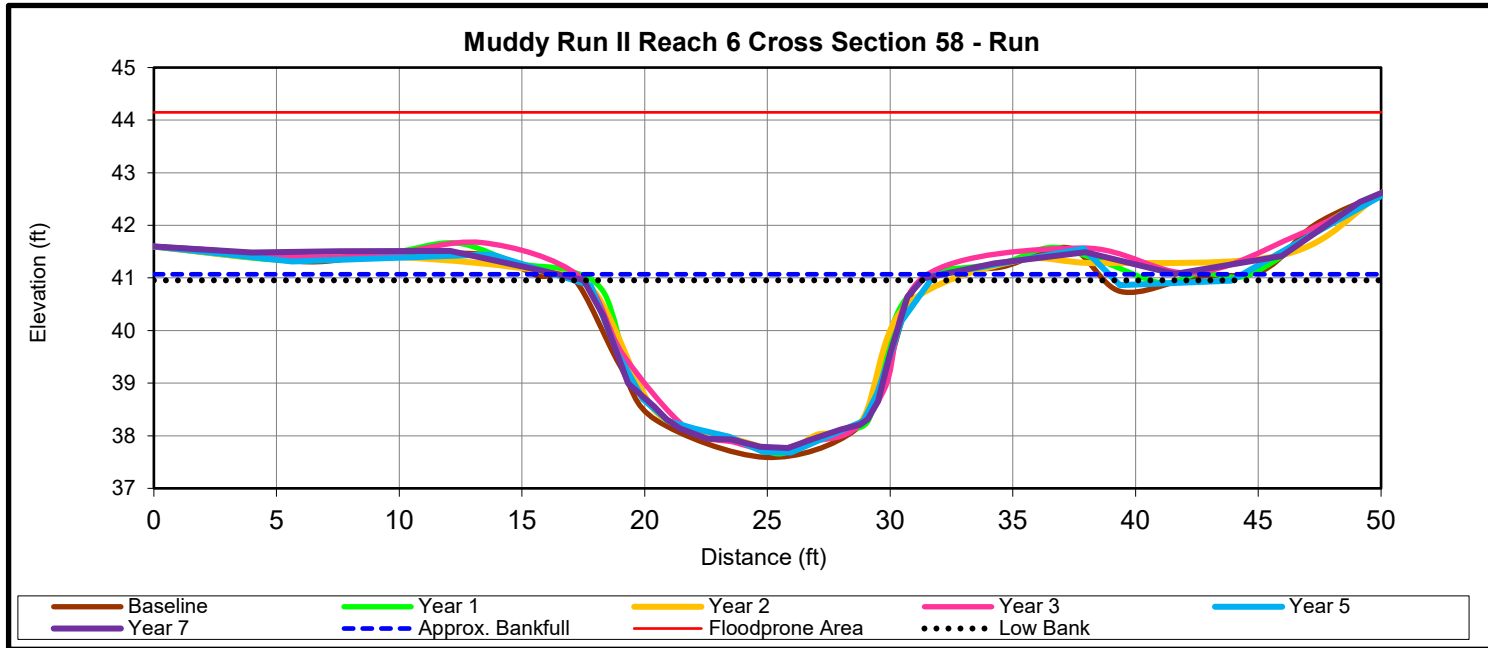

DIMENSIONS SUMMARY	Cross Section 58 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Bankfull Elevation (ft) - Based on AB-XS A ¹	41.0	41.0	41.0	41.0	41.1	41.1	
Bankfull Width (ft) ¹	14.2	13.7	16.9	14.0	15.4	15.7	
Floodprone Width (ft) ¹	50.0	50.0	50.0	50.0	50.0	50.0	
Bankfull Mean Depth (ft)	2.4	2.3	1.9	2.3	2.2	-	
Bankfull Max Depth (ft) ²	3.4	3.3	3.3	3.3	3.4	3.2	
Low Bank Elevation (ft)	-	-	-	-	-	41.0	
Bankfull Cross Sectional Area (ft ²) ³	33.9	31.7	32.3	32.6	33.9	32.3	
Bankfull Width/Depth Ratio	6.0	6.0	8.9	6.0	7.0	-	
Bankfull Entrenchment Ratio ¹	>2.2	>2.2	>2.2	>2.2	>3.2	>3.2	
Bankfull Bank Height Ratio ¹	1.0	1.0	1.0	1.0	0.9	1.0	

Appendix E

Hydrology Data

Table 13. Documentation of Geomorphologically Significant Flow Events

Table 14. Rainfall Summary

Table 15a. Wetland Hydrology Criteria Attainment

Table 15b. Wetland Hydrology Gauges Summary

2020 Groundwater Monitoring Gauge Hydrographs

Table 13. Documentation of Geomorphically Significant Flow Events

Stage Recorder	Number of Bankfull Events	Maximum Bankfull Height (ft.)
Stage Recorder 1 (Reach 2)		
MY1 2014	1	0.40
MY2 2015	1	0.60
MY3 2016	4	1.60
MY4 2017	5	1.10
MY5 2018	6	2.45
MY6 2019	0	---
MY7 2020	6	0.94
Stage Recorder 2 (Reach 3a)		
MY1 2014	8	1.50
MY2 2015	19	2.00
MY3 2016	8	2.00
MY4 2017	7	2.00
MY5 2018	10	3.50
MY6 2019	1	0.63
MY7 2020	NA	NA
Stage Recorder 3 (Reach 3b)		
MY1 2014	0	---
MY2 2015	4	0.20
MY3 2016	2	2.18
MY4 2017	0	---
MY5 2018	1	0.65
MY6 2019	0	---
MY7 2020	NA	NA
Stage Recorder 4 (Reach 5b)		
MY1 2014	2	0.45
MY2 2015	1	0.40
MY3 2016	1	3.80
MY4 2017	8	2.80
MY5 2018	6	3.75
MY6 2019	5	2.40
MY7 2020	16	3.20

NA - Not Available due to HOBO failure

Table 14. Rainfall Summary

Month	Average	Normal Limits		Wallace Station
		30 Percent	70 Percent	
January	4.33	3.32	5.03	2.46
February	3.23	2.14	3.87	7.71
March	4.50	3.23	5.32	4.04
April	3.16	1.70	3.85	3.35
May	3.68	2.69	4.34	9.61
June	4.49	3.11	5.34	6.97
July	6.06	4.16	7.22	5.01
August	5.40	3.12	6.56	5.52
September	5.00	2.04	6.07	11.39
October	3.21	1.62	3.92	3.73
November	2.89	1.83	3.49	0.40
December	3.24	2.14	3.88	---
Total	49.19	31.10	58.89	60.19

Table 15a. Wetland Hydrology Criteria Attainment

2020 Max Hydroperiod (Growing Season 17-Mar through 14-Nov, 242 days) Success Criterion 9%					
Gauge	Consecutive		Cumulative		Occurrences
	Days	Percent of growing Season	Days	Percent of growing Season	
AW1	41	17	165	68	13
AW2	42	17	165	68	13
AW3	41	17	174	72	11
AW4	128	53	221	91	3
AW5	57	23	212	87	8
AW6	59	24	214	88	7
AW7	92	38	226	93	4
RAW1	46	19	190	79	9
RAW2	12	5	68	28	18
RAW3	45	18	182	75	10




Table 15b. Wetland Hydrology Gauge Summary


Gauge	MY1-2014		MY2-2015		MY3-2016		MY4-2017		MY5-2018**		MY6-2019		MY7-2020	
	Consecutive		Consecutive		Consecutive		Consecutive		Consecutive		Consecutive		Consecutive	
	Days	Percent of growing Season	Days	Percent of growing Season	Days	Percent of growing Season	Days	Percent of growing Season	Days	Percent of growing Season	Days	Percent of growing Season	Days	Percent of growing Season
AW1	22	9	63	26	22	9	49	20	19	8	24	10	41	17
AW2	22	9	41	17	21	9	26	11	46	19	42	17	42	17
AW3	13	5	38	16	32	13	52	21	47	19	25	10	41	17
AW4	67	28	77	32	95	39	69	28	20	8	24	10	128	53
AW5	7	3	38	16	32	13	55	23	49	20	28	11	57	23
AW6	43	18	65	27	22	9	55	23	49	20	24	10	59	24
AW7	5	2	72	30	36	15	59	24	59	24	13	5	92	38
RAW1*	22	9	49	20	33	13	33	13	***	***	25	10	46	19
RAW2	10	4	19	8	15	6	6	2	***	***	8	3	12	5
RAW3	20	8	41	17	32	13	34	14	46	19	15	6	45	18

*MY4-2017 data only represents March 17, 2017 - May 2, 2017


**Gauge data after June 7, 2018 was determined to be unreliable due to inconsistent ambient pressure data

***Gauge malfunctioned in 2018


2020 Muddy Run II Groundwater Gauge AW1

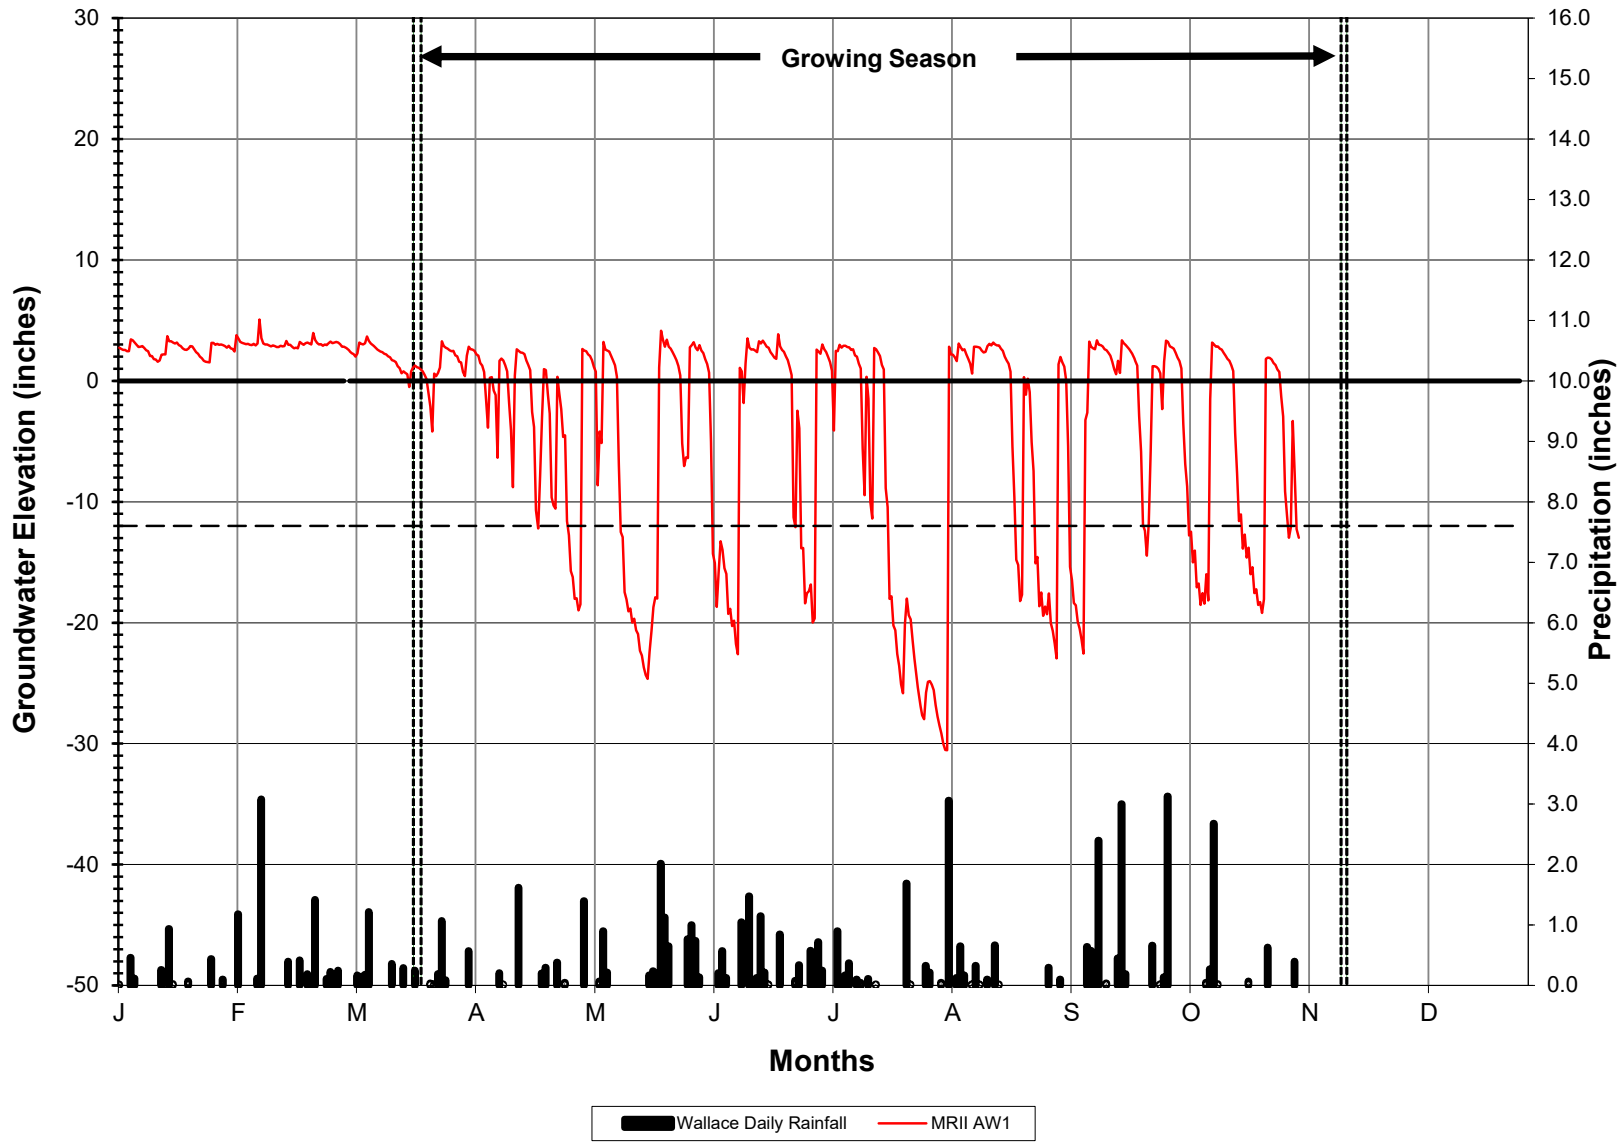


2020 Muddy Run II Groundwater Gauge AW2

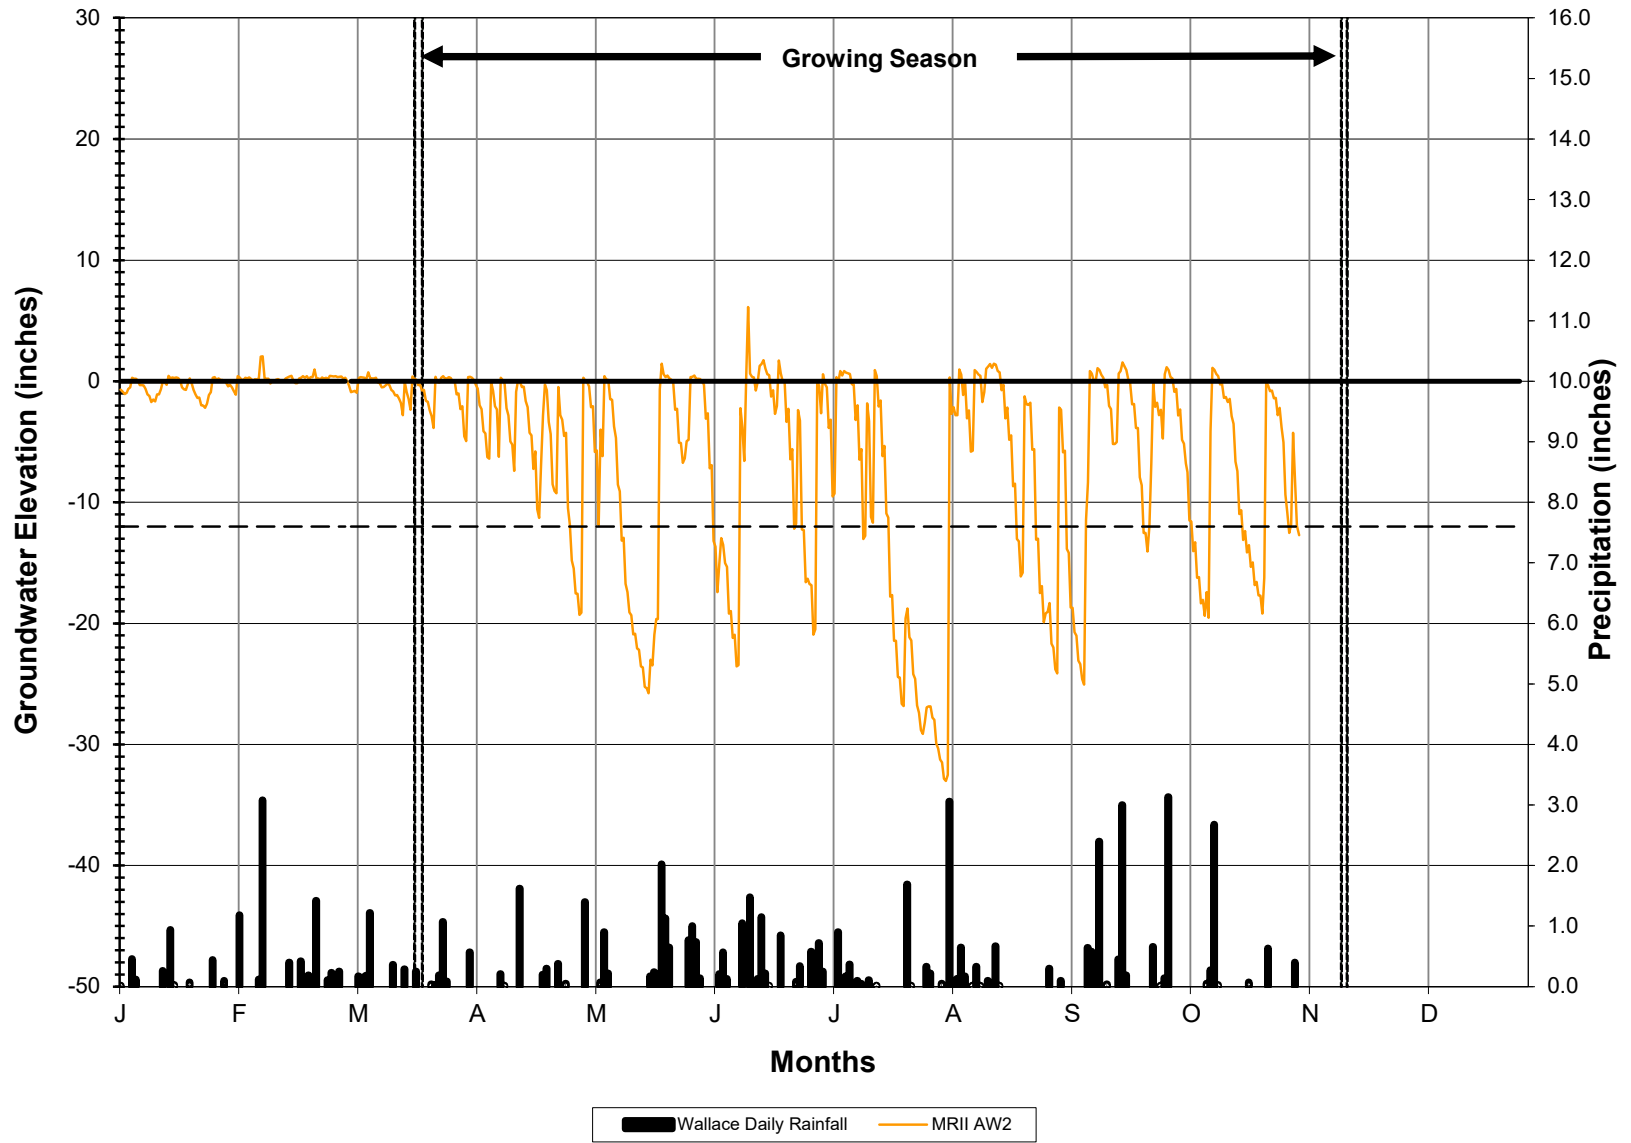


2020 Muddy Run II Groundwater Gauge AW3

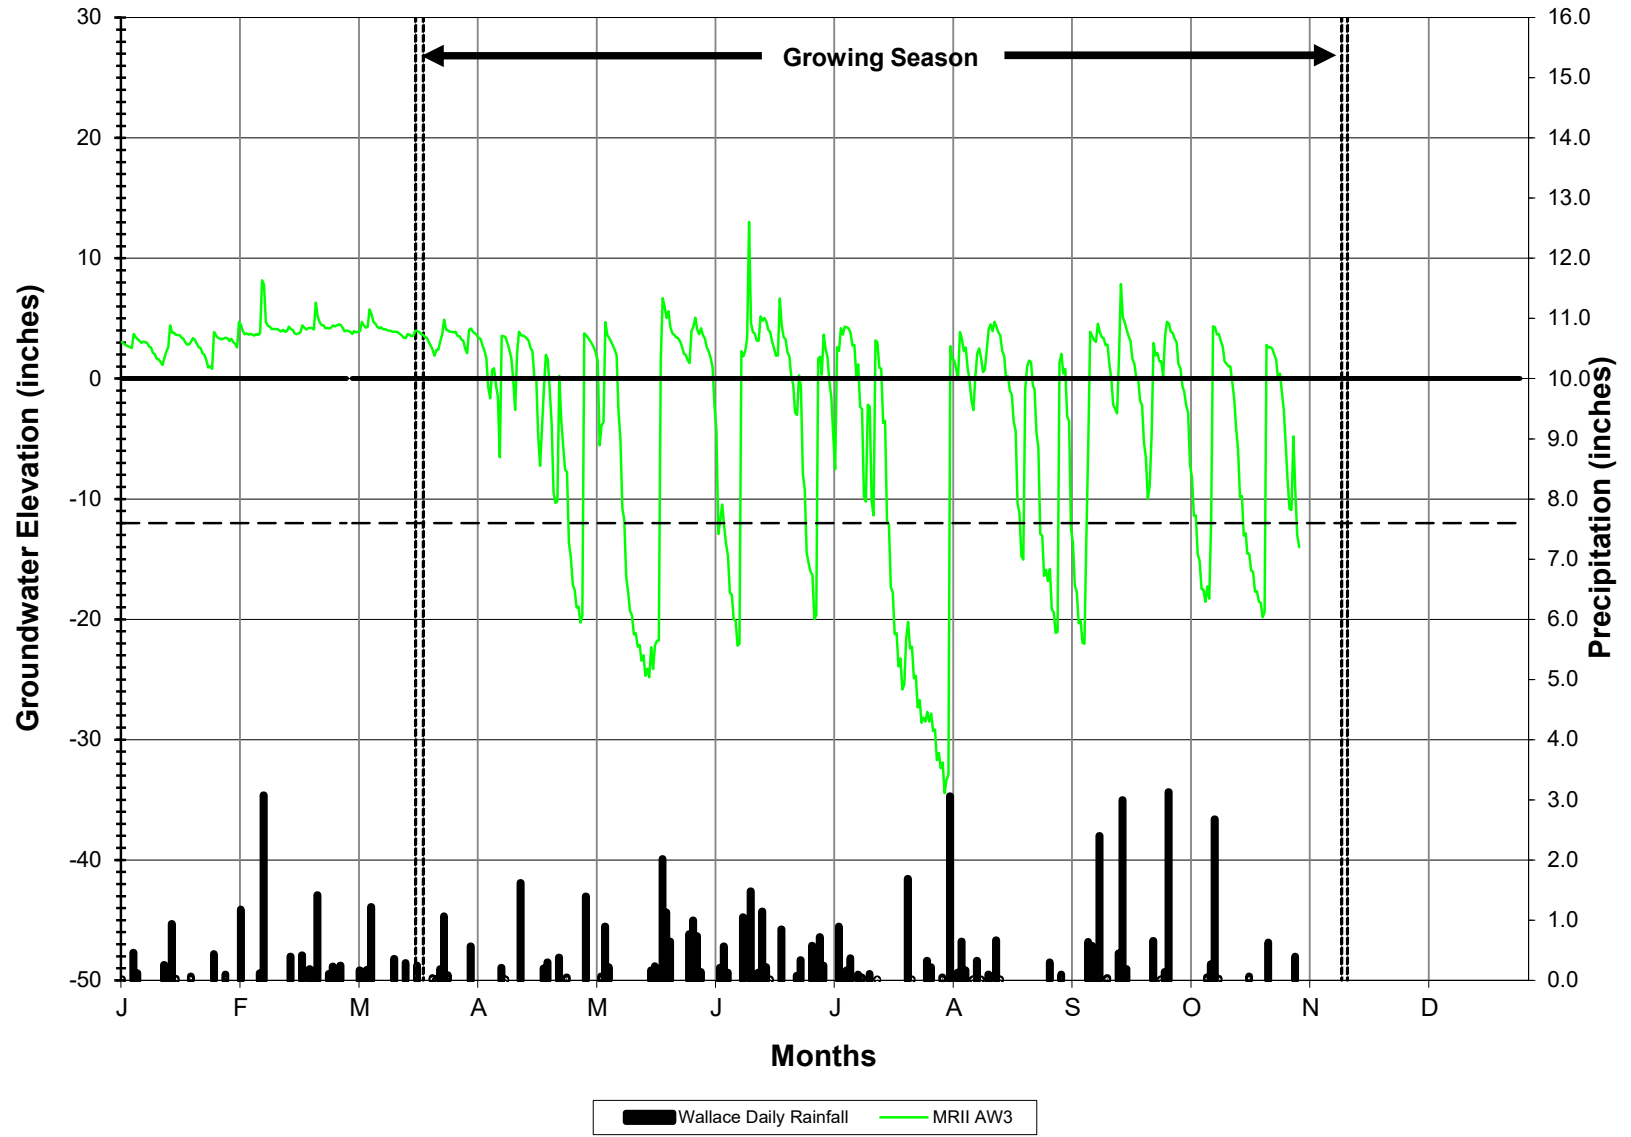


2020 Muddy Run II Groundwater Gauge AW4

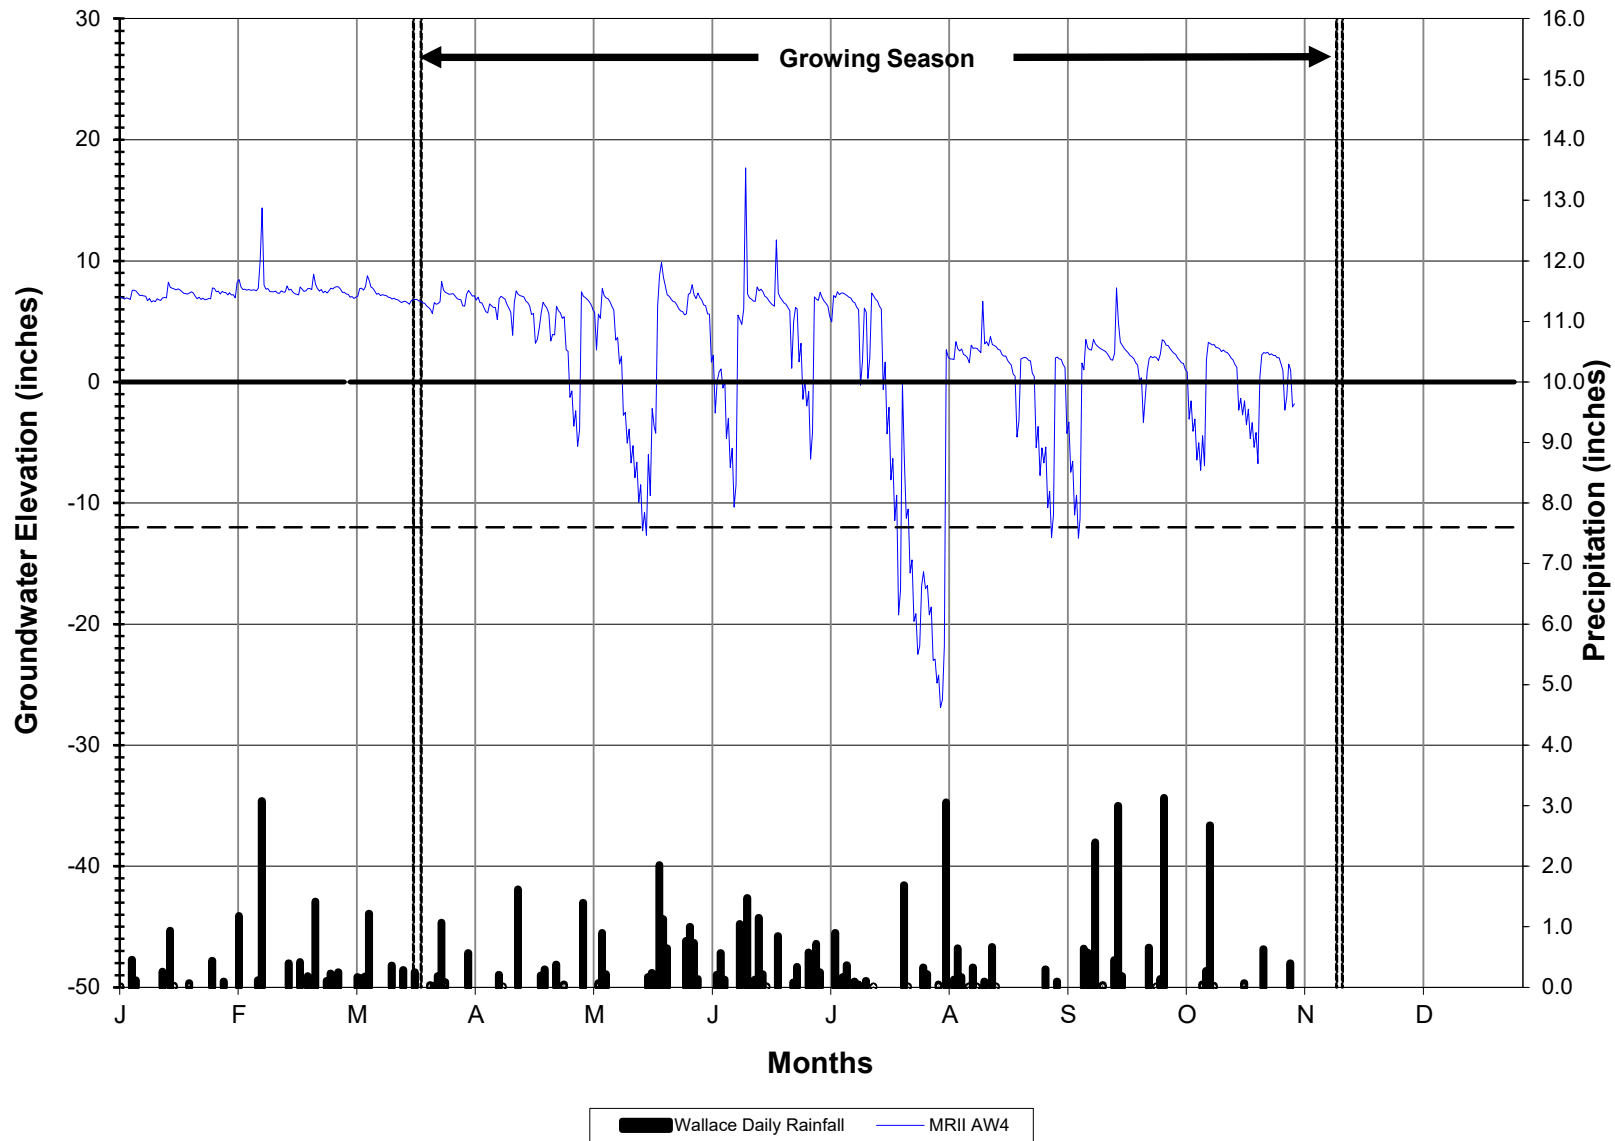


2020 Muddy Run II Groundwater Gauge AW5

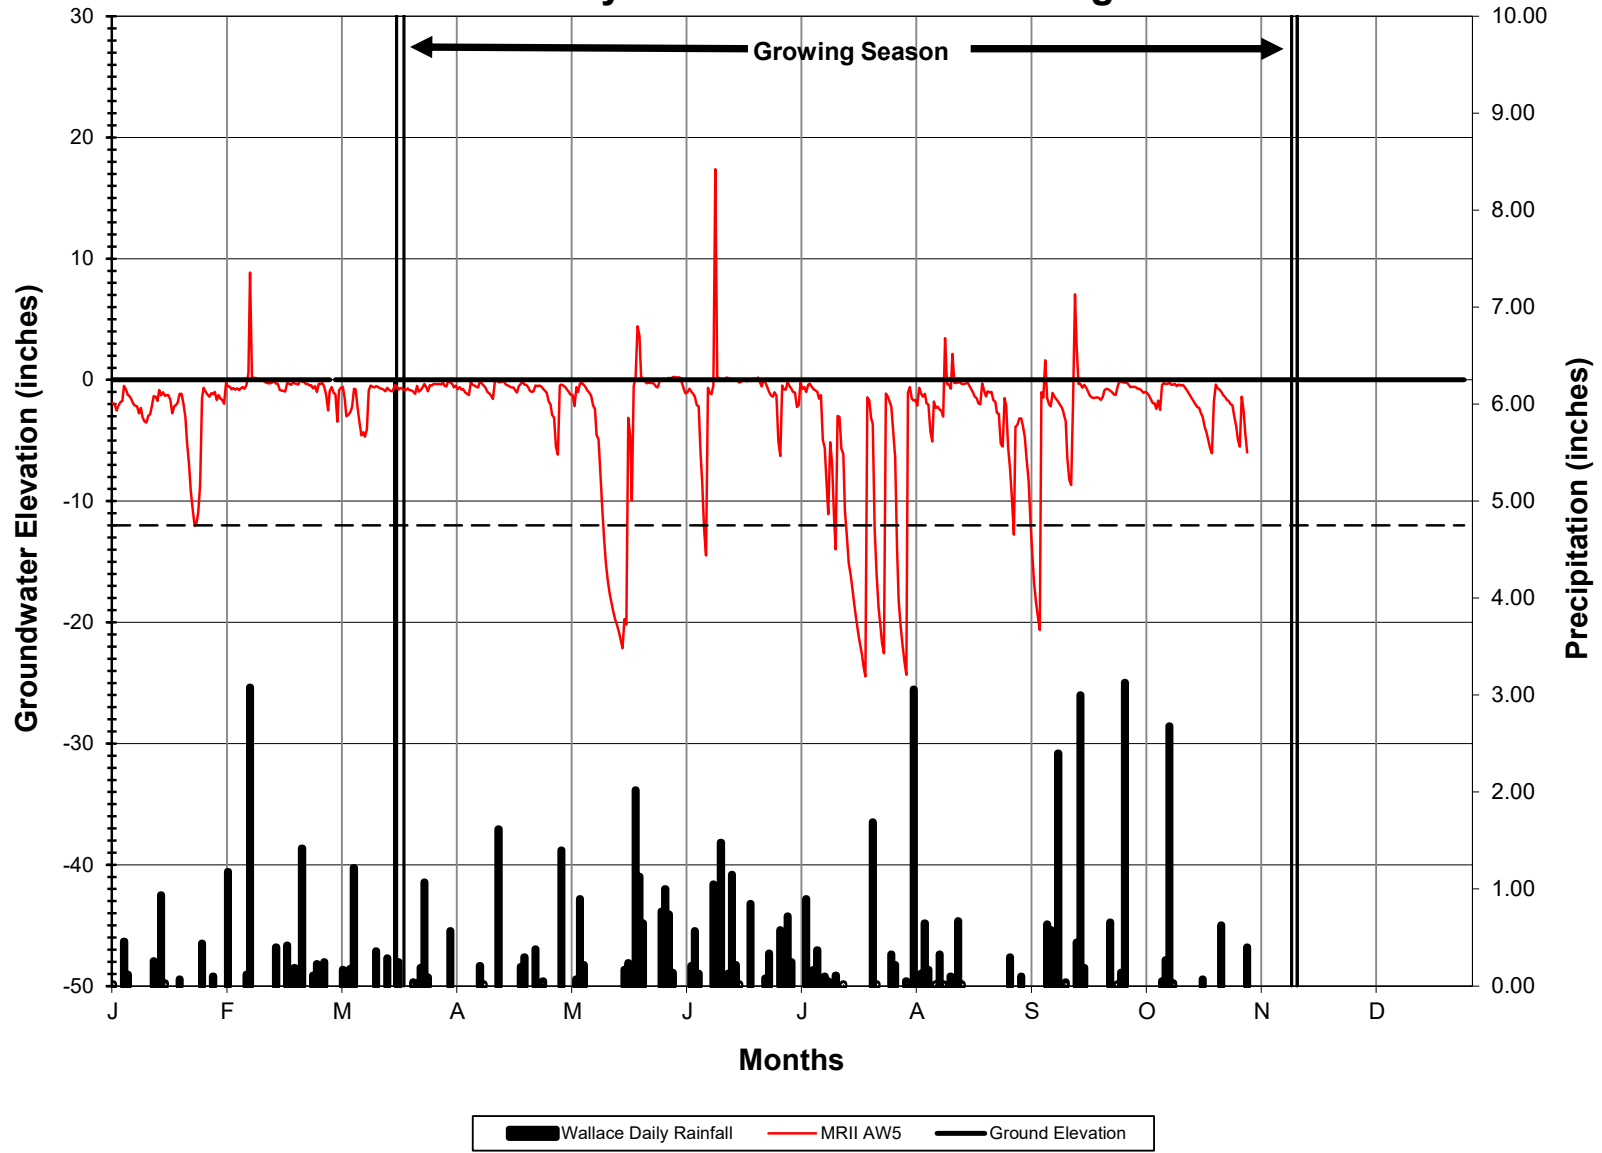


2020 Muddy Run II Groundwater Gauge AW6

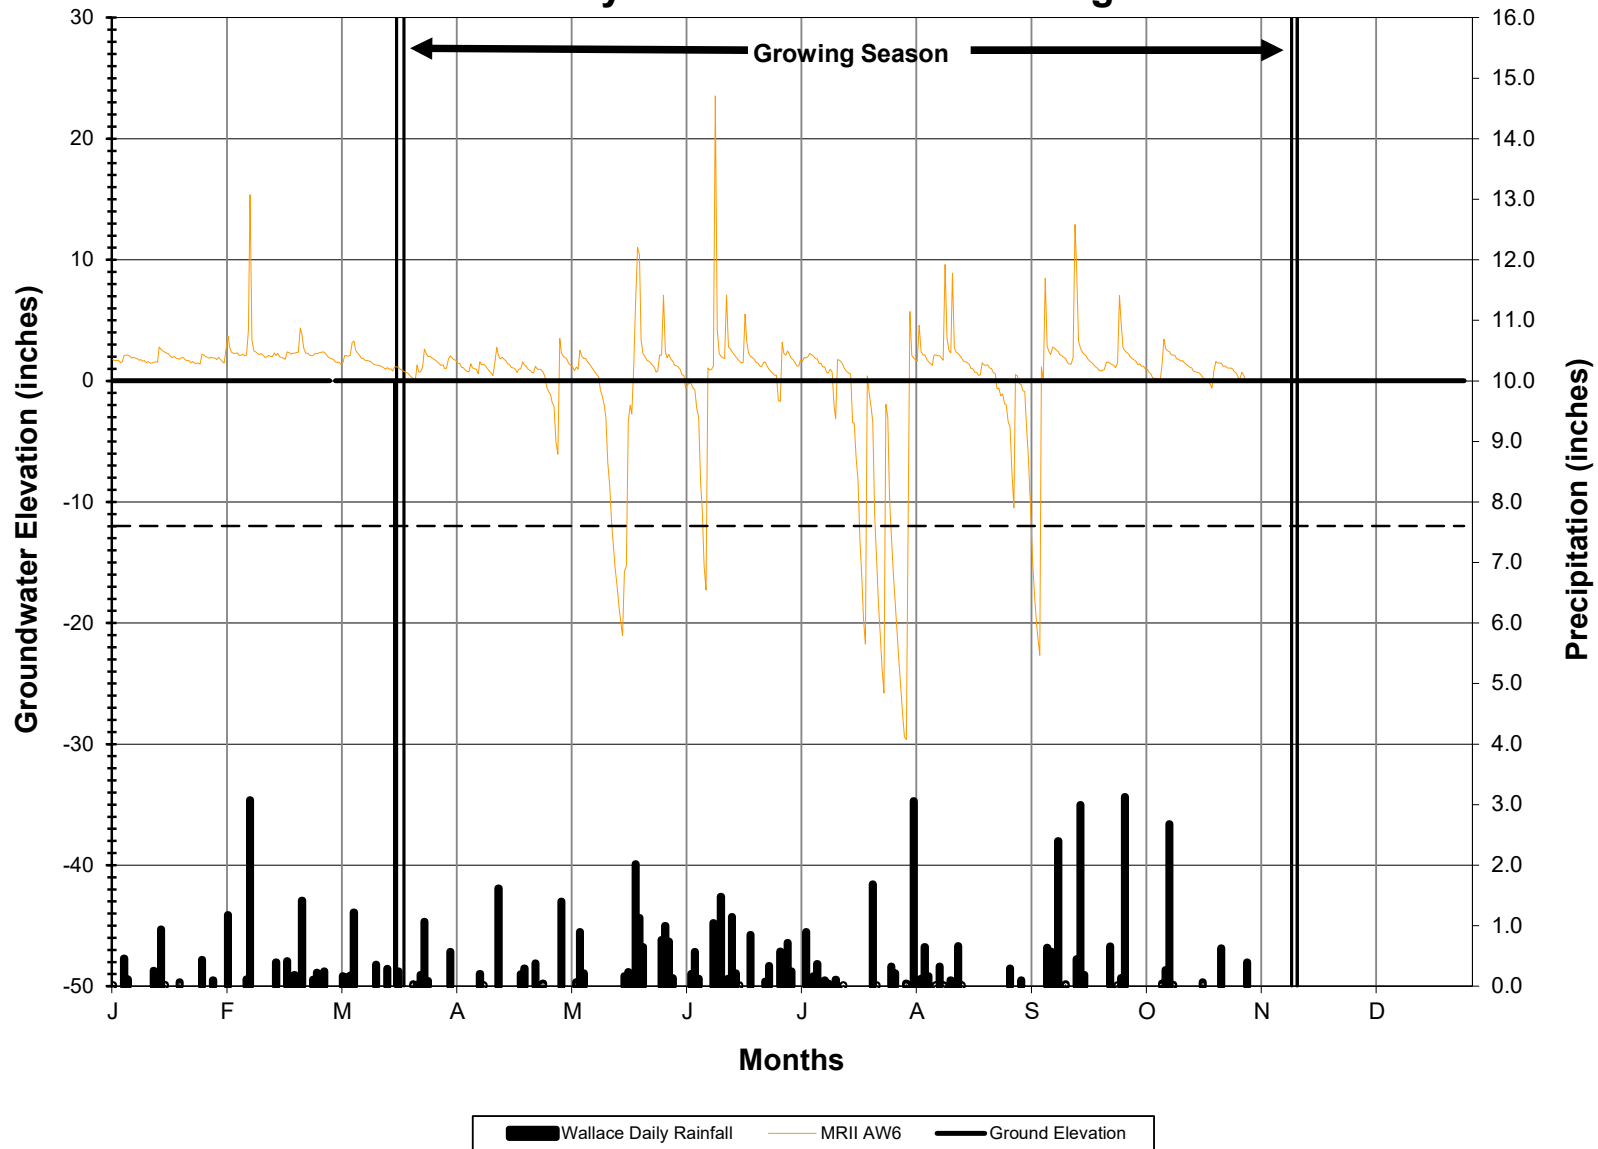


2020 Muddy Run II Groundwater Gauge AW7

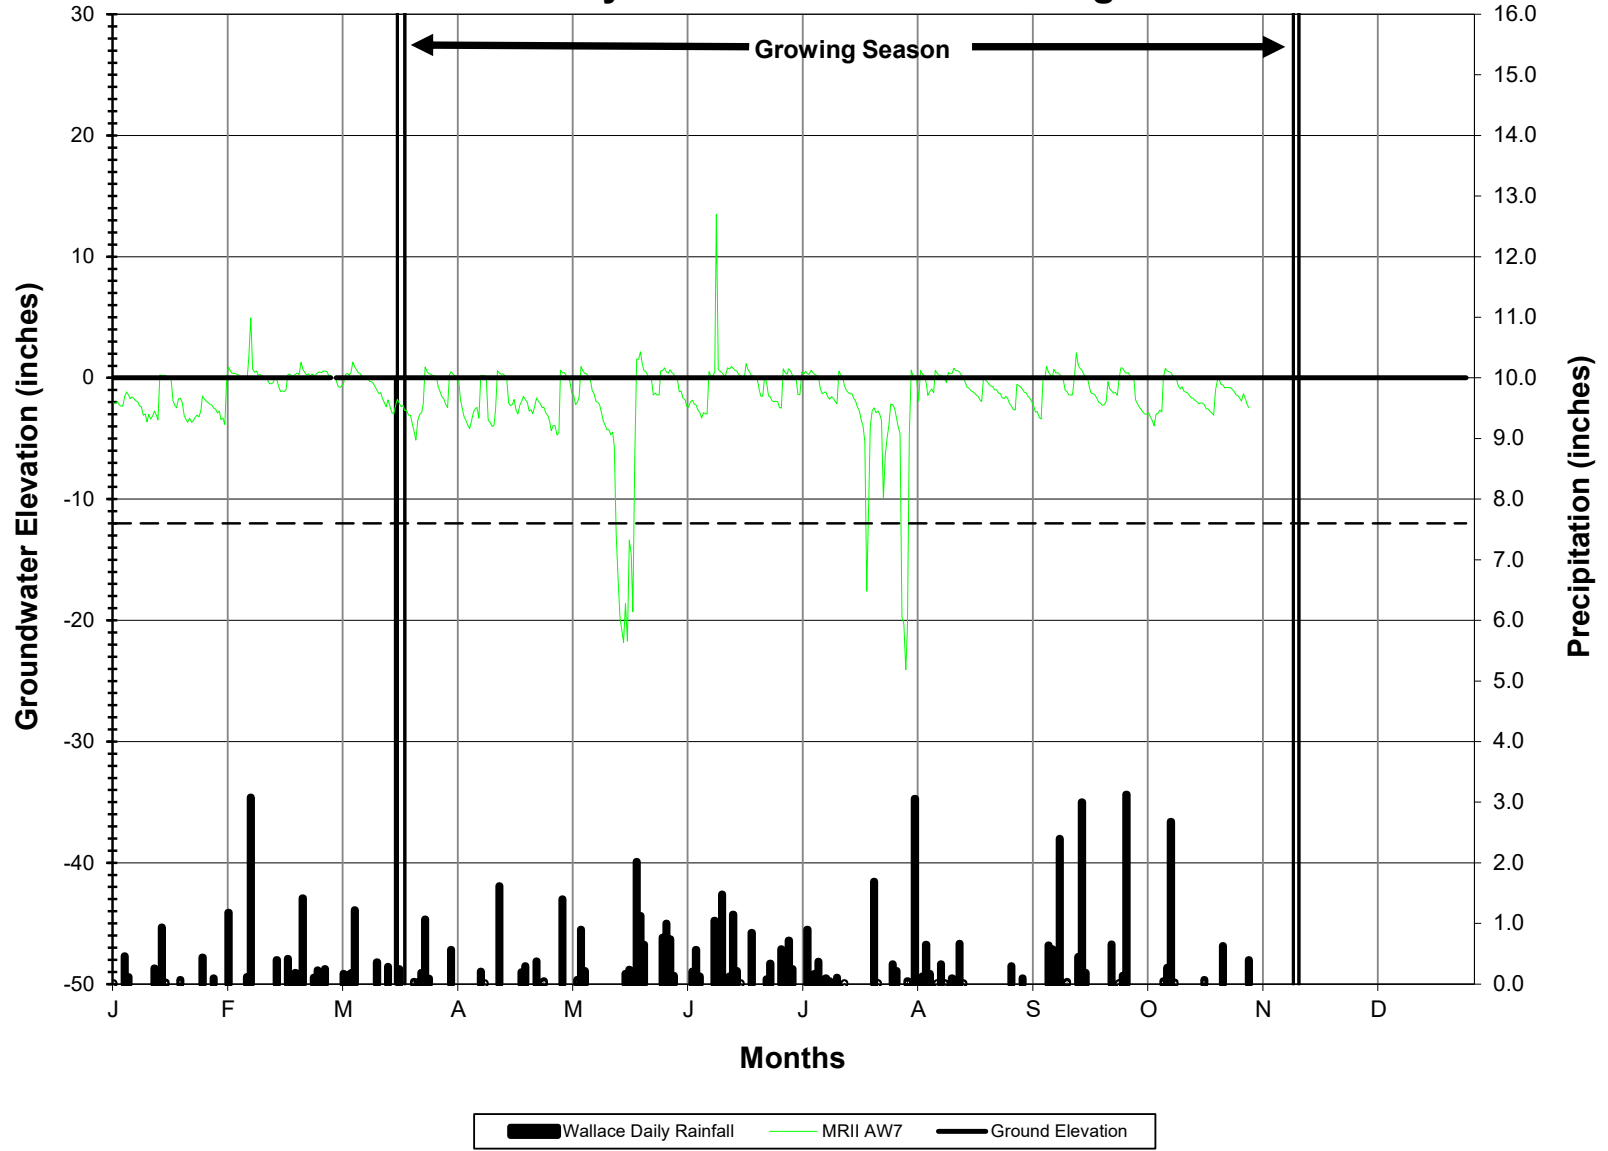

2020 Muddy Run II Groundwater Gauge REFAW1

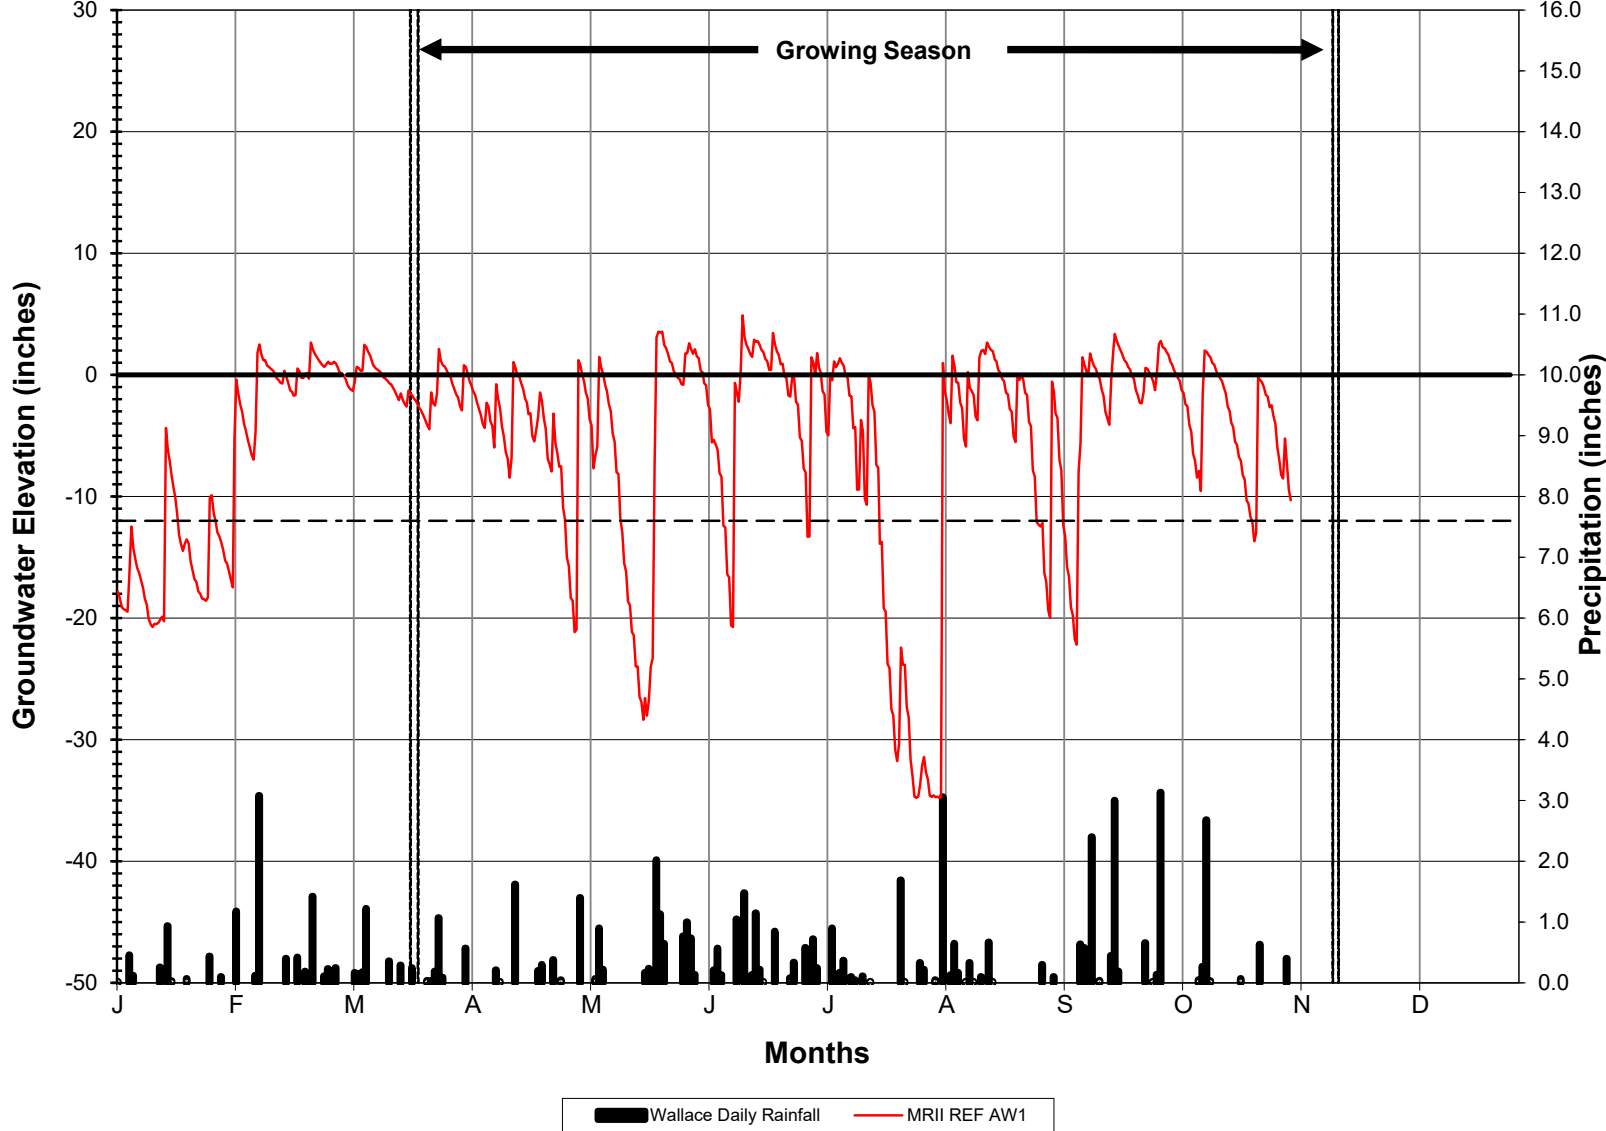

2020 Muddy Run II Groundwater Gauge REFAW2

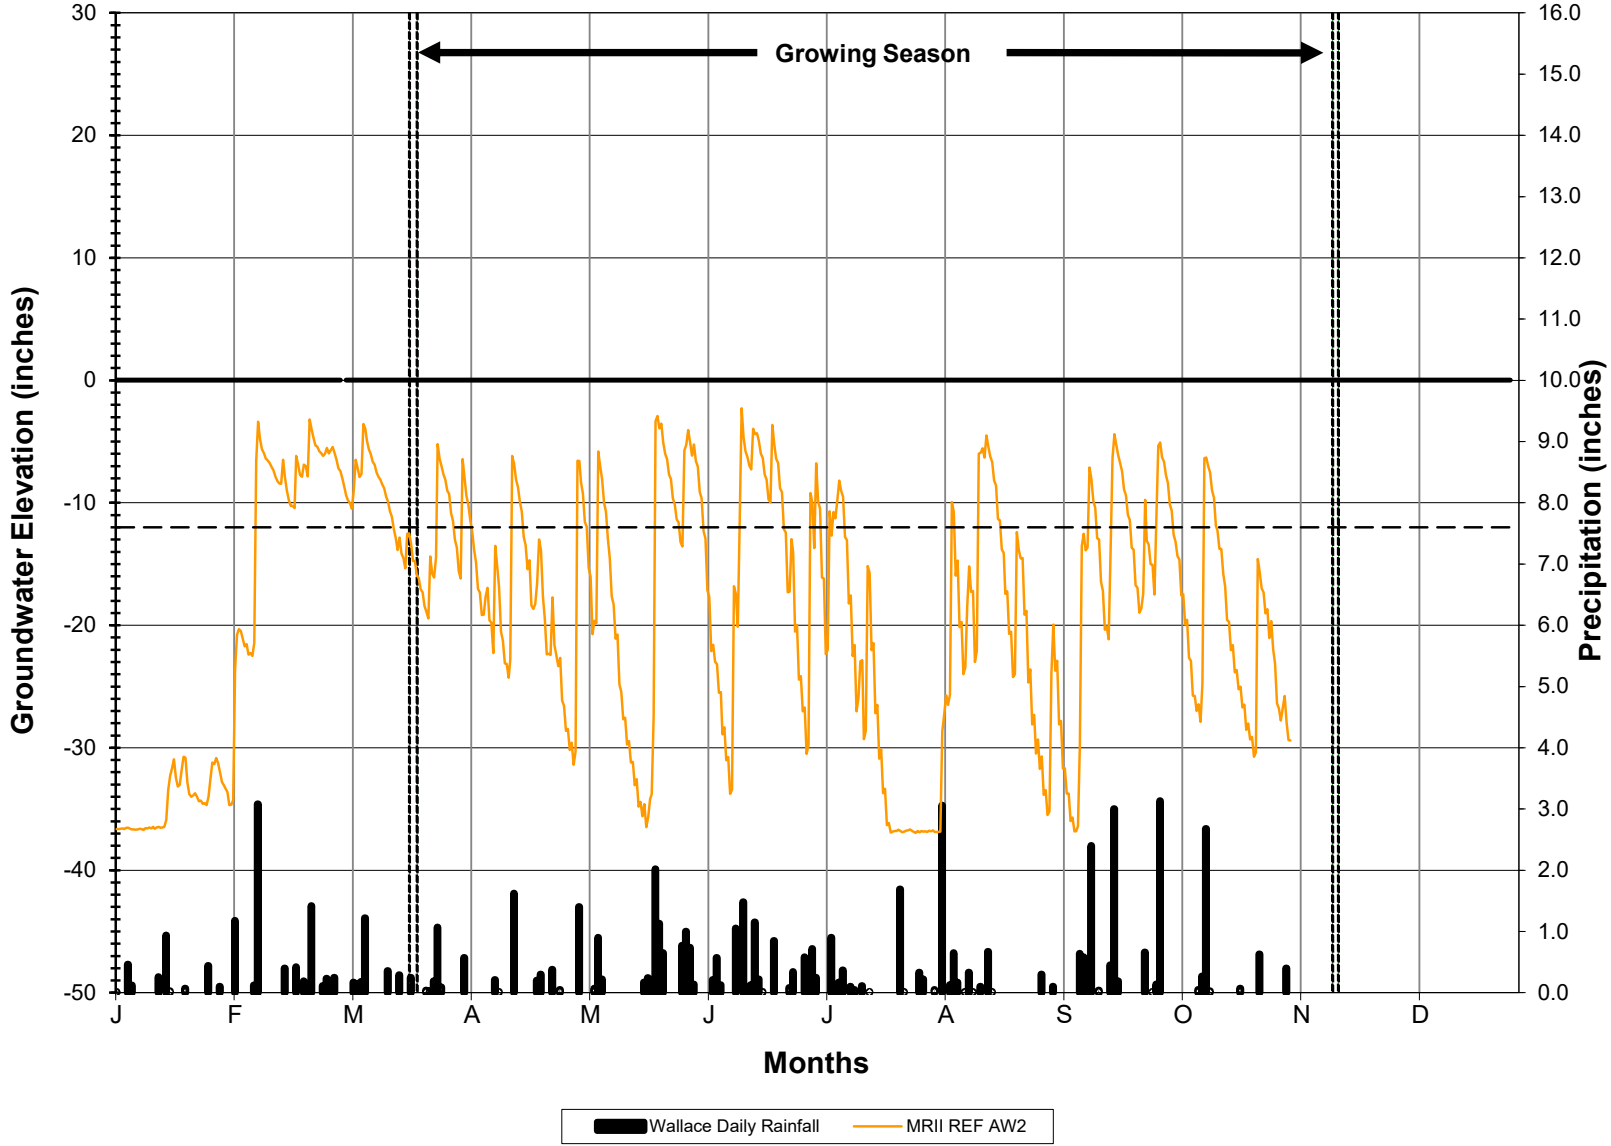

2020 Muddy Run II Groundwater Gauge REFAW3

